

Assembly Type ABSOLUTE Linear Scale

ABS AT1103A

ABS AT1143

ABS AT1153



User's Manual - Instructions for use -

Read this document thoroughly before operating the product. After reading, retain it close at hand for future reference.

This English language version of the document contains the original instructions.

No. 99MBE094B6

Date of publication: January 1, 2026 (1)



■ Product names and model numbers covered in this document


Product name	Model number
Assembly Type ABSOLUTE Linear Scale	ABS AT1103A
	ABS AT1143
	ABS AT1153

■ Notice regarding this document







- Mitutoyo Corporation assumes no responsibilities for any damage to the product, caused by its use not conforming to the procedure described in this document.
- Upon loan or transfer of this product, be sure to affix this document to the product.
- In the event of loss or damage to this document, immediately contact the agent where you purchased the product or a Mitutoyo sales office.
- Read this document thoroughly before operating the product. In particular, be sure to fully understand "Safety Precautions" on page 7 and "Precautions for Use" on page 7.
- The contents of this document are based on information current as of January 2026.
- No part or whole of this document may be transmitted or reproduced by any means without prior written permission of Mitutoyo Corporation.
- Some screen displays in this document may be highlighted, simplified or partially omitted for convenience of explanation. In addition, some of them may differ from actual ones to the extent that no user will misunderstand the functions and operations.
- The corporation, organization and product names that appear in this document are their trademarks or registered trademarks.


©2017-2026 Mitutoyo Corporation. All rights reserved.

Contents

Contents	1
About This Document	3
Conventions Used in This Document	4
Safety Precautions	7
Precautions for Use	7
Environment for placement	7
Electromagnetic Compatibility (EMC)	8
Export Control Compliance	8
Notes on Export to European Countries	8
Disposal of Products outside the European Countries	8
Disposal of Old Electrical & Electronic Equipment (Applicable in the European Countries with Separate Collection Systems)	9
China RoHS Compliance Information	9
Warranty	10
Disclaimer	10
1 Overview	11
1.1 Features	11 
1.2 Part Names and Features	12
1.3 Scale Unit Model Numbers	14
2 Advance Preparation	15
2.1 Check the Maximum Travel Distance and Effective Scale Length	15
2.2 Confirmation of Included Items	16
2.3 Signal Cable Preparation	17
2.3.1 Signal Cable Connection Direction	17
2.3.2 Cable Connection Example	18
2.3.3 Cable Bending Radius R Tolerance Range	20
2.4 Feedback Cable Preparation	21
2.4.1 Example of NC Device Wiring	21
2.4.2 Feedback Cable Length Calculation	23
2.4.3 Assembly of D Sub-Connector	24
2.4.4 Feedback Cable Diagram and Grounding to Ground Bar	26

*  indicates the link to a video.


2.5	Cover Installation	27	
2.6	Precautions Regarding Mounting Surface Design	28	
3	Attachment to the Machine Body.....	29	
3.1	Procedure for Attachment to the Machine Body	29	
3.2	Installation and Positional Adjustment of the Scale Main Body	29	
3.2.1	Check the Mounting Surface, etc.	29	
3.2.2	Installation of Scale Main Body	30	
3.3	Mounting the Detector and Adjusting Its Position	33	
3.4	Signal Cable Connection and Fastening	38	
3.4.1	Connecting Cables and Verifying Operation	38	
3.4.2	Cable Fastenings and Precautions	41	
3.5	Air Purging	43	
3.5.1	Flow Rate of Air Supply to the Scale Unit.....	43	
3.5.2	Recommended Air Equipment	43	
3.5.3	Connection Method	45	
4	Alarm detection function	47	
4.1	Alarm Detection Function	47	
4.2	Meaning of Alarm Codes.....	48	
5	Specifications	51	
5.1	Scale Unit Specifications.....	51	
5.2	Optional Accessories	56	
5.2.1	Signal Cable: Unfinished Cable Specification	56	
5.2.2	Signal Cable: Mitutoyo Connector Specification	57	
5.2.3	Signal Cable: Fanuc Connector Specification	58	
5.2.4	Signal Cable: Mitsubishi Electric Connector Specification	59	
6	Troubleshooting	61	
7	Appendix.....	63	
7.1	Quantity of Accessories Used for Installation	63	
SERVICE NETWORK		App-1	

*  indicates the link to a video.

About This Document

■ Positioning of this document, document map

The position of this document and its relationship to the other subsections are as follows.

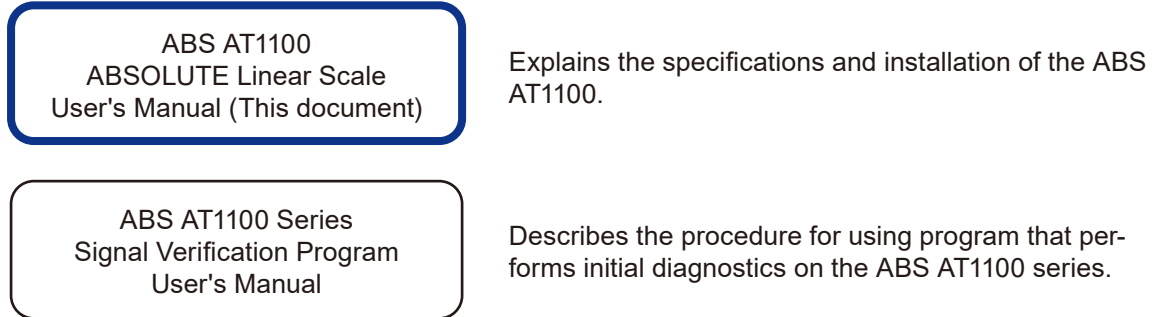

■ Intended readers and purpose of this document

● Intended readers

This product is attached for use to a variety of equipment, including NC machine tools and semiconductor manufacturing equipment. This document is intended for those who will be performing the installation.



The readers are assumed to be capable of reading the drawings and understanding the directions.

● Purpose




The purpose of this document is to help you understand the specifications of this product and how to properly install it.

Conventions Used in This Document



■ Safety reminder conventions warning against potential hazards

 CAUTION	Indicates a hazard with a low level of risk which, if not avoided, could result in minor or moderate injury.
	Indicates a situation which, if not avoided, may result in property damage.



■ Conventions indicating prohibited and mandatory actions

	Indicates concrete information about prohibited actions.
	Indicates concrete information about mandatory actions.
	Indicates that grounding needs to be implemented.

■ Conventions indicating referential information or reference location

IMPORTANT	Indicates information that must be known when using the product.
Tips	Indicates further information and details relevant for the operating methods and procedures that are explained in that section.
	Indicates reference location if there is information that should be referred to in this document or an extraneous User's Manual. Example: For details about XX, see  "1.2 Part Names and Features" on page 12 in "1 Overview".

■ Conventions indicating video content

	<p>A QR code that can be read with a smartphone or other device to view a video.</p>
	<p>A button that can perform in PDF format User's Manuals. Click the button to view a video.</p>

*Video content does not include audio. Video size is 1280 x 720.

■ Other conventions

(): Round brackets	Represent a paraphrase of an immediately preceding phrase or a supplementary explanation.
" ": Double quotation marks	Represent a highlighted phrase. They also indicate an index where information to be referenced is described.
[]: Square brackets	Represent a menu name on the screen, screen name, dialog name, button, display item, tab name, or key on the keyboard. They also indicate an item to be purposely entered or selected by the customer.
<p>1, 2, 3</p> <p>1, 2, 3, ...</p>	<p>Indicates the order and the contents of tasks.</p> <p>(1): indicates main tasks, 1: indicates detailed tasks)</p>
»	Indicates the action resulted from some operation(s).

■ Example of conventions use

3

Attachment to the Machine Body

3 Attachment to the Machine Body

3.2.2 Installation of Scale Main Body

You can check the installation procedure for the scale

1 **Temporarily affix the scale main body to the scale mounting surface on the machine body.**
 Use provided screws as indicated below to temporarily secure the scale main body to the extent that it will not move even if you remove your hand from the scale main body.

- Fully-fixed fastening points (elongation base point position with respect to temperature change)
Hexagon socket head cap screws M6x30 + Internal lock washers
- Flexible fastening points
Hexagon socket screws M6x30 + flat washers (small round) + specialized plate spring

Do not fasten the detector at this time.

Tips

- The number of fully-fixed fastening point holes depends on the overall length of the scale.
For details, see "Appearance and installation dimensions table" on page 55.
- Two screws are used for the fully-fixed fastening points.
For details, see "Note regarding appearance and installation dimensions" on page 54.

NOTICE

Do not remove the detector fixing block. Detector failure may result.

The detector fixing block determines the positional relationship between the scale main body and the detector. This positional relationship is maintained when the scale unit is attached to the machine body.

30
No. 99MBE094B

Indicates a link to a video.

Indicates an operating procedure to be performed or its outline.

Indicates supplementary information.

Safety Precautions

Observe the following descriptions to make full use of the performance of this product.

CAUTION

Improper installation and mishandling carries a risk of injury.



- Read this document thoroughly before operating the system to use it properly.
- Before installing this product on the machine body, make sure that the power to the control unit is turned off. There is a risk of injury or damage to the machine due to unintended machine operation.



Screws on the connectors of each connecting cable should be firmly tightened to ensure dustproofing, waterproofing, and noise suppression. Also, to prevent defective contacts, do not touch the connecting terminals of the connectors with bare hands.

Precautions for Use

■ Use and handling of the product

- This product is attached for use to compatible equipment such as NC machine tools and semiconductor manufacturing equipment.

This product cannot be used with NC machine tools and semiconductor manufacturing equipment that are not compatible with this product.

For NC machine tools and semiconductor manufacturing equipment that are compatible with this product, contact the agent where you purchased the product or Mitutoyo sales representative (☎ "SERVICE NETWORK" on page App-1).

- This product is for industrial usage.

Do not use this product for purposes other than for industrial usage.

- The product is a precision instrument.

- Do not subject the product to drastic shocks such as dropping it, or exert excessive force upon it.
- Do not disassemble or modify the product. Also, such actions are not covered by warranty.

If the product is used beyond the conditions indicated in the specifications (☞ "5 Specifications" on page 51), be aware that the functions and performance cannot be guaranteed.

Environment for placement

■ Vibration

When installing this product on the machine body, install it in a location with as little vibration as possible.

Prolonged use in areas that are subject to high vibration may result in malfunction of internal precision components and affect performance.

■ Protection against shock, dust, and water

To prevent this product from being subjected to a strong shock due to impact by a workpiece or other object being measured and to protect the scale main body from direct exposure to cutting oil or chips, please provide a cover that covers the entire scale main body.

■ Ambient temperature and humidity

This product should be operated in an environment where the temperature is between 0 °C and 50 °C and where the relative humidity is between 20 % and 80 % RH. Do not use this product in a place where sudden changes in temperature or humidity are observed.

Electromagnetic Compatibility (EMC)

This product complies with the EMC Directive and the UK Electromagnetic Compatibility Regulations; however, if this receives electromagnetic interference that exceeds these requirements, it will be out of warranty and require appropriate measures.

This product is an industrial product, and is not intended to be used in residential environment. If this product is used in residential environment, this product may cause electromagnetic interference with other instruments. In such a case, it is required to take appropriate measures for preventing such electromagnetic interference.

Export Control Compliance

This product falls into the Catch-All-Controlled Goods and/or Catch-All-Controlled Technologies (including Programs) under Category 16 of Appended Table 1 of Export Trade Control Order or under Category 16 of Appended Table of Foreign Exchange Control Order, based on Foreign Exchange and Foreign Trade Act of Japan.

If you intend re-export of the product from a country other than Japan, re-sale of the product in a country other than Japan, or re-providing of the technology (including Programs), you shall observe the regulations of your country.

Also, if an option is added or modified to add a function to this product, this product may fall under the category of List-Control Goods, List-Control Technology (including Programs) under Category 1 - 15 of Appended Table 1 of Export Trade Control Order or under Category 1 - 15 of Appended Table of Foreign Exchange Control Order, based on Foreign Exchange and Foreign Trade Act of Japan. In that case, if you intend re-export of the product from a country other than Japan, re-sale of the product in a country other than Japan, or re-providing of the technology (including Programs), you shall observe the regulations of your country. Please contact Mitutoyo in advance.

Notes on Export to European Countries

When you intend exporting of this product to any of the European countries, it may be required to provide User's Manual(s) in English and Declaration of Conformity in English (in some cases, the official language of the country to be exported). For detailed information, please contact Mitutoyo in advance.

Disposal of Products outside the European Countries

Please follow the official instruction in each community and country.

Disposal of Old Electrical & Electronic Equipment (Applicable in the European Countries with Separate Collection Systems)



This symbol on the product or on its packaging is based on WEEE Directive (Directive on Waste Electrical and Electronic Equipment), and this symbol indicates that this product shall not be treated as household waste.



To reduce the environmental impact and minimize the volume of landfills, please cooperate in reuse and recycle.

For how to dispose of the product, please contact the agent where you purchased the product or a Mitutoyo sales office.

China RoHS Compliance Information

This product meets China RoHS requirements. See the table below.

产品中有害物质的名称及含量

部件名称	有害物质					
	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr(VI))	多溴联苯 (PBB)	多溴二苯醚 (PBDE)
本体	○	○	○	○	○	○
电气设备部分	×	○	○	○	○	○
配件	○	○	○	○	○	○

部件名称	有害物质			
	邻苯二甲酸 二正丁酯 (DBP)	邻苯二甲酸 二异丁酯 (DIBP)	邻苯二甲酸 丁基苯酯 (BBP)	邻苯二甲酸 二(2-乙基己)酯 (DEHP)
本体	○	○	○	○
电气设备部分	○	○	○	○
配件	○	○	○	○

本表格依据 SJ/T 11364 的规定编制。

○: 表示该有害物质在该部件所有均质材料中的含量均在 GB/T 26572 规定的限量要求以下。

×: 表示该有害物质至少在该部件的某一均质材料中的含量超出 GB/T 26572 规定的限量要求。



环保使用期限标识是根据《电器电子产品有害物质限制使用管理办法》以及《电器电子产品有害物质限制使用标识要求(SJ/T11364-2024)》制定的,适用于中国境内销售的电子电气产品的标识。

电器电子产品只要按照安全及使用说明内容在正常使用情况下,从生产日期算起,在此期限内产品中含有的有毒有害物质不致发生外泄或突变,不致对环境造成严重污染或对其人身、财产造成严重损害。

产品使用后,要废弃在环保使用年限内或者刚到年限的产品,请根据国家标准采取适当的方法进行处置。

另外,此期限不同于质量/功能的保证期限。

Warranty

This product has been manufactured under strict quality management, but should it develop problems within one year of the date of purchase in normal use, repair shall be performed free of charge. Please contact the agent where you purchased the product or Mitutoyo sales representative (☎ "SERVICE NETWORK" on page App-1).

If this product fails or is damaged for any of the following reasons, it will be subject to a repair charge, even if it is still under warranty.

- Failure or damage owing to fair wear and tear
- Failure or damage owing to inappropriate handling, maintenance or repair, or to unauthorized modification
- Failure or damage owing to transport, dropping, or relocation of the product after purchase
- Failure or damage owing to fire, salt, gas, abnormal voltage, lightning surge, or natural disaster
- Failure or damage owing to use in combination with hardware or software other than those designated or permitted by Mitutoyo
- Failure or damage owing to use in ultra-hazardous activities

This warranty is effective only where the product is properly installed and operated in conformance with the instructions in this document within the original country of the installation.

EXCEPT AS SPECIFIED IN THIS WARRANTY, ALL EXPRESS OR IMPLIED CONDITIONS, REPRESENTATIONS, AND WARRANTIES OF ANY NATURE WHATSOEVER INCLUDING, WITHOUT LIMITATION, ANY IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, NONINFRINGEMENT OR WARRANTY ARISING FROM A COURSE OF DEALING, USAGE, OR TRADE PRACTICE, ARE HEREBY EXCLUDED TO THE MAXIMUM EXTENT ALLOWED BY APPLICABLE LAW.

You assume responsibility for all results due to the selection of this product to achieve your intended results.

Disclaimer

IN NO EVENT WILL MITUTOYO, ITS AFFILIATED AND RELATED COMPANIES AND SUPPLIERS BE LIABLE FOR ANY LOST REVENUE, PROFIT, OR DATA, OR FOR SPECIAL, DIRECT, INDIRECT, CONSEQUENTIAL, INCIDENTAL, OR PUNITIVE DAMAGES HOWEVER CAUSED AND REGARDLESS OF THE THEORY OF LIABILITY ARISING OUT OF THE USE OF OR INABILITY TO USE THIS PRODUCT EVEN IF MITUTOYO OR ITS AFFILIATED AND RELATED COMPANIES AND/OR SUPPLIERS HAVE BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.

If, notwithstanding the foregoing, Mitutoyo is found to be liable to you for any damage or loss which arises out of or is in any way connected with use of this product by you, in no event shall Mitutoyo's and/or its affiliated and related companies' and suppliers' liability to you, whether in contract, tort (including negligence), or otherwise, exceed the price paid by you for the product only.

The foregoing limitations shall apply even if the above-stated warranty fails of its essential purpose. BECAUSE SOME COUNTRIES, STATES OR JURISDICTIONS DO NOT ALLOW THE EXCLUSION OR THE LIMITATION OF LIABILITY FOR CONSEQUENTIAL OR INCIDENTAL DAMAGES, IN SUCH COUNTRIES, STATES OR JURISDICTIONS, MITUTOYO'S LIABILITY SHALL BE LIMITED TO THE EXTENT PERMITTED BY LAW.

1 Overview

This chapter describes the features of this product and the names and functions of its parts.

1.1 Features	11
1.2 Part Names and Features	12
1.3 Scale Unit Model Numbers	14

1.1 Features

See an example of a sliding device with ABS AT1100 attached.



This product is an absolute linear scale that employs electromagnetic induction.

The linear scale, which is a length measuring unit, outputs the amount of movement and displacement as a digital quantity based on a scale with fixed-pitch graduations. It can accurately capture the travel of a wide variety of equipment, including NC machine tools and semiconductor manufacturing equipment. The absolute function measures all position coordinates from a fixed origin, regardless of the last previously measured coordinates. In addition, the machine does not require a return to origin at the start of work or in the event of power failure, and does not require a backup battery, resulting in a significant labor savings.

The use of an electromagnetic induction system, which is less susceptible to problems caused by the entry of foreign matter, allows the unit to be used in environments where chips, cutting oil, etc. are generated.


Several different types are available with different effective scale lengths.

1.2 Part Names and Features

Part names

This section explains the names and features of each part.

This product is generally referred to as the "scale unit". The scale unit consists of the scale main body and the detector.

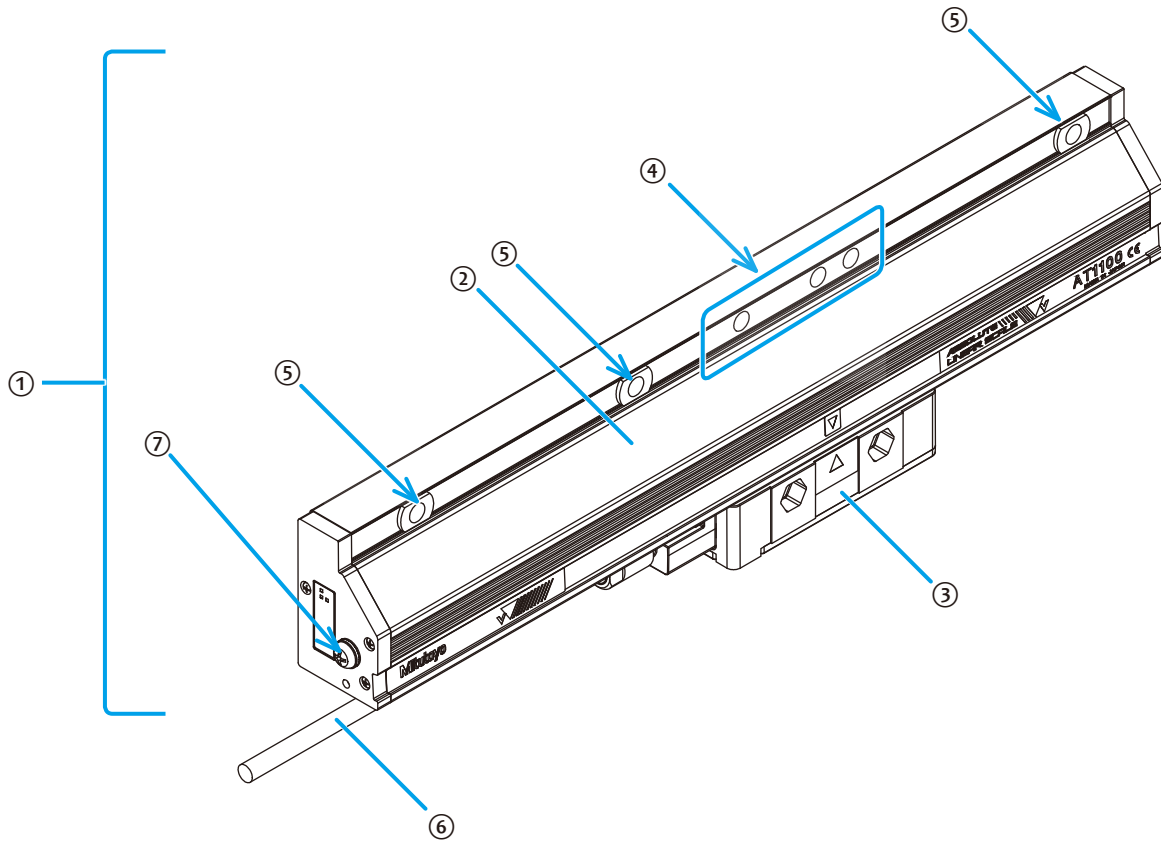

No.	Name	Description
①	Scale unit	"Scale unit" is the generic name for this product, which includes the scale main body and the detector.
②	Scale main body	The scale is installed internally.
③	Detector	The detector is a sensor that reads the scale position.
④	Fully-fixed fastening points	This is the base point for elongation with respect to change in temperature (the base point of mechanical expansion and contraction of the scale due to temperature change). This is the part to be fastened first upon attachment to the machine body.
⑤	Flexible fastening points	This is the part to be fixed afterwards when attaching to the machine body.
⑥	Signal cable (optional accessory)	This cable connects this product to the NC device with which it is used. The signal cable can be connected on either the left or right side of the detector.
⑦	Air supply ports (both sides, M5 screws)	To improve environmental robustness (coolant and dust resistance) of this product, clean compressed air can be supplied to the interior of the scale main body through these ports.


■ ABS origin and elongation base point

The fastening points of the scale main body are divided into a "fully-fixed fastening points" and "flexible fastening points".

The "elongation base point", which is the origin of mechanical expansion and contraction of the scale due to temperature changes, is the position indicated in the figure below.

The position of the electrical ABS origin inside the scale is set at the elongation base point.

Note that the elongation base point cannot be changed by the customer.

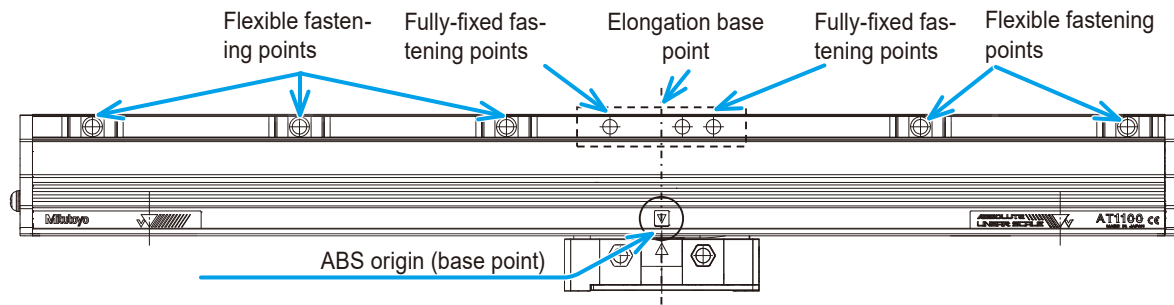


Tips

- The number of flexible fastening points depends on the effective scale length.
- To stabilize temperature characteristics of the overall system, it is recommended that the scale be installed so that the elongation base point of the scale main body is located close to the center of behavioral change with respect to temperature variation of the machine body.


■ Counter direction

Output serial data increases (counting on the + side) when the direction of movement of the detector is to the right in the positional relationship shown in the figure below.

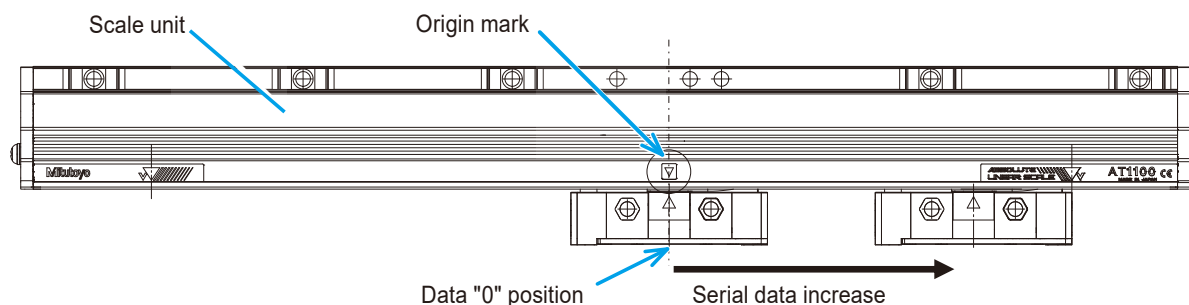

1.3 Scale Unit Model Numbers

This section describes scale unit specifications indicated by the model number. Please confirm that the specifications match those of the equipment to be installed.

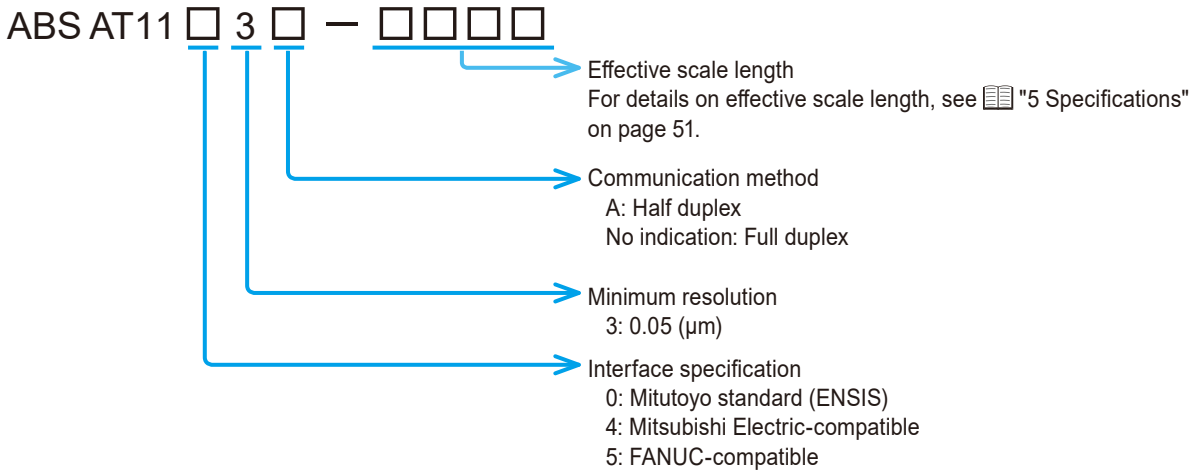

● Interface specification: Model number of applicable system and scale unit

Applicable system		Scale unit model number
FANUC CORPORATION	Serial α interface	ABS AT1153
	Serial αi interface	
Mitsubishi Electric Corporation	Mitsubishi CNC Series control unit	ABS AT1143
	MDS-D/MDS-DH Series	
Mitutoyo standard (ENSIS) servo amplifiers		ABS AT1103A

For information on NC devices (such as servo amplifiers and controllers) that can be connected, contact the respective device manufacturers. For the Mitutoyo standard (ENSIS), contact the manufacturer of NC devices that can be connected.

2 Advance Preparation


This chapter describes advance preparations for attaching this product to the machine body.

2.1	Check the Maximum Travel Distance and Effective Scale Length	15
2.2	Confirmation of Included Items	16
2.3	Signal Cable Preparation	17
2.4	Feedback Cable Preparation	21
2.5	Cover Installation	27
2.6	Precautions Regarding Mounting Surface Design	28


2.1 Check the Maximum Travel Distance and Effective Scale Length

Check the maximum travel distance and effective scale length of the scale main body.

Make sure that the maximum travel distance (L_1) of the scale main body is greater than the maximum travel distance of the machine to which it is to be attached.

For details on effective scale length (L_0) and maximum travel distance (L_1), see  "■ Appearance and installation dimensions" on page 53.

Also, please note that the guaranteed accuracy range of this product is the range covered by effective scale length.

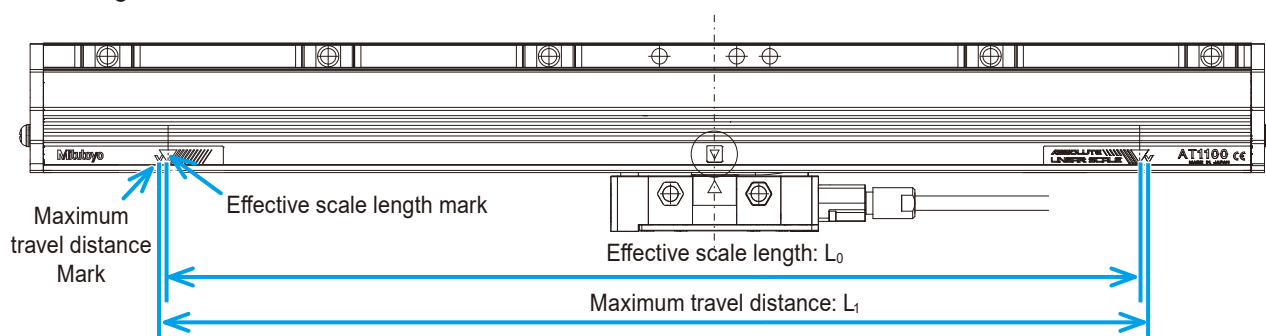

IMPORTANT

- When checking the travel distance of the scale main body on the machine, make sure that the maximum travel distance of the machine body is less than or equal to L_1 above and that the required range of accuracy is less than or equal to L_0 above.
- If the maximum travel distance or effective scale length of the scale main unit is insufficient, the size of the scale main unit must be changed.

2.2 Confirmation of Included Items

Items included with this product are indicated below.


Make sure that none of the included items are missing.

Also make sure that no items have been damaged in transit.

If you have any questions, please contact the agent where you purchased the product or Mitutoyo sales representative.

Name	Quantity	Note
Scale unit	1 unit	
Accessories	1 set	See "Accessories (mounting screws, etc.)" below.
User's Manual (this document)	1 each	
Warranty	1 each	
Inspection report (accuracy inspection table)	1 each	

● Accessories (mounting screws, etc.)

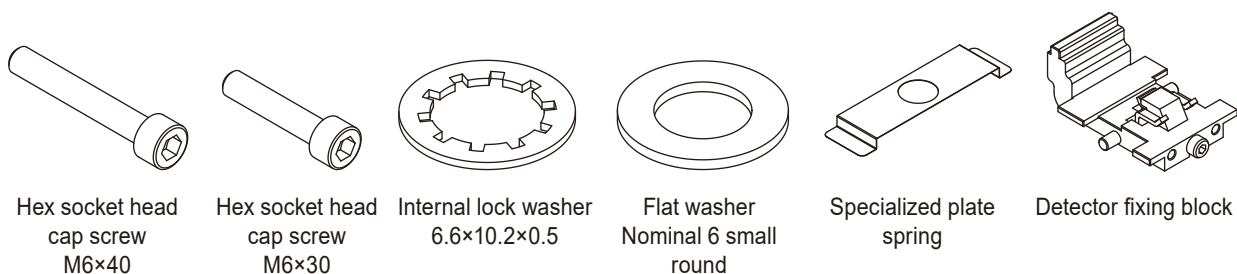

- Two detector fixing blocks are included with the scale unit to secure the detector to the scale main body. For detector fixing block mounting points, see "2.6 Precautions Regarding Mounting Surface Design" on page 28.
- The quantity of other accessories depends on the effective scale length of the scale unit. For details, see "7.1 Quantity of Accessories Used for Installation" on page 63.
- Signal cables are sold separately. They are not included as provided accessories. For details on length of signal cables, see "5.2 Optional Accessories" on page 56.

2.3 Signal Cable Preparation

The signal cables used with this product are sold separately. Arrange the direction of connection to the detector head according to your application.

Tips

For signal cable specifications and part numbers, see  "5.2 Optional Accessories" on page 56.


● Types of signal cables

Item	Specifications
Cable length	1 m / 3 m / 6 m / 9 m / 12 m* *12 m cable is only available in unfinished form.
Cable material	<ul style="list-style-type: none"> • PVC sheath $\varnothing 6.5$ without conduit • PVC sheath $\varnothing 10.6$ with conduit (Mitutoyo standard connectors only)
Output connector	<ul style="list-style-type: none"> • Unfinished cable specifications • FANUC connector specifications • Mitsubishi Electric connector specifications • Mitutoyo standard connector specifications

2.3.1 Signal Cable Connection Direction

The signal cable can be connected to the electrical component using the connector on either side of the detector.


For the connection procedure, see  "3.4 Signal Cable Connection and Fastening" on page 38.

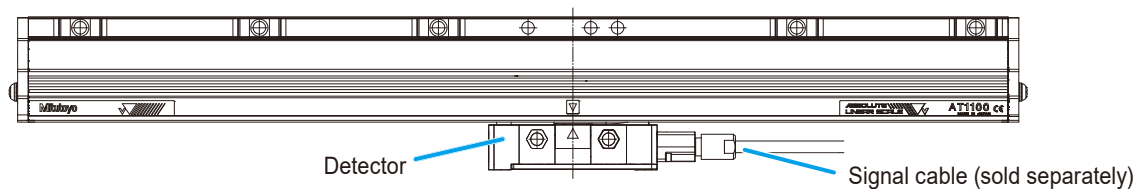

Signal cable connection direction (left)



Signal cable connection direction (right)

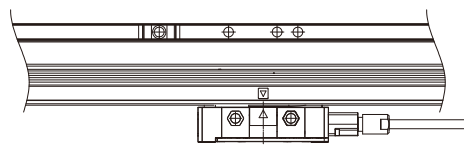

2.3.2 Cable Connection Example


Examples of cable connection are shown below.

If the length of the signal cable that Mitutoyo can supply is insufficient, the customer should provide a feedback cable.

Please note that this will require that the customer obtain some parts on their own.

■ Connection example 1

The following example illustrates direct connection to NC equipment, etc.

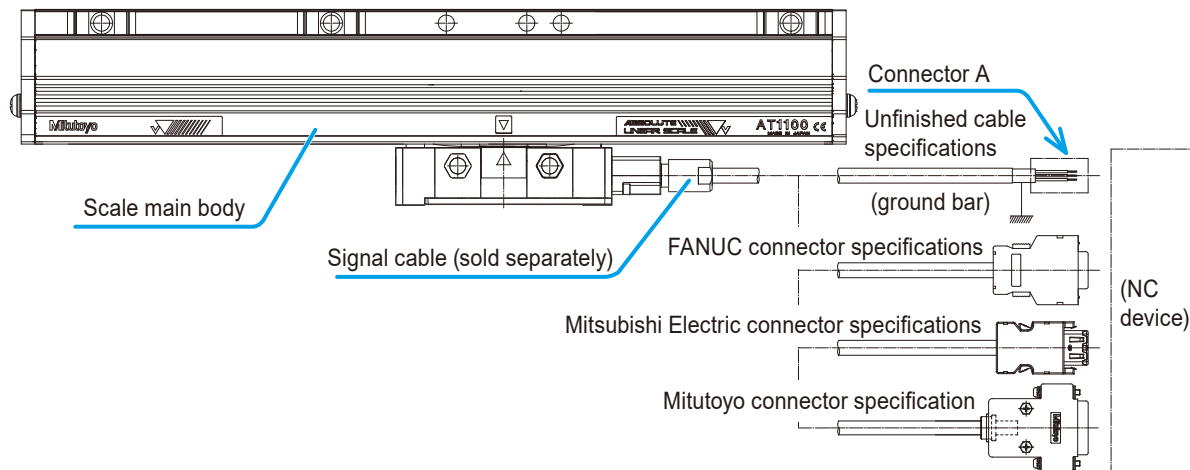



Tips

- Connector A must be provided by the customer.
- The customer is responsible for wiring connector A and ground bar connection.

■ Connection example 2 (using unfinished cable)

 The following is an example of adding a feedback cable consisting of unfinished cable with a D sub-connector attached.

If a feedback cable is not used, see  "5.2 Optional Accessories" on page 56 and connect the leads directly to the connector on the NC device side. When doing the wiring, follow the connector manufacturer's recommendations.

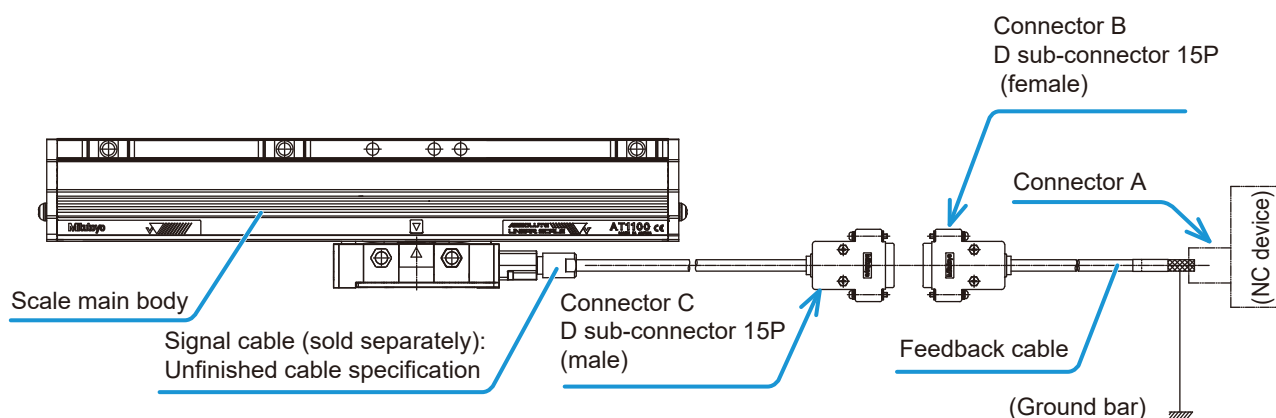

IMPORTANT

The combined length of the signal and feedback cables should be no more than 29 m.

NOTICE

Non-compliance can result in malfunction or damage.

When using cables other than the those recommended, be sure to use shielded cables and ensure that the total impedance of the power supply lines (+5 V and 0 V) is "0.65 Ω or less/full length".

Feedback cables should also be used to avoid repetitive bending.

Tips

- Connectors A, B, and C and the feedback cable must be provided by the customer.
- Customers are responsible for wiring each of connectors A, B, and C and making connection to the ground bar.
- When using a feedback cable, refer to the following when procuring the cable.

Recommended cable material:

Product number: A66L-0001-0286

Manufacturer: Hitachi Cable, Ltd., Oki Electric Cable Co., Ltd.


2.3.3 Cable Bending Radius R Tolerance Range

Cable bending radius R should be within the allowable range shown below.

The figure below shows the bending radius R of the signal cable, and the feedback cable extension of the signal cable should follow suit.


- When the detector moves (when the cable is bent repeatedly)

→ Cable bending radius $R=100$ mm or more

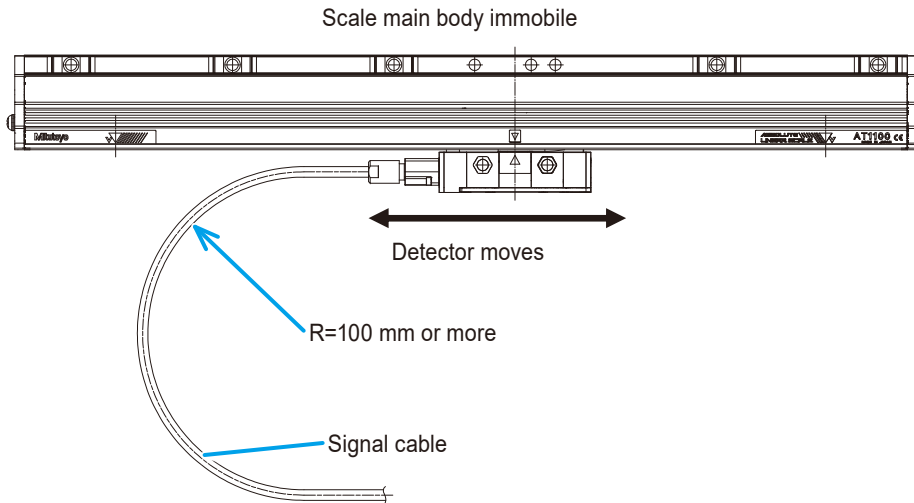

- When the detector is fixed (when the cable is fixed)

→ Cable bending radius $R=50$ mm or more

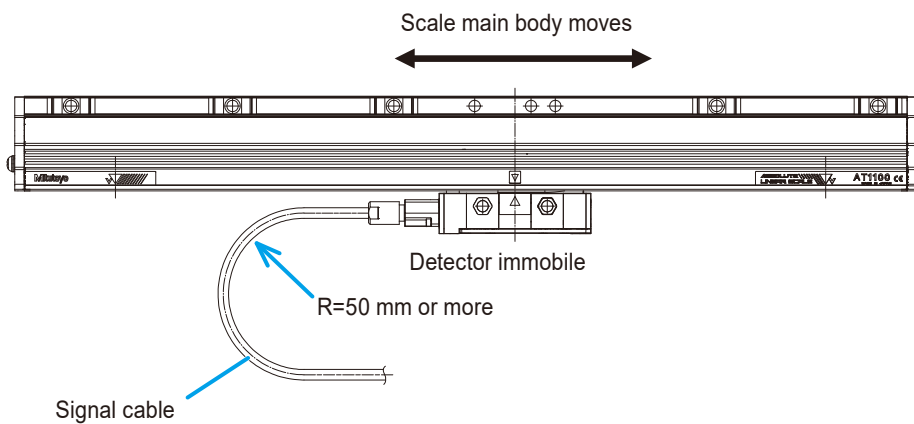

NOTICE

Do not exceed the tolerance range of the cable bending radius R. Doing so may result in wire breakage, etc. Furthermore, such breakage is not covered by the warranty.

Tips

- Signal cables are sold separately. Cable clamps and other cable fasteners are not included, and must be provided by the customer.
- For details on how to fasten the cable, see "3.4.2 Cable Fastenings and Precautions" on page 41.

2.4 Feedback Cable Preparation

This section explains preparation of a feedback cable (provided by the customer) using an example. Wire the feedback cable and NC device connector in the manner recommended by the connector manufacturer.

2.4.1 Example of NC Device Wiring

The following wiring table illustrates connection of NC equipment using a feedback cable. This shows the case in which the connector fitted to the signal cable is a D-sub connector. Wiring when other connectors are used should be established by the customer.

NOTICE

Non-compliance may cause malfunction or damage to the NC unit and scale unit.




The shield braid of the feedback cable must be grounded to a ground bar or the like immediately adjacent to the NC device.

Tips


Specifications of recommended cable stock for feedback cables (A66L-0001-0286):

- Wire for power supply: 0.5 mm² 3 black, 3 red
- Signal line wire: 0.18 mm² twisted pair wire (black x red, black x white, red x white)

■ For ABS AT1103A (Interface specification: Mitutoyo standard (ENSIS))

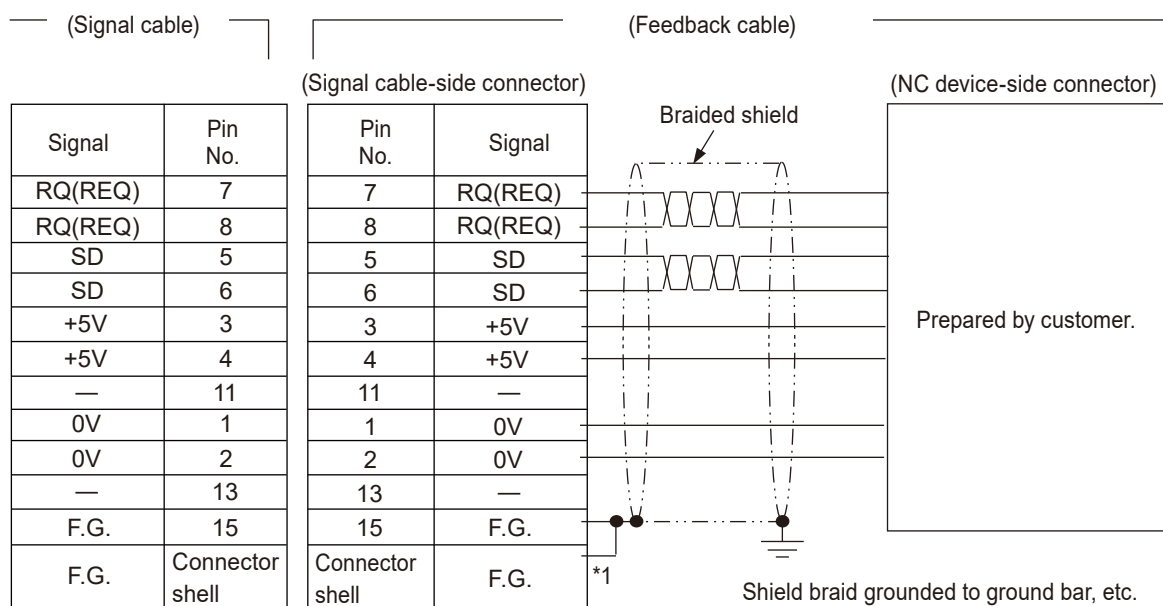

■ For ABS AT1153 (interface specification: made by FANUC Corporation)

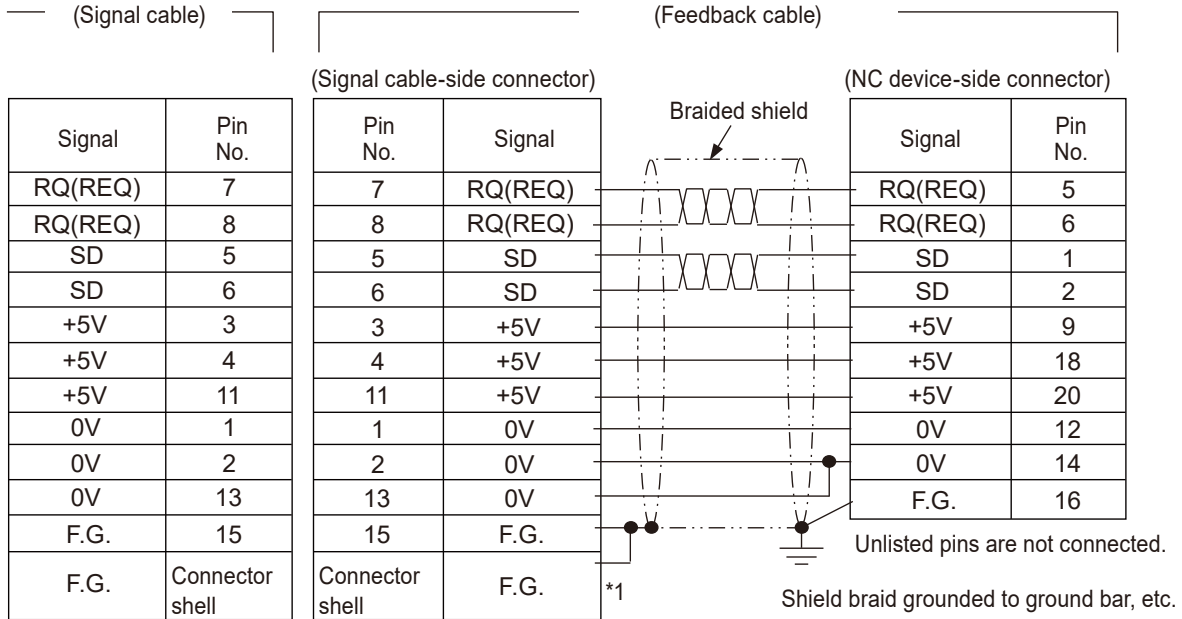


*1: If a shielded drain wire is present, connect it to pin 15 of the D sub-connector.

■ For ABS AT1143 (interface specification: made by Mitsubishi Electric Corp.)

● CNC 700 Series connection

Compatible servo amplifiers: MDS-D, MDS-DH, MDS-Dn

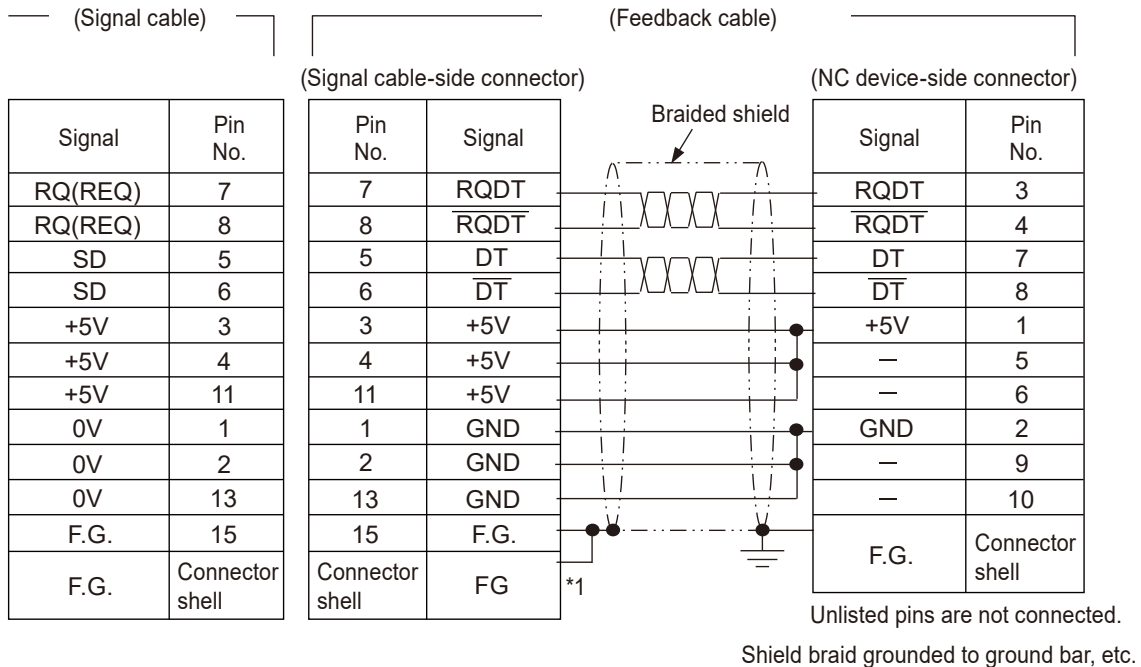


*1: If a shielded drain wire is present, connect it to pin 15 of the D sub-connector.

2.4.2 Feedback Cable Length Calculation

■ How to calculate feedback cable length

The following table shows how to calculate the feedback cable length. Use as a reference for feedback cable fabrication.

● Arrangement

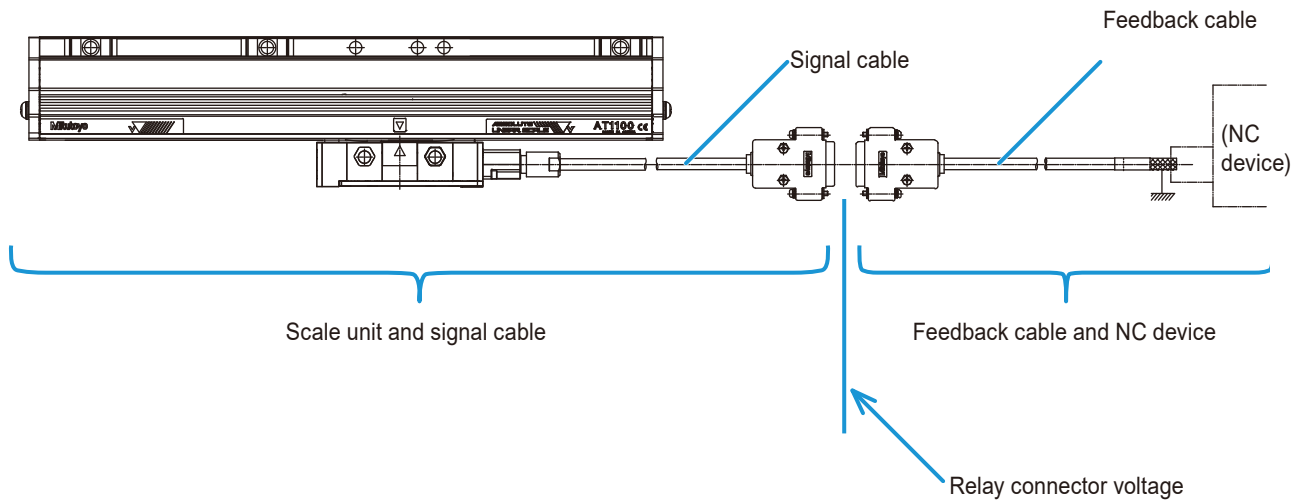

● Calculation formula

Allowable voltage drop \geq (current consumption \times wire resistance $\times 2 \times$ feedback cable length) \div number of pairs of power lines used ①

Conditions

Feedback cable length	L (unit: m)
Wire resistance of wire stock used	a (unit: Ω/m)
Number of pairs of power lines used	b (unit: pairs)
Current consumption	0.3 (unit: A)
Supply voltage from servo amplifier* (min. value)	4.95 (unit: V)
*Standard supply voltage value	
Relay connector voltage (min. value**)	4.5 (unit: V)
**Check the input voltage at the relay connector	
Voltage drop due to signal cable	0.039 (unit: V/m), for a 1 m signal cable

Applying the above conditions to formula ① yields the following.

$$(4.95 - (4.5 + 0.039)) [V] \geq (0.3 [A] \times a [\Omega/m] \times 2 \times L [m]) / b \cdots \cdots ②$$

Equation ② above is taken as the formula for finding L.

$$L [m] \leq \frac{b(4.95-4.539)}{0.6a} \cdots \cdots ③$$


Based on the above, prepare a feedback cable with length (L [m]) that satisfies Formula ③ using wire stock of resistance (a [Ω/m]), and with (b [wires]) pairs of power supply wires.

2.4.3 Assembly of D Sub-Connector


- 1 Remove 25 mm of the sheath from the cable stock.
Be careful to avoid damaging the internal shield braid.



- 2 To fold the shield braid back evenly, unravel the exposed shield wires, spread them radially, and cut them in a circular pattern so that they extend 6 mm–8 mm beyond the sheath.

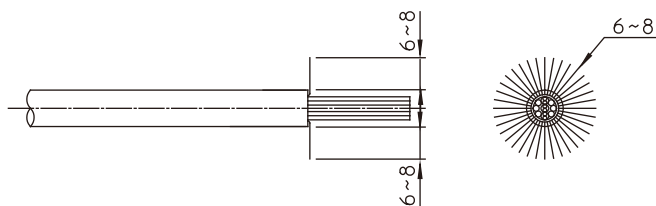


- 3 Strip 3 mm of insulation from the tip of each wire and pre-solder.

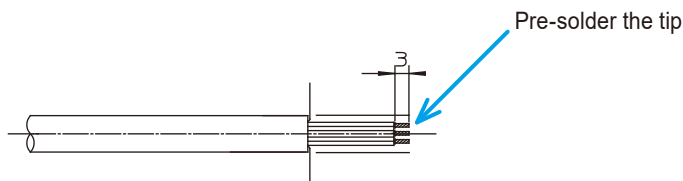


- 4 Solder individual wires to the D sub-connector (15P male).

- 1 First fit heat-shrink tubing ($\varnothing 2$, L = 6 mm–8 mm) over each of the terminals of the D sub-connector and then solder each wire.
- 2 Bend the shield braid to the sheath side.

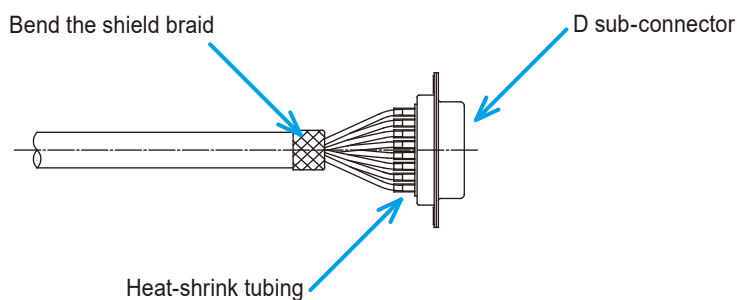


5 Set the D sub-connector in the plug case.

- 1 Use screws and the cable clamp to clamp the folded shield braid portion of the cable to the plug case.
- 2 After setting hex nuts (M2.6) into the plug case, insert the hex posts in from the connector side and screw them into the nuts (finger tightening them).

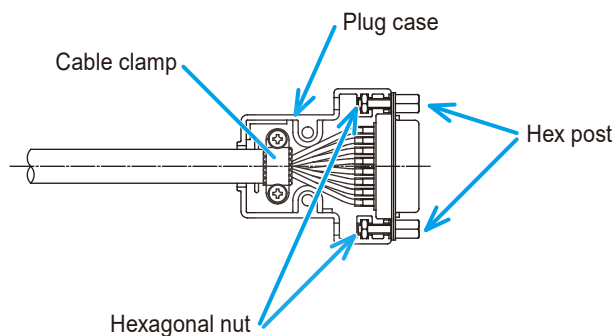


- 3 Put the other half of the plug case in place, secure it with the plug case fixing screws (M2.6 x 14 and hex nuts), and finally securely tighten the hex posts.

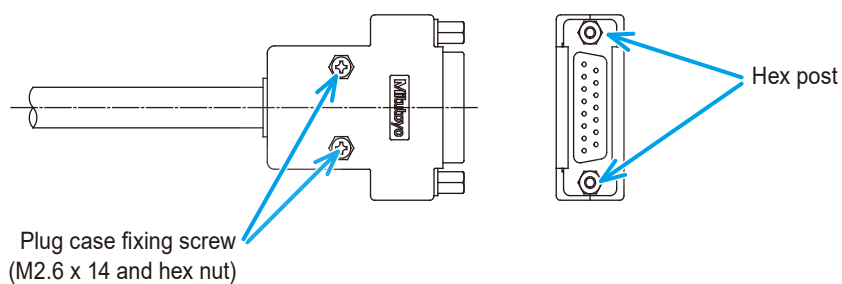**IMPORTANT**

Use thread-locking fluid on threaded parts.

2.4.4 Feedback Cable Diagram and Grounding to Ground Bar

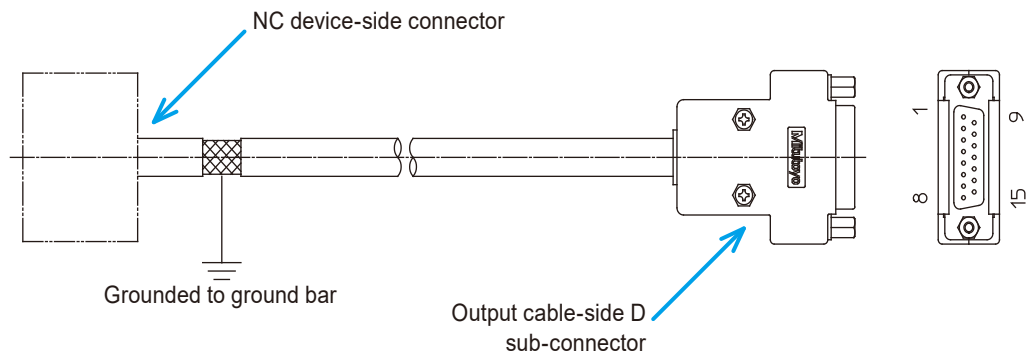


NOTICE

Non-compliance may cause malfunction or damage to the NC unit and scale unit.



When assembling the D sub-connector side, the shield braid of the cable must be electrically connected to the metal shell. Also, be sure to remove part of the outer sheath on the NC device side and ground the shield braid using a grounding bar or similar device.

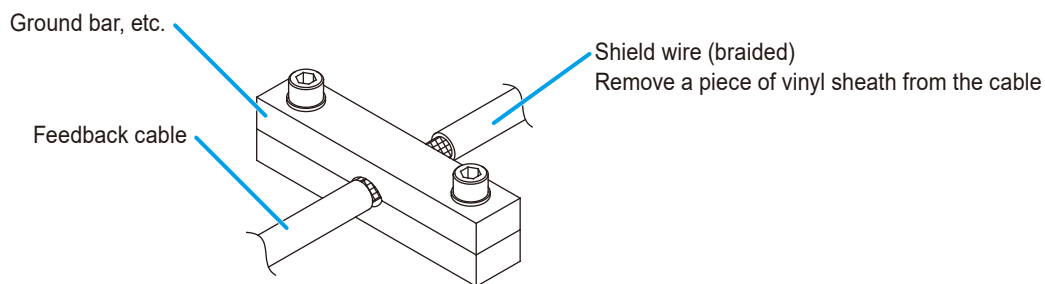

2.5 Cover Installation

When using this product, be sure to install a cover so that the scale main body is protected from direct exposure to cutting oil or chips.


Check installation orientation of the scale main body.



■ Attachment orientation of scale main body and cover

The opening of the scale main body is covered with dust-proof rubber to prevent entry of foreign matter, but it is more susceptible to entry of foreign matter than other surfaces. Therefore, select the installation location of the scale main body and the cover with consideration for the direction of dispersion of cutting fluid and chips.

The figures below show examples of both cover installation orientations that are susceptible to ingress of foreign matter and those that are resistant to ingress of foreign matter (recommended) with respect to the direction of dispersion of cutting oil, chips, etc.

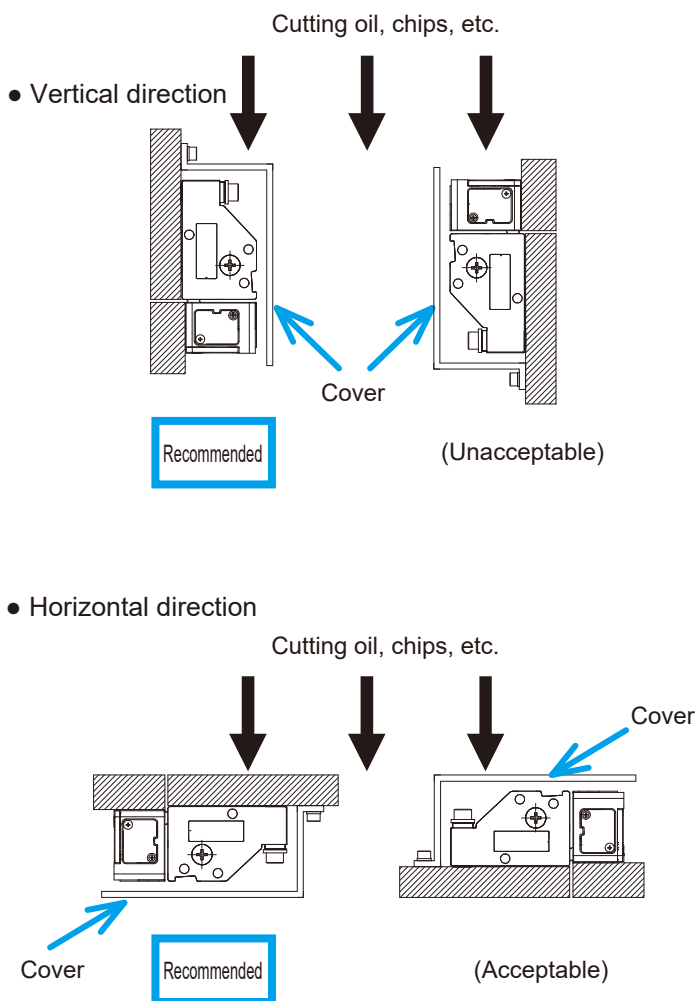


2.6 Precautions Regarding Mounting Surface Design

The following are design precautions to be observed with regard to the surface on which the scale main body is installed on the machine body.

Check precautions for design of the installation surface.



- The installation surfaces of the scale main body and the detector must be machined surfaces and have flatness within 0.05/500 mm.
- The installation surface of the detector is offset from that of the scale main body. Therefore, be sure to machine the mounting surface and maintain the offset dimension within the machining allowance of 2 mm \pm 0.1 mm. If positional adjustment is to be made by inserting spacers, etc., be sure to measure the offset prior to installation.
- When installing the scale main body, adjustment in the vertical direction is required as shown below.
To simplify positioning adjustment, it is recommended that a reference positioning pin or similar device be used.
The vertical positioning reference for the scale main body is the surface of the aluminum frame.
- The gap between the scale main body and the detector is determined by the detector fixing blocks.

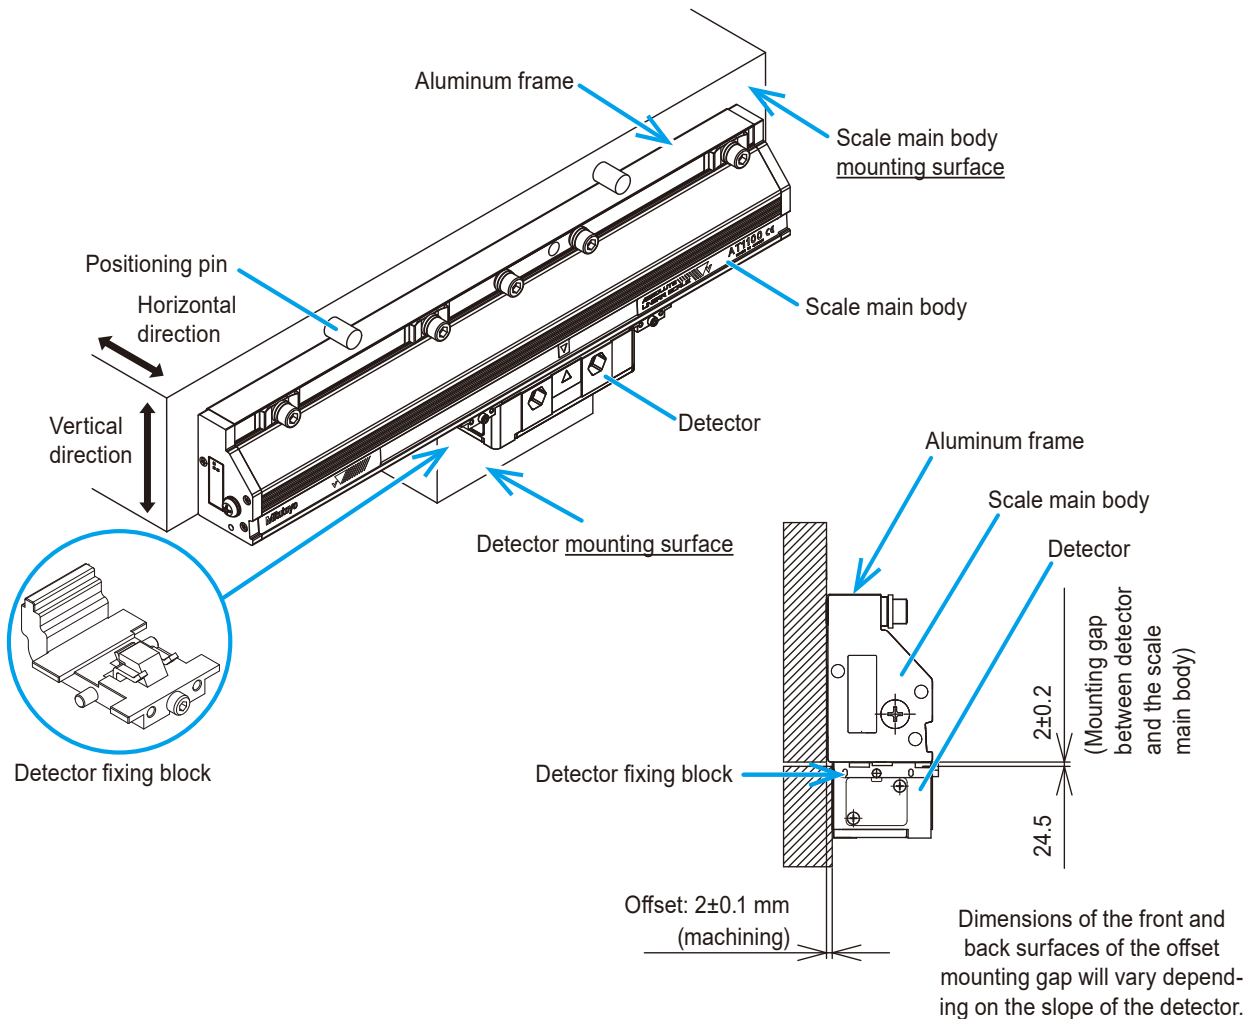

Tips

- For detailed installation specifications, see "■ Appearance and installation dimensions" on page 53.
- For detailed installation procedures, see "3 Attachment to the Machine Body" on page 29.


3 Attachment to the Machine Body

This chapter describes procedures and precautions regarding attachment of this product to the machine body.

3.1 Procedure for Attachment to the Machine Body	29
3.2 Installation and Positional Adjustment of the Scale Main Body	29
3.3 Mounting the Detector and Adjusting Its Position.....	33
3.4 Signal Cable Connection and Fastening	38
3.5 Air Purging	43

3.1 Procedure for Attachment to the Machine Body

Installation of this product on the machine body is broadly divided into the following steps.

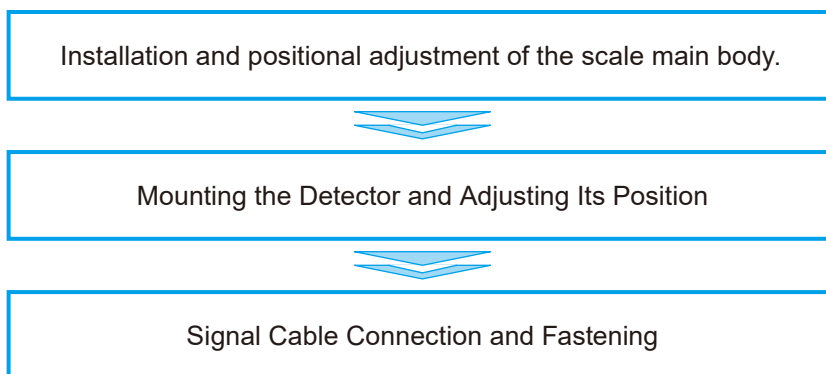

The following describes each procedure in detail.


3.2 Installation and Positional Adjustment of the Scale Main Body

3.2.1 Check the Mounting Surface, etc.

Referring to "2.6 Precautions Regarding Mounting Surface Design" on page 28 and "■ Appearance and installation dimensions" on page 53, verify that the positional and surface accuracy of the mounting surface for the scale main body and the mounting surface of the detector are within specified tolerances.

3.2.2 Installation of Scale Main Body

You can check the installation procedure for the scale main body.





1 Temporarily affix the scale main body to the scale mounting surface on the machine body.


Use provided screws as indicated below to temporarily secure the scale main body to the extent that it will not move even if you remove your hand from the scale main body.

- Fully-fixed fastening points (elongation base point position with respect to temperature change)
Hexagon socket head cap screws M6x30 + Internal lock washers
- Flexible fastening points
Hexagon socket screws M6x30 + flat washers (small round) + specialized plate spring

Do not fasten the detector at this time.

Tips

- The number of fully-fixed fastening point holes depends on the overall length of the scale.
For details, see  "■ Appearance and installation dimensions table" on page 55.
- Two screws are used for the fully-fixed fastening points.
For details, see  "● Note regarding appearance and installation dimensions" on page 54.

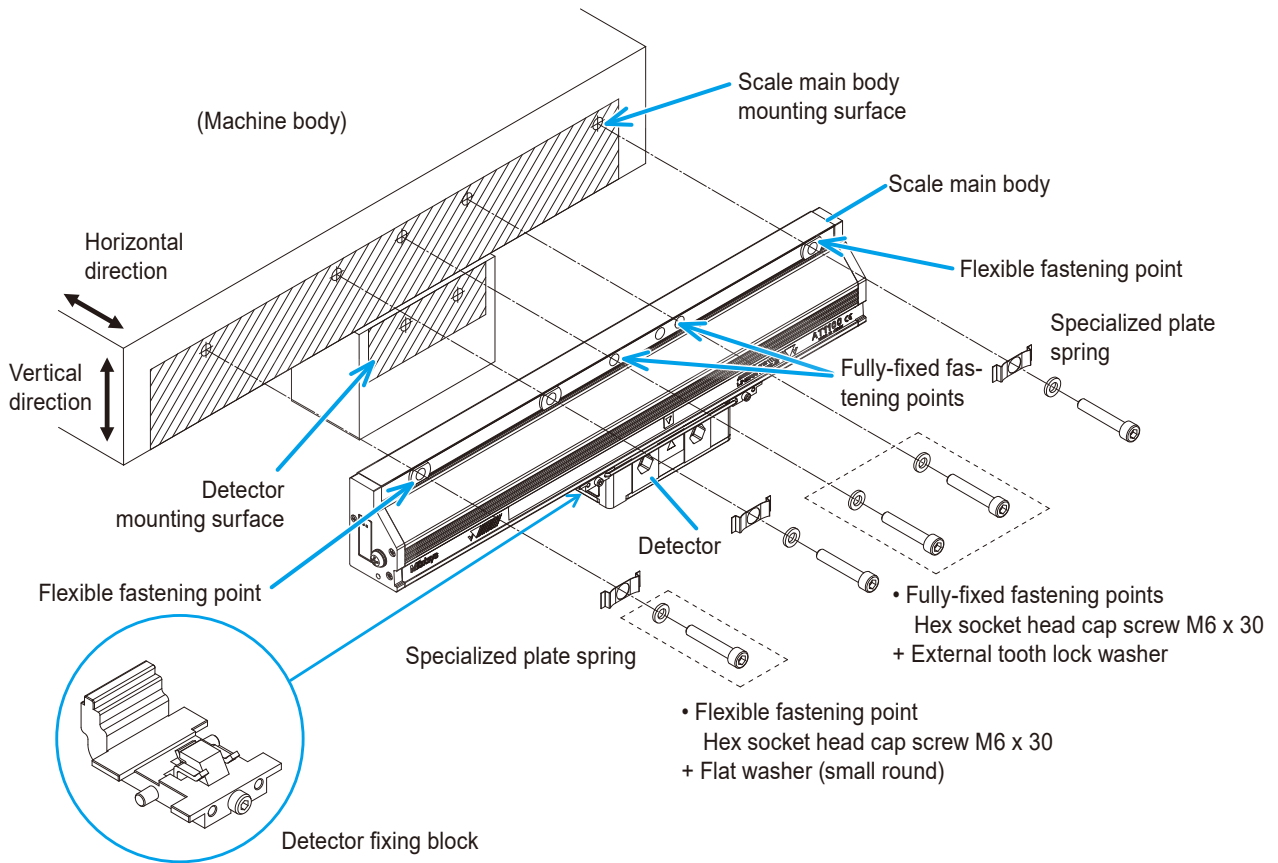


NOTICE
Do not remove the detector fixing block. Detector failure may result.


3 Attachment to the Machine Body

2 Adjust scale main body positioning in the vertical direction.

The scale main body of this product does not need to be positioned in the horizontal direction as shown in the figure below (it relies on accuracy of the mounting surface on the machine body), but it must be positionally adjusted in the vertical direction through parallelization.


For parallelization, refer to the external appearance and installation dimension drawings of the scale main body, and parallelize on the surface indicated in figure A below.


For details on the external appearance and installation dimension drawings, see  "■ Appearance and installation dimensions" on page 53.

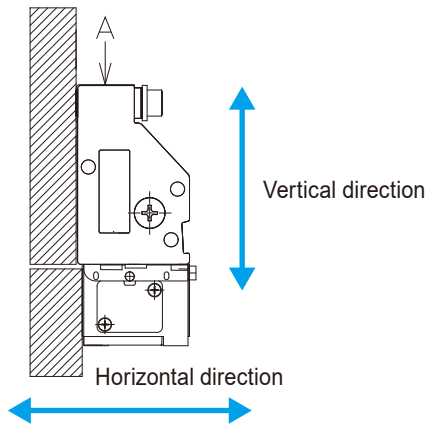


● Positional adjustment procedure

For parallelization by positional adjustment, use instruments such as a test indicators or dial gages. The figure below shows use of test indicators.

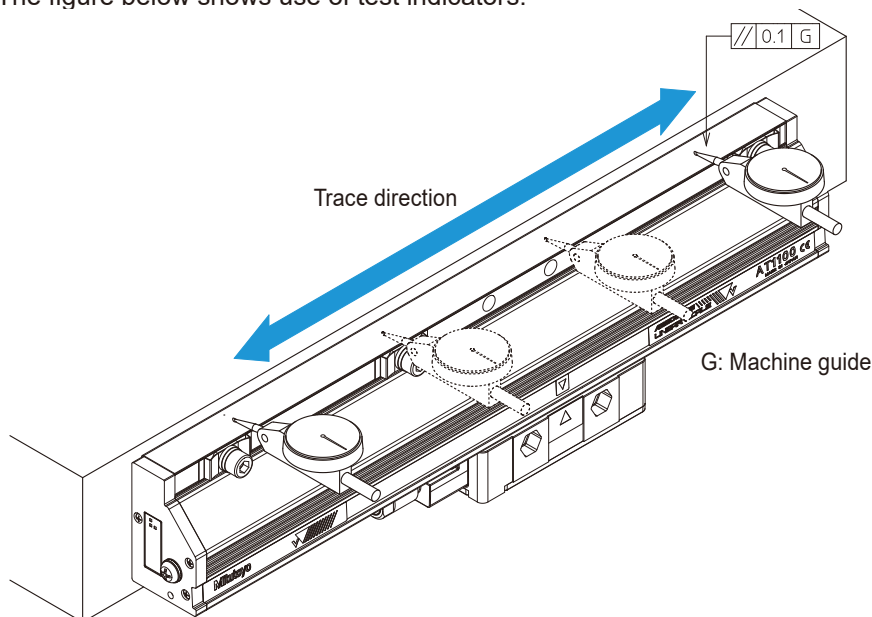

 Positioning can be simplified by using a base point, such as a positioning pin, as shown in "2.6 Precautions Regarding Mounting Surface Design" on page 28, but the mounting position must be confirmed.

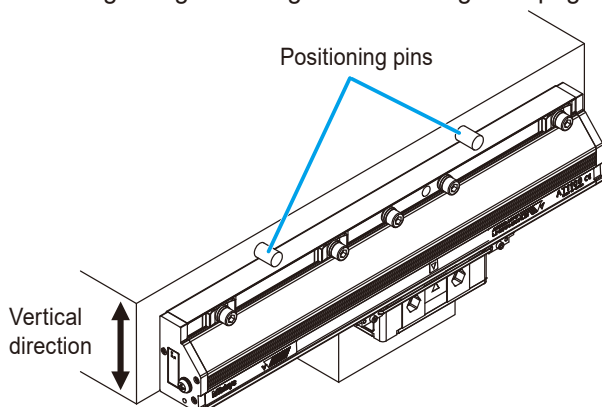


3 Securely fasten the scale main body to the scale mounting surface of the machine body.

After adjusting vertical positioning of the scale main body, tighten all screws.


When doing so, please note the following.

- Screw tightening torque: 9 N•m
- Screw tightening procedure
When tightening the screws, be sure to tighten the fully-fixed fastening points first, followed by the flexible fastening points.

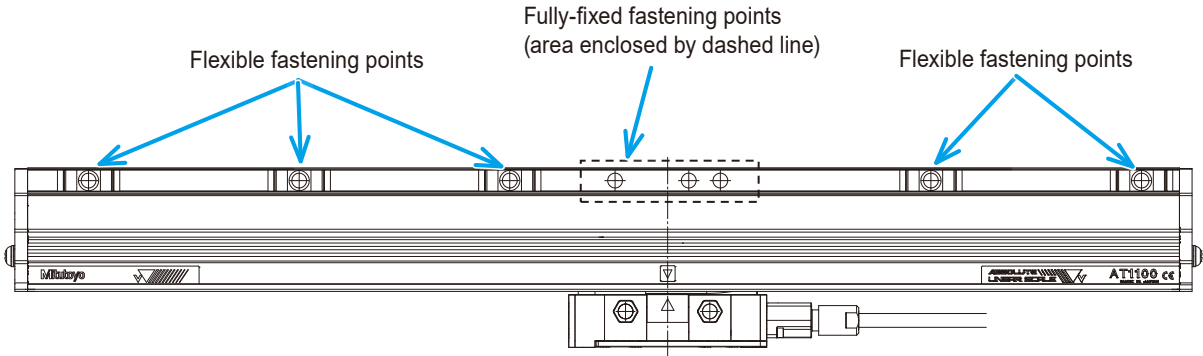


- Flexible fastening points when fastened

The fastened state of the flexible fastening points is shown below. Use as a reference.

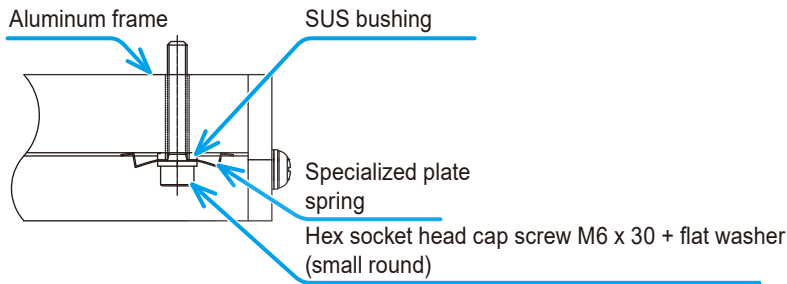

3.3 Mounting the Detector and Adjusting Its Position

After completing  "3.2 Installation and Positional Adjustment of the Scale Main Body" on page 29, install and position the detector according to the following procedure.


Check the head installation procedure.




IMPORTANT

Make sure that the offset between the mounting surface of the detector head and the scale main body is $2\pm 0.1\text{mm}$.

If the offset is out of the allowable range, adjust it by inserting a spacer or the like.


For details, see  "■ Appearance and installation dimensions" on page 53.

1 Remove the connecting rod that connects the two detector fixing blocks.

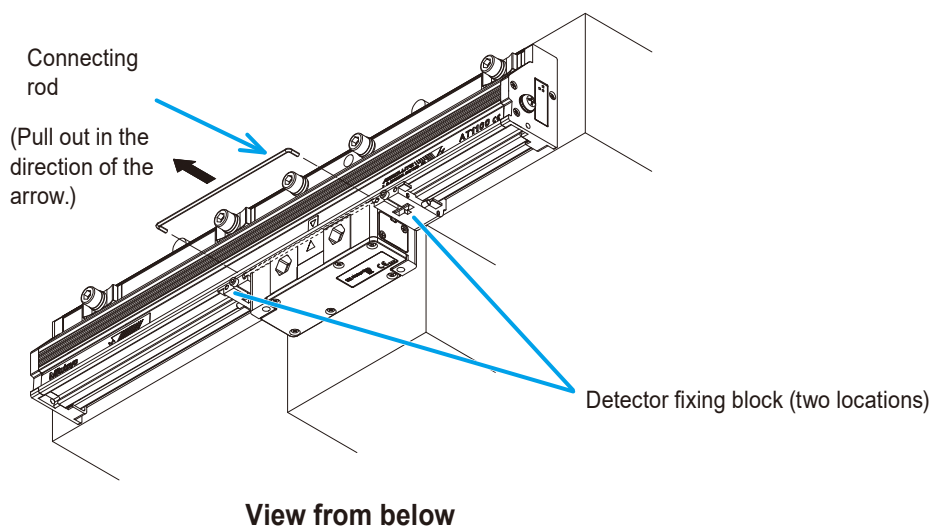

2 Secure the detector with the provided hexagon socket head cap screws M6 x 40.

Hex socket head cap screw M6 x 40:
Tightening torque: 9 N·m

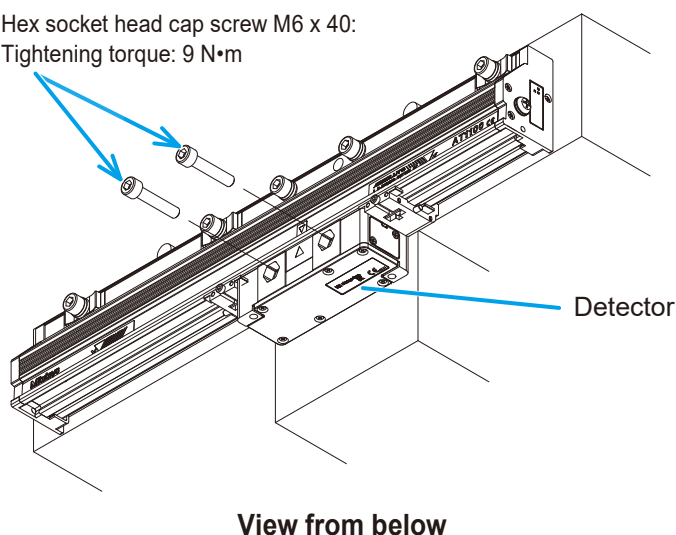


NOTICE


If there is a gap between the detector and the mounting surface, use a spacer or the like to fill the gap. Forcibly tightening the screws while a gap is present may damage the scale unit.

3 Loosen the clamp screws holding the detector fixing blocks (two locations) by about five to eight turns and tilt the clamp screws.

Note that if the clamp screws are loosened too much, the metal fittings of the detector fixing block will fall out.

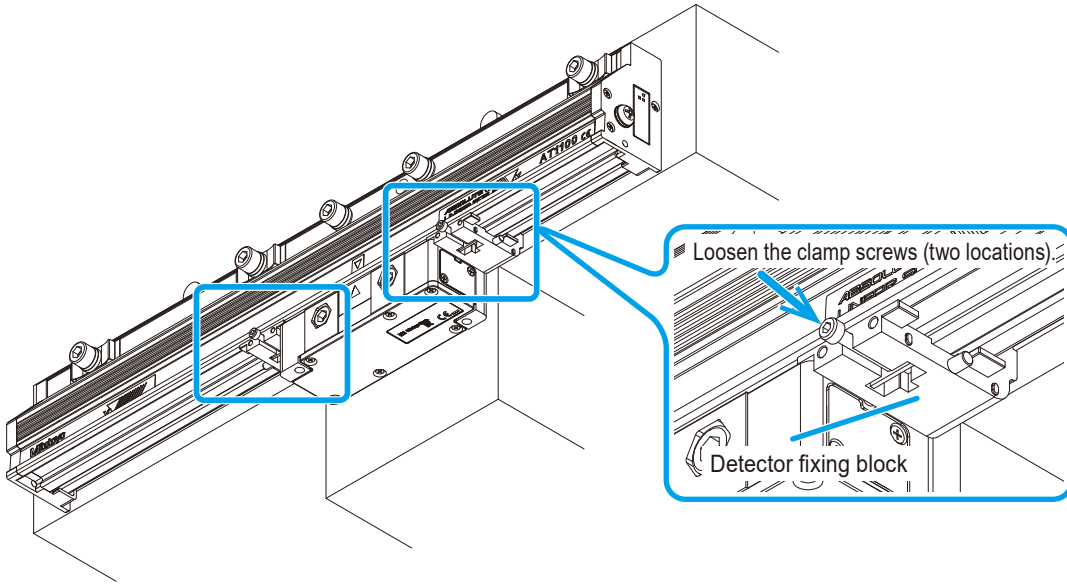

View from below

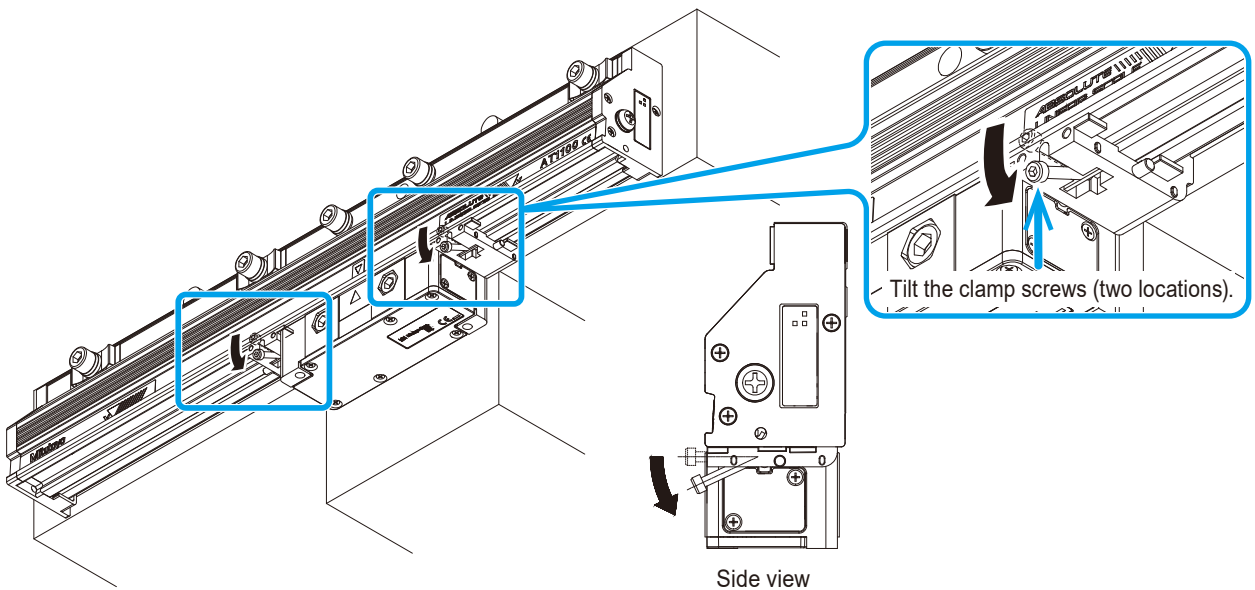


View from below

Side view

4 Remove the detector fixing block in the direction of the arrows.

Installation is now complete.

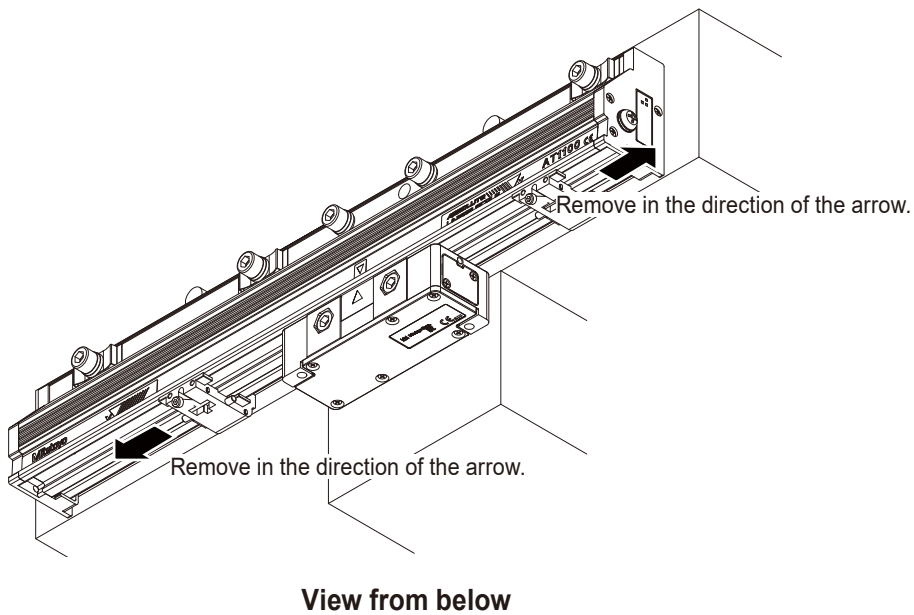


■ When mounting the detector on a front or bottom surface

When mounting the detector from the front or from the bottom, refer to the following.
 In this situation, screws and nuts used for installation are not included, and must be provided by the customer.


NOTICE

When designing the bracket for fixing the detector, please note the following points. Non-compliance can result in malfunction.

- Pay close attention to rigidity of the bracket.
- When fixing the detector from the front as shown in "Mounting example 1" below, refer to the detector fixing block dimensions shown at right, and be careful to avoid interference between the clamp screws of the detector fixing block and the bracket for fixing the detector.

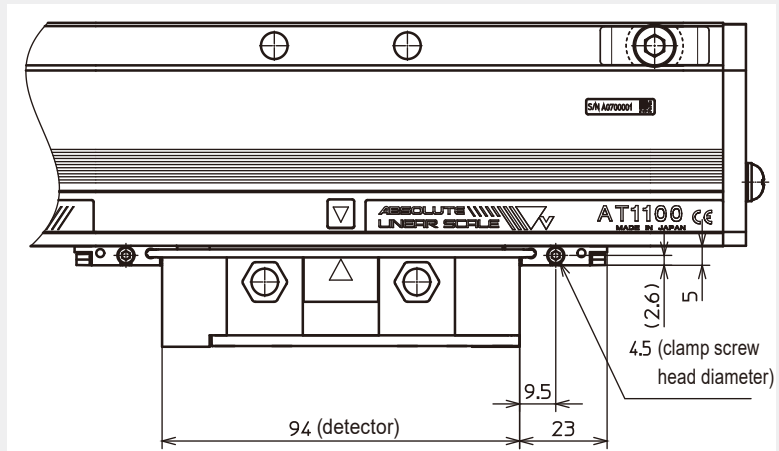


- Installation example 1 (when mounting from the front)

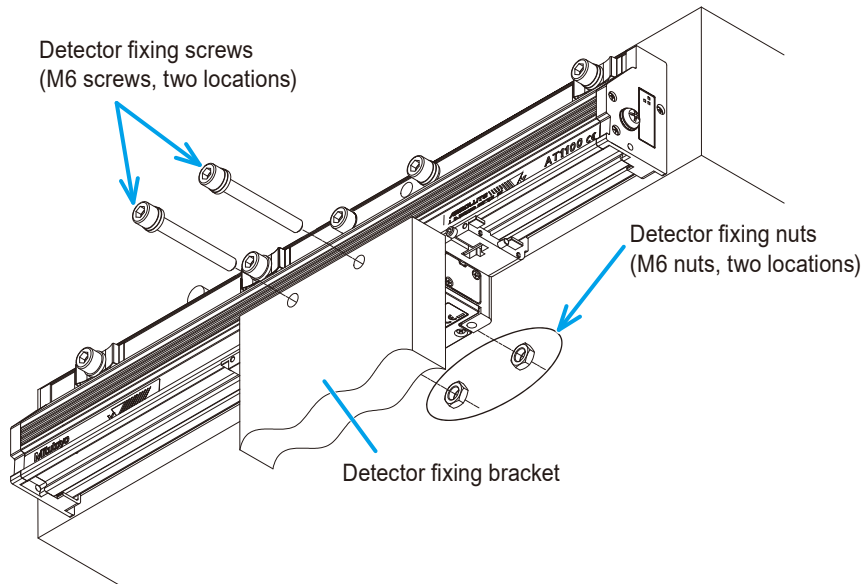

View from below

- Mounting example 2 (when mounting from the bottom)

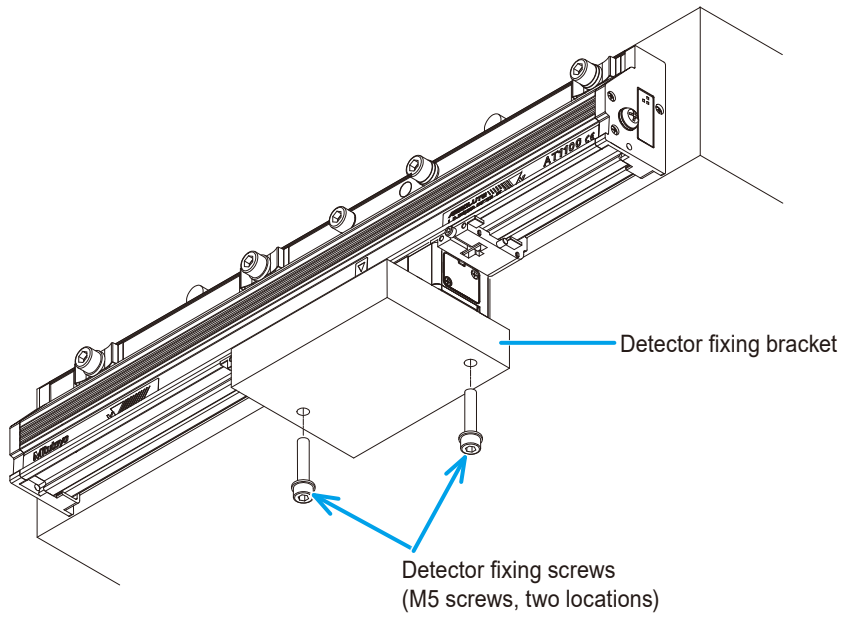


View from below

3.4 Signal Cable Connection and Fastening

3.4.1 Connecting Cables and Verifying Operation

The figure below shows an example system configuration.


For details on cables, see "5 Specifications" on page 51.

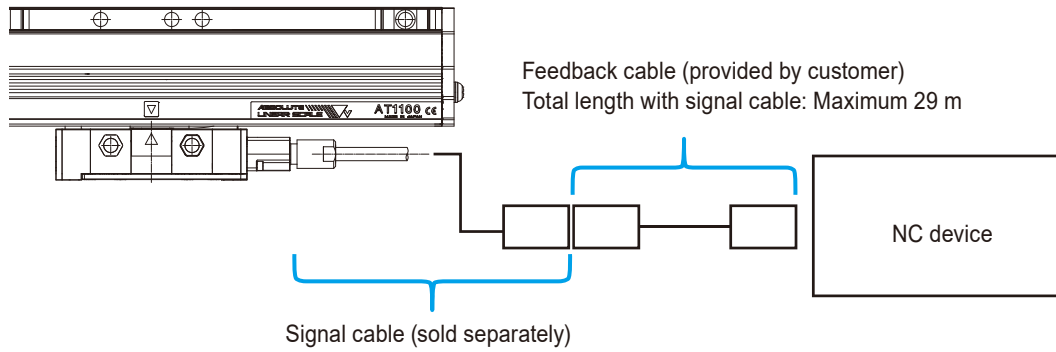

■ Signal cable connection

Check the signal cable connection procedure.

1 Select the direction of signal cable installation direction (left or right).

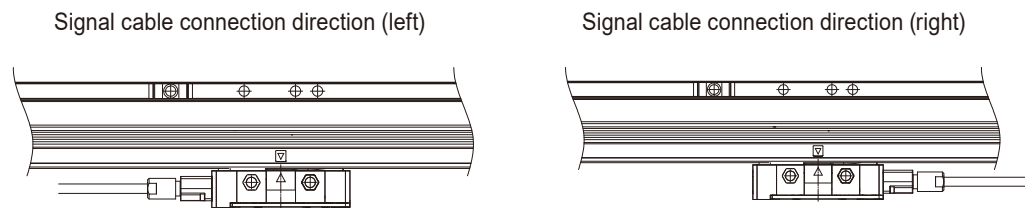

2 Remove the connector panel from the detector.

In the standard condition, connector panels are installed on both sides of the signal cable attachment ports of the detector.


Remove the connector panel on the side of the detector where the cable is attached.

3 Attachment to the Machine Body

IMPORTANT

There is a packing between the detector connector panel and the detector.


When attaching the cable, work carefully to prevent the packing from falling off. If it falls off, be sure to properly re-seat it in the groove of the detector.

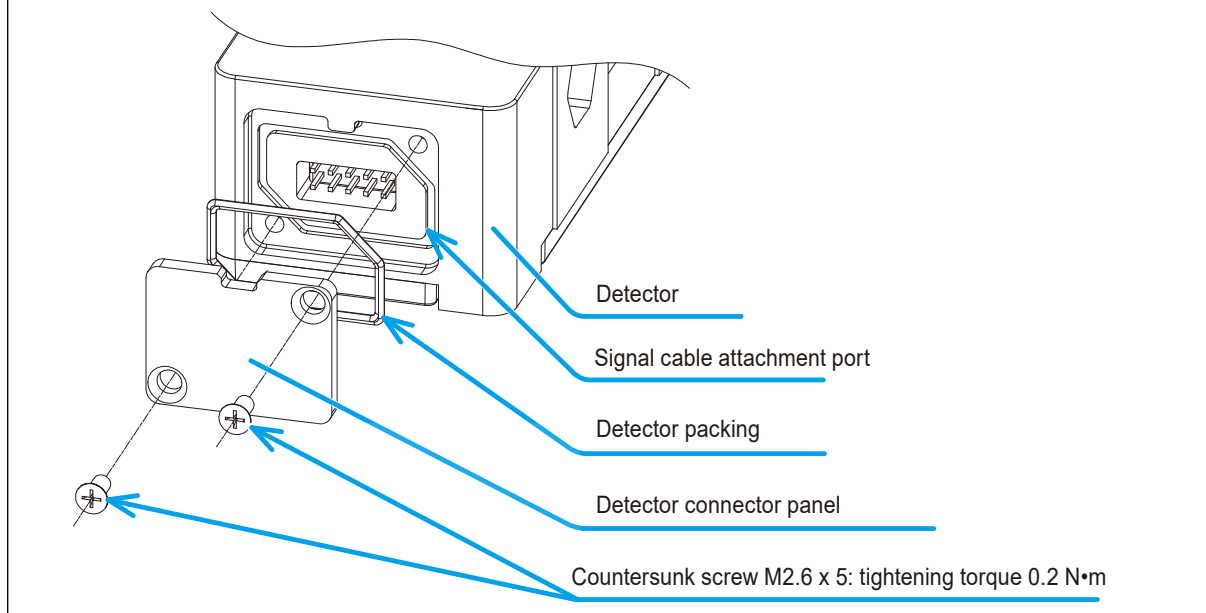**3 Connect the signal cable to the detector.**

Align the key on the signal cable attachment port with the notch in the connector.

IMPORTANT

- To ensure waterproof performance, a packing is installed between the detector and the connector. When connecting the signal cable, be sure to check that the packing is properly seated in the groove of the signal cable attachment port.
- Although the detector is waterproof, waterproof performance is not assured if tightening torque of the countersunk screw is insufficient or the detector packing is not properly seated. To ensure waterproof performance, be sure to follow the procedure when connecting the cables.

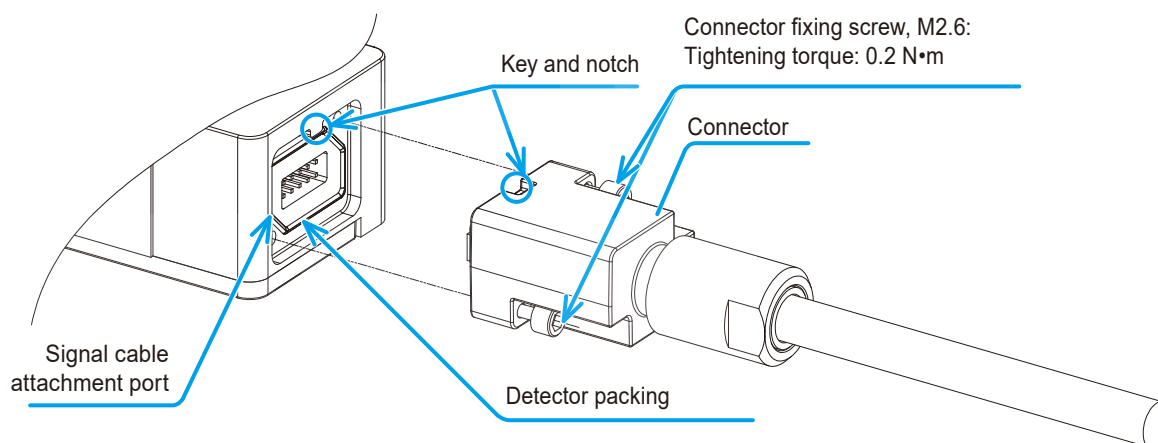

4 Connect the signal cable to the NC device.


If the cable length is insufficient, use a feedback cable (to be provided by the customer). After connection, check that the screws used for connector joints are securely tightened.

IMPORTANT

When connecting a Mitutoyo signal cable to a customer-provided feedback cable, the combined length of the signal cable and feedback cable should be no more than 29 m.

5 After all cables are connected, supply power and check operation of the scale unit and its functions and performance.

NOTICE

- If the scale unit does not operate properly when power is supplied, first verify that connections are correct. If it does not operate properly after verifying connections and supplying power again, see  "6 Troubleshooting" on page 61.
- When checking operation of the scale unit, be very careful to prevent pinching of cables by the equipment.
- Also be careful to avoid ingress of chips or other debris into the machine body during operation, as this could cause a malfunction.

3.4.2 Cable Fastenings and Precautions

Check the cable fastening procedure.



When fastening cables, carefully follow the procedure given below.

1 Arrange cables so as to avoid kinking, bending, and sources of electrical noise.

IMPORTANT


Noise carried by signal and feedback cables can cause malfunctions if they are bundled with other cables that are a source of electrical noise or placed near relays that turn high currents on and off.

2 Secure each cable by cable clamps, etc.


NOTICE

Non-compliance may result in cable damage or disconnection.

- Never bend cables.
The cable bending radius R should be within the range shown in "2.3.3 Cable Bending Radius R Tolerance Range" on page 20.

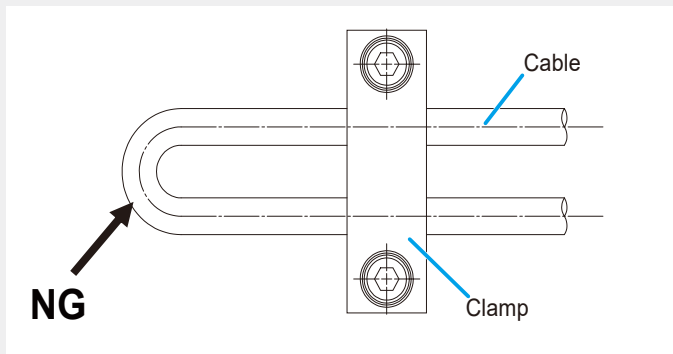


- If a cable is subject to repeated bending, allow it to move freely without fastening it, and take care to prevent application of stress at the point where the cable is clamped near its end.

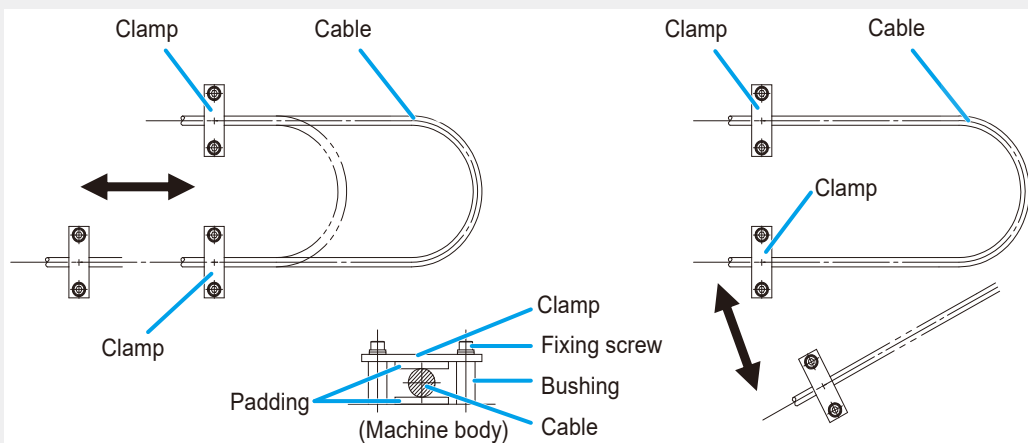


NOTICE

There is a risk of damage to or disconnection of the cable, connector, detector, or this product.

- Take into consideration shaking of the connectors due to vibration, etc.

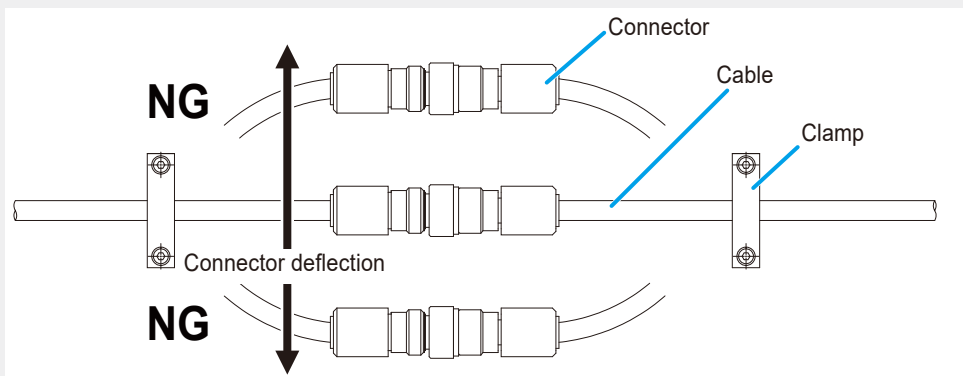


- Care should be taken to avoid extreme bending or pulling at the base of the signal cable during the entire stroke range.

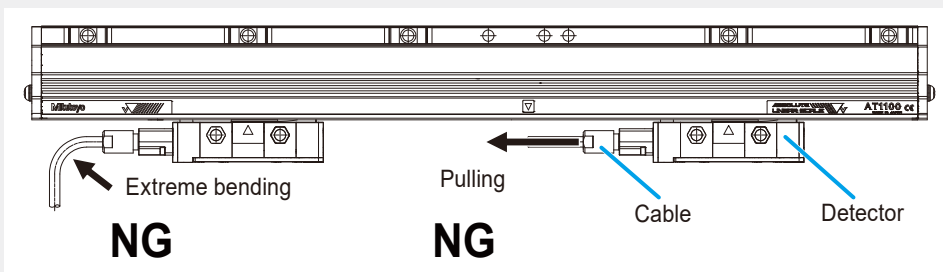

- Make sure that there is no interference with covers, etc., over the full stroke range.

3.5 Air Purging

This product is equipped with a mechanism for air purging. This mechanism supplies clean compressed air to the inside of the scale main body, thereby improving environmental resistance (coolant and dust resistance) of the scale unit.

As shown in  "3.5.3 Connection Method" on page 45, clean compressed air can be piped to either of the M5 threaded holes on both sides of the scale main body by air equipment of the specified specifications inside the scale main body.

3.5.1 Flow Rate of Air Supply to the Scale Unit

Supply air at the rate of 10 L/min–20 L/min per scale unit per axis.

The standard air flow rate is about the level of air coming out of the dust wiper part of the dust-proof rubber.

Adjust the air flow rate with reference to the following.

- When using the fixed diaphragm specified by Mitutoyo (fixed diaphragm inner diameter: $\varnothing 0.9$)

Adjust the air pressure so that the air flow rate is 10 L/min–20 L/min per axis.

(Reference) For air supply to a single axis:

The air flow rate is approximately 12.7 L/min when the air pressure is 0.1 MPa.

The air flow rate is approximately 19 L/min when the air pressure is 0.2 MPa.

- When using other fixed diaphragms

Adjust the air pressure so that the air flow rate is 10 L/min–20 L/min per axis.

For the relationship between flow rate and air pressure, refer to the flow characteristics (fixed diaphragm diameter and flow rate-pressure relationship) provided by the manufacturer of the pneumatic equipment.

- When using a flow rate control valve

Adjust the air flow rate to 10 L/min–20 L/min per axis.

NOTICE

Do not supply a large unadjusted air flow, as this may damage parts and cause malfunctions.

3.5.2 Recommended Air Equipment

This product does not require an air dryer.

Do not supply air directly to the air equipment, but always use compressed air from a compressor through a main line air filter.


The oil mist filter element should be replaced approximately once each year.





Install the fixed diaphragm on the scale unit side.

As examples, the following page lists specifications and manufacturer's model numbers of recommended air equipment.

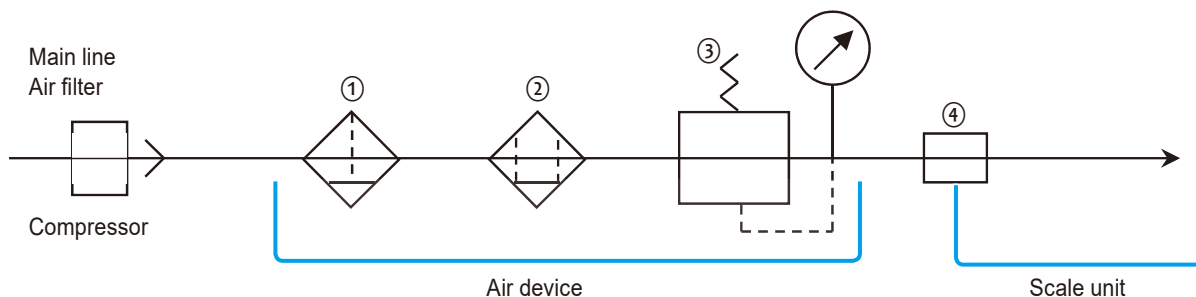Other companies' products may be used as long as they have the same specifications.

■ Air supply unit



No.	Component elements	External appearance	Specification	Item No.	
				Part No. (Mitutoyo)	Maker model number
①	Air filter		<ul style="list-style-type: none"> Fluid used: Compressed air Maximum operating pressure: 1.0 MPa Guaranteed pressure resistance: 1.5 MPa Maximum particle size (degree of filtration): 5 μm Oil concentration on outflow side: N/A 	N/A	F1000-8-W (CKD)
②	Oil mist filter		<ul style="list-style-type: none"> Fluid used: Compressed air Maximum operating pressure: 1.0 MPa Guaranteed pressure resistance: 1.5 MPa Maximum particle size (degree of filtration): 0.01 μm Oil concentration on outflow side: 0.01 mg/m³ or less Element replacement: 1 year (6000 hours) or pressure drop 0.1 MPa 	N/A	M1000-8-W (CKD)
③	Regulator		<ul style="list-style-type: none"> Fluid used: Compressed air Maximum operating pressure: 1.0 MPa Guaranteed pressure resistance: 1.5 MPa Setting pressure range: 0.05 MPa–0.85 MPa 	N/A	R1000-8-W (CKD)
④	Fixed diaphragm		<ul style="list-style-type: none"> Fluid used: Air Operating pressure range: 0.1 MPa–0.9 MPa Screw tightening torque: 1.0 N•m–1.5 N•m Flow rate at 0.1 MPa pressure: Approx. 12.7 L/min Flow rate at 0.2 MPa pressure: Approx. 19 L/min <p style="text-align: right;">(per axis)</p>	06ACJ155	PC6-M5M-0.9 (Pisco special order product)


3.5.3 Connection Method

IMPORTANT


Compressed air used must pass through the main line air filter, not directly from the compressor to the air equipment.

When making connections, use $\phi 6$ air tubing and install the fixed diaphragm on the scale unit side.

■ When air is supplied to two scale unit axes

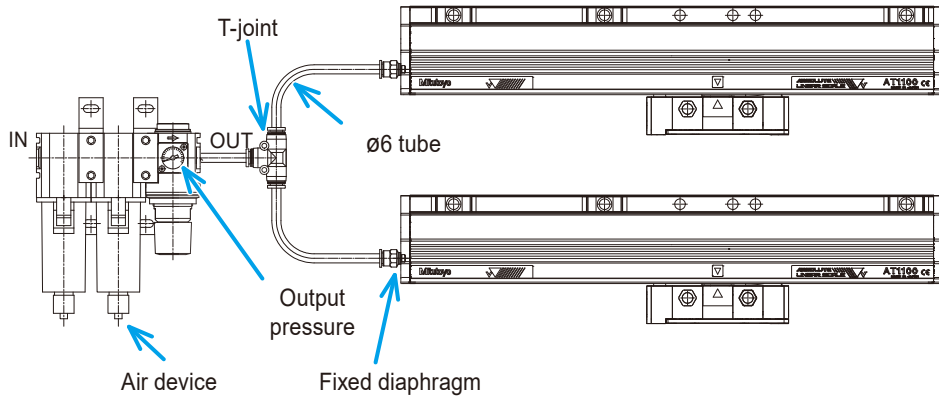

■ When air is supplied to three scale unit axes

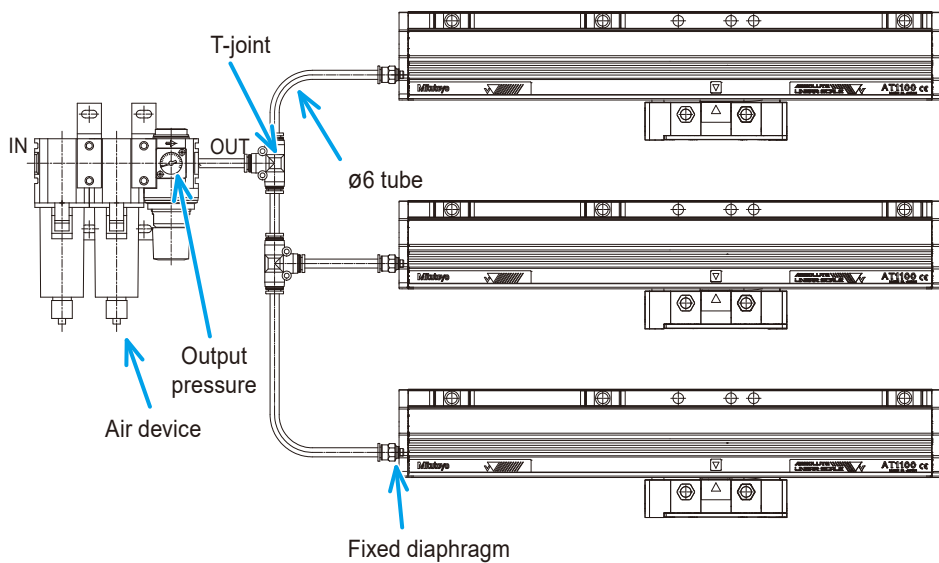

Tips

- The should be replaced about once each year. Replacement time depends on operating conditions and environment.
- Check the user's manual that is provided with the air equipment for maintenance instructions.

MEMO

4 Alarm detection function

This product has various alarm detection functions inside the detection.

4.1 Alarm Detection Function

Alarm detection functions are broadly classified into two types: warning and abnormality.

The warning detection function detects high temperature warning, etc. inside the product's detector and returns to normal when the condition is removed.

The abnormality detection function detects signal strength errors and absolute value detection errors in this product. Once an error occurs, the abnormality detection status is maintained until a reset occurs or power is turned on again.

<<Descriptions of alarm detections>>

Types of alarm detection		Description
Warn- ing	High temperature warning	Detected when internal temperature of the detector rises above 65 °C and returns to normal status when it falls below 60 °C.
	Signal strength	Output when signal strength falls below 30 % and returns to normal status when signal strength rises above 30 %.
Abnor- mality	Signal strength error	Output when signal strength is less than 15 % or 100 %.
	Transducer error	Output when an abnormality occurs in the internal signal balance.
	Absolute value de- tection error	Output when an abnormality occurs absolute value data.
	Hardware error	Output when an abnormality occurs in the internal hardware.
	Initialization error	Output if system initialization is not complete successfully when the power is turned on.
	Overspeed	Output when the maximum response speed (3 m/s) is exceeded.

4.2 Meaning of Alarm Codes

This section indicates the relationship between alarm codes output by the NC device and alarms produced by this product (internal errors of the scale unit), as well as causes and countermeasures for each alarm.

■ With the ABS AT1153

The following table shows the relationship between alarms of the ABS AT1153 and the alarm codes displayed on FANUC's NC devices (α interface / α i interface).

Note also that the alarm codes for NC equipment differ according to whether a scale unit is used with fully closed control or with a linear motor.

Servo amplifier alarm codes	Description	Cause and countermeasure
LED abnormality <ul style="list-style-type: none"> Fully closed control: 380 With linear motor: 365 	Scale unit error occurred. <ul style="list-style-type: none"> Hardware error 	Cause <ul style="list-style-type: none"> Scale unit abnormality detected. Countermeasure <ul style="list-style-type: none"> Cycle the power off and on. If the abnormality is detected again, the scale unit requires replacement.
Phase abnormality <ul style="list-style-type: none"> Fully closed control: 381 With linear motor: 361 	Scale unit error occurred. <ul style="list-style-type: none"> Initialization error Absolute value detection error Transducer error Overspeed Signal strength error Signal strength alarm 	Cause <ul style="list-style-type: none"> Scale unit abnormality detected. Countermeasure <ul style="list-style-type: none"> Check mechanical installation of the scale unit. Check power supplied to the scale unit for ripple noise and other electrical noise. If there is nothing wrong with the installation condition, power supply, etc., the scale unit must be replaced.
Serial data Error <ul style="list-style-type: none"> Fully closed control: 385 With linear motor: 368 	Communication error occurred. <ul style="list-style-type: none"> No response 	Cause <ul style="list-style-type: none"> An error occurred in communication between the scale unit and the NC unit that prevented data from the scale unit from being received. (No response) Countermeasure <ul style="list-style-type: none"> Check wiring of cables and connectors. Check routing of cables. (For example, for noise due to high current cables.)
Data transfer error <ul style="list-style-type: none"> Fully closed control: 386 With linear motor: 369 	Communication error occurred. <ul style="list-style-type: none"> Communication abnormality 	Cause <ul style="list-style-type: none"> A CRC error or stop bit error occurred in the serial data from the scale unit during communication between the scale unit and the NC device. (Communication failure) Countermeasure <ul style="list-style-type: none"> Check routing of cables. (For example, for noise due to high current cables.)
Physical disconnection Alarm <ul style="list-style-type: none"> Fully closed control: 447 With linear motor: 446 	Communication error occurred. <ul style="list-style-type: none"> Cable discontinuity 	Cause <ul style="list-style-type: none"> Abnormality occurred in the communication between the scale unit and the NC unit due to a cable disconnection. Countermeasure <ul style="list-style-type: none"> Check cables and connector connections.

*The NC device alarm code is the FANUC serial interface specification for position detection and is common to both the α -interface and αi -interface.

■ With the ABS AT1143



The table below shows the relationship between ABS AT1143 alarms and the alarm codes displayed on the servo amplifier (control unit MITSUBISHI CNC series) manufactured by Mitsubishi Electric Corporation.

Servo amplifier alarm codes	Description	Cause and countermeasure
AL2A	Scale unit error <ul style="list-style-type: none"> • Signal strength error • Transducer error • Absolute value detection error • Hardware error • Initialization error • Overspeed 	Cause <ul style="list-style-type: none"> • The detector detected an abnormality. Countermeasure <ul style="list-style-type: none"> • Check mechanical installation of the scale unit. • Check power supplied to the scale unit for ripple noise and other electrical noise. • If there is nothing wrong with the installation condition, power supply, etc., the scale unit must be replaced.
AL28	Scale unit alarm occurred. <ul style="list-style-type: none"> • Thermal alarm • Signal strength alarm 	Cause <ul style="list-style-type: none"> • The detector detected a warning. There is no error in the position data, but installation and use conditions require review. Countermeasure <ul style="list-style-type: none"> • If the ambient temperature of the detector exceeds 60 °C, drive conditions (speed and acceleration) should be reviewed. • Check mechanical installation of the scale unit.
AL16	Communication error occurred. (During servo amplifier initialization) <ul style="list-style-type: none"> • When 3 consecutive errors are received on the servo amplifier side (including no response) 	Cause <ul style="list-style-type: none"> • Communication abnormality occurred between the scale unit and the servo amplifier. (Communication is not possible from the time the servo amplifier power is turned on.) Countermeasure <ul style="list-style-type: none"> • Check cables and connector connections. • Check routing of cables. (For example, for noise due to high current cables.)
AL20	Communication error occurred. (During servo amplifier control) <ul style="list-style-type: none"> • When 3 consecutive errors are received on the servo amplifier side (including no response) 	Cause <ul style="list-style-type: none"> • Communication abnormality occurred between the scale unit and the servo amplifier. (Occurs during controlled by the servo amplifier.) Countermeasure <ul style="list-style-type: none"> • Check cables and connector connections. • Check routing of cables. (For example, for noise due to high current cables.)

5 Specifications



This chapter describes the specifications of this product.

5.1 Scale Unit Specifications

Item		Description
Detection method		Electromagnetic induction.
Effective scale length L_0 (mm)		24 lengths: 140, 240, 340, 440, 540, 640, 740, 840, 940, 1040, 1140, 1240, 1340, 1440, 1540, 1640, 1740, 1840, 2040, 2240, 2440, 2640, 3040
Cross-sectional size		85 x 37 (mm)
Cable configuration		 "2.3 Signal Cable Preparation" on page 17
Position data	"0" position	 "■ ABS origin and elongation base point" on page 13
Resolution		0.05 μm
Indication accuracy (20 °C)		Effective scale length $L_0=140\text{ mm}-2040\text{ mm}$: $(3+5L_0/1000)\ \mu\text{m}$ Effective scale length $L_0=2240\text{ mm}-3040\text{ mm}$: $(5+5L_0/1000)\ \mu\text{m}$
Operating temperature/humidity range		0 °C–50 °C 20 % RH–80 % RH (without condensation)
Storage temperature/humidity range		-20 °C–70 °C 20 % RH–80 % RH (without condensation)
Power supply voltage		ABS AT1153 / ABS AT1143 / ABS AT1103A: DC 5 V \pm 10 %
Maximum current consumption		ABS AT1153: 300 mA (Max) ABS AT1143: 290 mA (Max) ABS AT1103A: 300 mA (Max)
Signal cable length		Up to 29 m (total of signal cable + feedback cable)
Maximum response speed		3 m/sec
Thermal expansion coefficient		$\approx 8 \times 10^{-6}/\text{K}$
Vibration resistance (55 to 2000 Hz)		$\leq 196\text{ m/s}^2$ (20G) *without error
Impact resistance (11 ms, 1/2 sine wave)		For effective scale length $L_0=140\text{ mm}-2040\text{ mm}$: $\leq 343\text{ m/s}^2$ (35G) *without error For effective scale length $L_0=2240\text{ mm}-3040\text{ mm}$: $\leq 294\text{ m/s}^2$ (30G) **without error
Compatible interfaces		<ul style="list-style-type: none"> ■ ABS AT1153 FANUC CORPORATION α-interface / αi-interface (Interface is auto-selected) ■ ABS AT1143 Mitsubishi Electric Corporation Mitsubishi CNC Series control unit: MDS-D/MDS-DH series ■ ABS AT1103A Mitutoyo standard interface (ENSIS)

Item	Description
CE marking/ UKCA marking	EMC Directive/Electromagnetic Compatibility Regulations: EN 61326-1 Immunity test requirement: Clause 6.2 Table 2 Emission limit: Class B RoHS Directive/The Restriction of the Use of Certain Hazardous Substances in Electrical and Electronic Equipment Regulations EN IEC 63000

 
● Note regarding appearance and installation dimensions

- "G" in the figure indicates the machine guide.
- "P" in the figure indicates the aluminum frame mounting surface. Also, "S" indicates the detector mounting surface.
- "Q" and "R" in the figure indicate the reference plane for mounting of the scale unit.
- For descriptions "L0 to L5" in the figure, see  "■ Appearance and installation dimensions table" on page 55 in the next section.
- For fully fixed fastening points, two-point fastening at "A" and "C" in the figure is recommended.
- Depending on effective scale length, position "A" in the figure may be identical to position "C". In such case, two-point fastening at positions "A" and "B" is recommended.
- Be sure to verify installation dimensions using the detector fixing blocks.
- The number of fully-fixed fastening point holes depends on the overall length of the scale. Threaded fasteners for fixing the complete installation should be used at the points indicated by black circles in the figure below according to the number of holes.
For fully-fixed fastening, see  "■ Appearance and installation dimensions" on page 53.

For two holes: Two point fastening at both holes



For three holes: Two point fastening at A and C (recommended)



■ Appearance and installation dimensions table

(Unit: mm)

Code No.	Model No.	Effective scale length L ₀	Maximum travel distance L ₁	Overall scale length L ₂	Fastening pitch		ABS origin · Elongation base point L ₅	Scale fastening holes n (each)	Number of holes for fully-fixed fastening points
					L ₃	L ₄			
559-100-□3	AT11□3◇-140	140	148	259	100	135	90	2	2
559-101-□3	AT11□3◇-240	240	248	359	150	185	147.5	3	3
559-102-□3	AT11□3◇-340	340	348	459	200	235	190	4	2
559-103-□3	AT11□3◇-440	440	448	559	250	285	247.5	5	3
559-104-□3	AT11□3◇-540	540	548	659	300	335	290	6	2
559-105-□3	AT11□3◇-640	640	648	759	350	385	347.5	7	3
559-106-□3	AT11□3◇-740	740	748	859	400	435	390	8	2
559-107-□3	AT11□3◇-840	840	848	959	450	485	447.5	9	3
559-108-□3	AT11□3◇-940	940	948	1059	500	535	490	10	2
559-109-□3	AT11□3◇-1040	1040	1048	1159	550	585	547.5	11	3
559-110-□3	AT11□3◇-1140	1140	1148	1259	600	635	590	12	2
559-111-□3	AT11□3◇-1240	1240	1248	1359	650	685	647.5	13	3
559-112-□3	AT11□3◇-1340	1340	1348	1459	700	735	690	14	2
559-113-□3	AT11□3◇-1440	1440	1448	1559	750	785	747.5	15	3
559-114-□3	AT11□3◇-1540	1540	1548	1659	800	835	790	16	2
559-115-□3	AT11□3◇-1640	1640	1648	1759	850	885	847.5	17	3
559-116-□3	AT11□3◇-1740	1740	1748	1859	900	935	890	18	2
559-117-□3	AT11□3◇-1840	1840	1848	1959	950	985	947.5	19	3
559-118-□3	AT11□3◇-2040	2040	2048	2159	1050	1085	1047.5	21	3
559-119-□3	AT11□3◇-2240	2240	2248	2359	1150	1185	1147.5	23	3
559-120-□3	AT11□3◇-2440	2440	2448	2559	1250	1285	1247.5	25	3
559-121-□3	AT11□3◇-2640	2640	2648	2759	1350	1385	1347.5	27	3
559-122-□3	AT11□3◇-2840	2840	2848	2959	1450	1485	1447.5	29	3
559-123-□3	AT11□3◇-3040	3040	3048	3159	1550	1585	1547.5	31	3

* The □ mark in the Code No. and the □ and ◇ marks in the Model No. designate the following interface specifications.

(□ in the Code No. and Model No. contain the same number.)

For the AT1103A □: 0, ◇: A

For the AT1143 □: 4, ◇: No indication

For the AT1153 □: 5, ◇: No indication

5.2 Optional Accessories

Note that the required signal cable (sold separately) depends on specifications of the interface to be connected.

5.2.1 Signal Cable: Unfinished Cable Specification

- Applicable scale units: ABS AT1153, ABS AT1143
- Connector (detector side): Custom, waterproof specification
- Wire specifications:

Wire color	Signal	Wire color	Signal
Brown	SD	White (2P)	+5 V
Red	*SD	Black (2P)	GND
Orange	RQ(REQ)	Shield wire	F.G.
Yellow	*RQ(REQ)		


*Wires not listed should be left unconnected.

*Prepare a ground bar for the shield and connect it.

- Cable material: PVC sheath $\varnothing 6.5$ without conduit
- Dimensions, Part No.:

■ ABS AT1153/1143 (unfinished cable specification)

Detector side (custom)
Waterproof specification

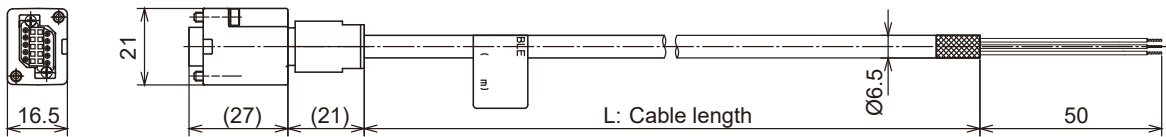

Part No.	Name	Cable length (m)
06AFG596-1	AT1100F/M Unfinished cable, 1 m	1
06AFG596-3	AT1100F/M Unfinished cable, 3 m	3
06AFG596-6	AT1100F/M Unfinished cable, 6 m	6
06AFG596-9	AT1100F/M Unfinished cable, 9 m	9
06AFG596-12	AT1100F/M Unfinished cable, 12 m	12

The unfinished cable specification cable cannot be used with the ABS AT1123 (SIEMENS I/F).

5.2.2 Signal Cable: Mitutoyo Connector Specification

- Applicable scale units: ABS AT1103A
- Connector (detector side): Custom, waterproof specification
- Pin specifications:

Pin No.	Signal	Pin No.	Signal
1, 2	GND	7	RQDT
3, 4	+5 V	8	$\overline{\text{RQDT}}$
5	DT	9–14	Unused
6	$\overline{\text{DT}}$	15	F.G.
		Connector shell	


● Without conduit

- Cable material: PVC sheath $\varnothing 6.5$ without conduit
- Dimensions, Part No.:

■ ABS AT1103A (Mitutoyo connector specification)

● Without conduit

Detector side (custom)
Waterproof specification

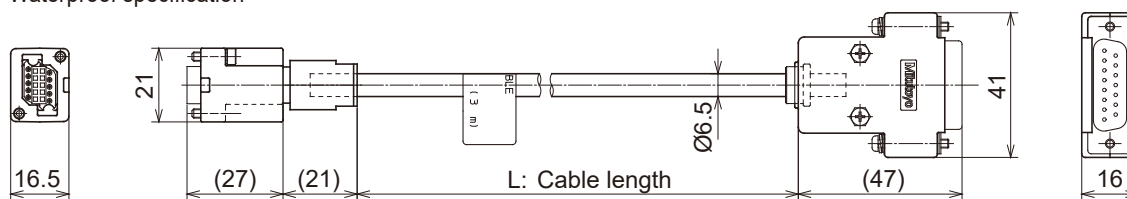


Part No.	Name	Cable length (m)
06AFY915-1	AT1100E Cable D15 1 m	1
06AFY915-3	AT1100E Cable D15 3 m	3
06AFY915-6	AT1100E Cable D15 6 m	6
06AFY915-9	AT1100E Cable D15 9 m	9
06AFY915-12	AT1100E Cable D15 12 m	12

● With conduit

- Cable material: PVC sheath $\varnothing 10.6$ with conduit
- Dimensions, Part No.:

Detector side (custom)
Waterproof specification

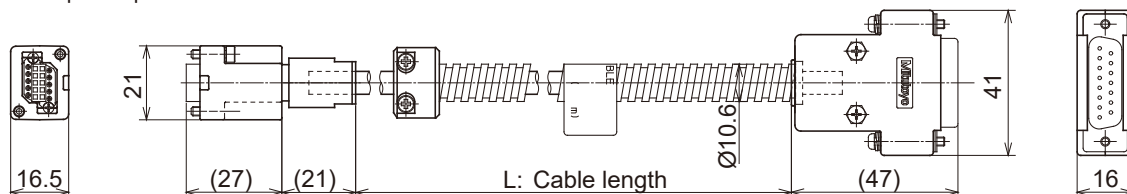

Part No.	Name	Cable length (m)
06AFY916-1	AT1100E C cable D15 1 m	1
06AFY916-3	AT1100E C cable D15 3 m	3
06AFY916-6	AT1100E C cable D15 6 m	6
06AFY916-9	AT1100E C cable D15 9 m	9
06AFY916-12	AT1100E C cable D15 12 m	12

5.2.3 Signal Cable: Fanuc Connector Specification

- Applicable scale units: ABS AT1153
- Connector (detector side): Custom, waterproof specification
- Wire specifications:


Pin No.	Signal	Pin No.	Signal
1	SD	12,14	GND
2	*SD	18,20	+5 V
5	RQ(REQ)	16	F.G.
6	*RQ(REQ)	3, 4, 7-13, 15, 17, 19	Unused

- Cable material: PVC sheath $\varnothing 6.5$ without conduit
- Dimensions, Part No.:

■ ABS AT1153 (FANUC connector specification)

Detector side (custom)
Waterproof specification

NC side (FI-20)
Non-waterproof specification

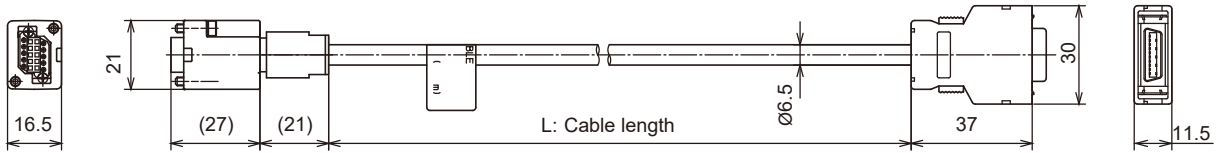

Part No.	Name	Cable length (m)
06AFF921-1	AT1100F Cable FANUC 1 m	1
06AFF921-3	AT1100F Cable FANUC 3 m	3
06AFF921-6	AT1100F Cable FANUC 6 m	6
06AFF921-9	AT1100F Cable FANUC 9 m	9

5.2.4 Signal Cable: Mitsubishi Electric Connector Specification

- Applicable scale units: ABS AT1143
- Connector (detector side): Custom, waterproof specification
- Wire specifications:


Pin No.	Signal	Pin No.	Signal
1	5 V	7	DT
2	GND	8	$\overline{\text{DT}}$
3	RQDT	5,6,9,10	Unused
4	$\overline{\text{RQDT}}$		
Connector shell			F.G.

- Cable material: PVC sheath $\varnothing 6.5$ without conduit
- Dimensions, Part No.:

■ ABS AT1143 (Mitsubishi Electric connector specification)

Detector side (custom)
Waterproof specification

NC side (MDR)
Non-waterproof specification

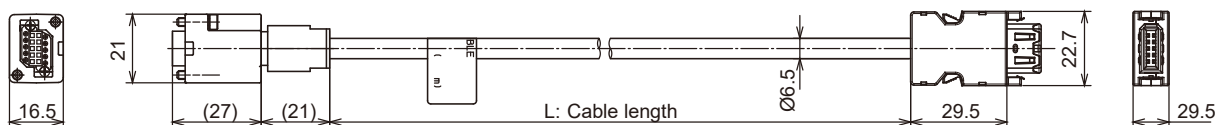


Part No.	Name	Cable length (m)
06AFF957-1	AT1100M Cable MDS-D 1 m	1
06AFF957-3	AT1100M Cable MDS-D 3 m	3
06AFF957-6	AT1100M Cable MDS-D 6 m	6
06AFF957-9	AT1100M Cable MDS-D 9 m	9

MEMO

6 Troubleshooting

This chapter provides a flowchart showing how to check the cause of problems occurring when the power is first turned on or when an alarm occurs during operation, and how to remedy problems.

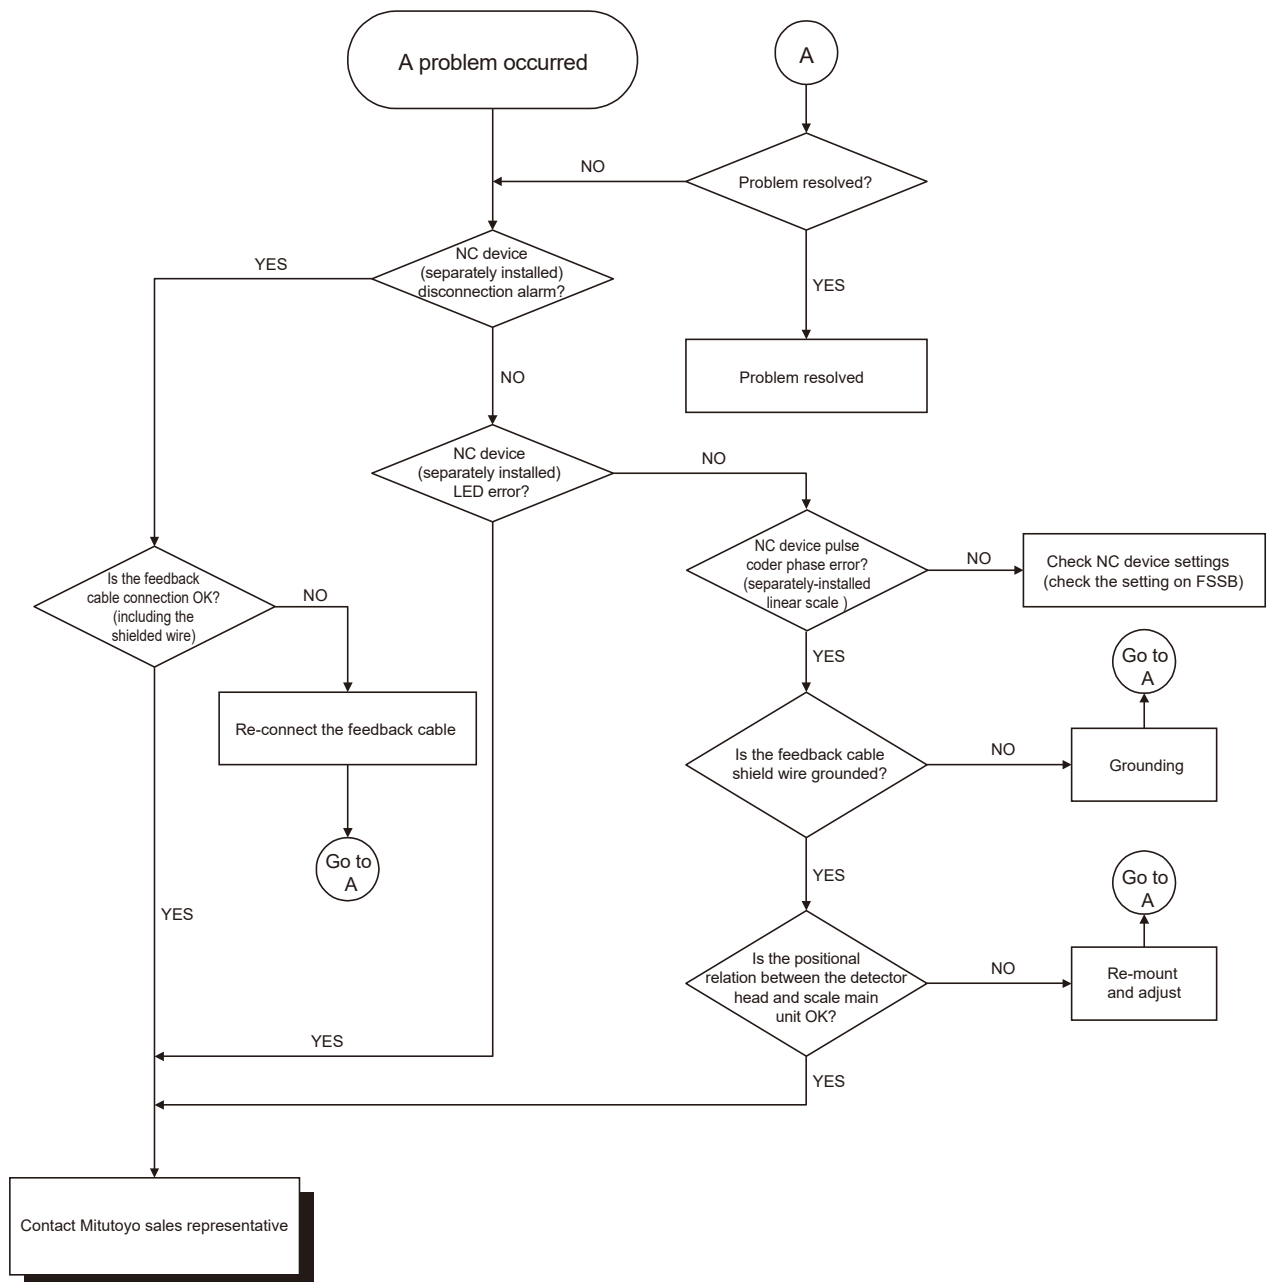

Tips

 
 
 
 
 
Software is available that makes it possible for the customer to make an initial determination regarding malfunctions or errors that occur with this product. Please contact the agent where you purchased the product or Mitutoyo sales representative (☎ "SERVICE NETWORK" on page App-1).

MEMO

7 Appendix

7.1 Quantity of Accessories Used for Installation

(Unit: ea.)

Part No.	197727	06AFL049	06AFL090	06AFL050	06AFL843
Effective scale length (mm)	Hex socket head cap screw M6 x 40 	Hex socket head cap screw M6 x 30 	Internal lock washer 6.6 x 10.2 x 0.5 	Flat washer Nominal 6 small round 	Frame retaining spring 
140	2	11	2	9	6
240	2	11	2	9	6
340	2	11	2	9	6
440	2	11	2	9	6
540	2	11	2	9	11
640	2	11	2	9	11
740	2	11	2	9	11
840	2	11	2	9	11
940	2	18	2	16	11
1040	2	18	2	16	11
1140	2	18	2	16	16
1240	2	18	2	16	16
1340	2	18	2	16	16
1440	2	18	2	16	16
1540	2	18	2	16	16
1640	2	25	2	23	21
1740	2	25	2	23	21
1840	2	25	2	23	21
2040	2	25	2	23	21
2240	2	25	2	23	27
2440	2	33	2	31	27
2640	2	33	2	31	27
2840	2	33	2	31	31
3040	2	33	2	31	31

SERVICE NETWORK

*As of January 2026

Europe

Mitutoyo Europe GmbH

Borsigstrasse 8-10, 41469 Neuss, GERMANY

TEL: 49 (0)2137 102-0

FAX: 49 (0)2137 102-351

Mitutoyo CTL Germany GmbH

Von-Gunzert-Strasse 17, 78727 Oberndorf, GERMANY

TEL: 49 (0)7423 8776-0

FAX: 49 (0)7423 8776-99

KOMEG Industrielle Messtechnik GmbH

Zum Wasserwerk 3, 66333 Völklingen, GERMANY

TEL: 49 (0)6898 91110

FAX: 49 (0)6898 9111100

Germany

Mitutoyo Deutschland GmbH

Borsigstrasse 8-10, 41469 Neuss, GERMANY

TEL: 49 (0)2137 102-0

FAX: 49 (0)2137 86 85

M³ Solution Center Hamburg

Tempowerkring 9·im HIT-Technologiepark
21079 Hamburg, GERMANY

TEL: 49 (0)40 791894-0

FAX: 49 (0)40 791894-50

M³ Solution Center Berlin

Ernst-Lau-Straße 6, 12489 Berlin, GERMANY

TEL: 49(0)30 2611 267

FAX: 49 30 67988729

M³ Solution Center Eisenach

Neue Wiese 4, 99817 Eisenach, GERMANY

TEL: 49 (0)3691 88909-0

FAX: 49 (0)3691 88909-9

M³ Solution Center Ingolstadt

Marie-Curie-Strasse 1A, 85055 Ingolstadt, GERMANY

TEL: 49 (0)841 954920

FAX: 49 (0)841 9549250

M³ Solution Center Leonberg

Am Längenbühl 3, 71229 Leonberg, GERMANY

TEL: 49 (0)7152 6080-0

FAX: 49 (0)7152 608060

Mitutoyo Deutschland GmbH - Small Tool Sales Division

Am Längenbühl 4, 71229 Leonberg, GERMANY

TEL: 49 (0)7152 9237-0

FAX: 49 (0)7152 9237-29

U.K.

Mitutoyo (UK) Ltd. HQ

Joule Road, West Point Business Park,
Andover, Hampshire SP10 3UX, UNITED KINGDOM

TEL: 44 (0)1264 353123

FAX: 44 (0)1264 354883

Coventry M³ Solution Centre

Unit6, Banner Park, Wickmans Drive, Coventry,
West Midlands CV4 9XA, UNITED KINGDOM

TEL: 44 (0)2476 426300

Halifax M³ Solution Centre

Lowfields Business Park, Navigation Close,
Elland, West Yorkshire HX5 9HB, UNITED KINGDOM

TEL: 44 (0)1422 375566

East Kilbride M³ Solution Centre

The Bairds Building, Rankine Avenue, Scottish
Enterprise Technology Park, East Kilbride G75
0QF, UNITED KINGDOM

TEL: 44 (0)1355 581170

France

Mitutoyo France

Paris Nord 2-123 rue de la Belle Etoile, BP
59267 ROISSY EN FRANCE 95957 ROISSY
CDG CEDEX, FRANCE

TEL: 33 (0)149 38 35 00

M³ Solution Center LYON

94A avenue du Progrès 69680 Chassieu,
FRANCE

TEL: 33 (0)149 38 35 70

M³ Solution Center STRASBOURG

Parc de la porte Sud, Rue du pont du péage,
67118 Geispolsheim, FRANCE

TEL: 33 (0)149 38 35 80

M³ Solution Center CLUSES

290 Avenue des Lacs, 74950 Scionzier,
FRANCE

TEL: 33 (0)1 49 38 35 90

M³ Solution Center TOULOUSE

Aeroparc Saint Martin Cellule B08 ZAC de
Saint Martin du Touch 12 rue de Caulet 31300
Toulouse, FRANCE

TEL: 33 (0)1 49 38 42 90

M³ Solution Center RENNES

2, rue Claude Chappe, PA le Vallon - ZAC
Mivoie, 35230 Noyal-Châtillon-sur-Seiche,
FRANCE

TEL: 33 (0)1 49 38 42 10

Italy

Mitutoyo Italiana S.r.l.

Corso Europa, 7 - 20045 Lainate (MI), ITALY
TEL: 39 02 935781
FAX: 39 02 93578255

M³ Solution Center BOLOGNA

Via Stalingrado 67/22D 40128 Bologna, ITALY
TEL: 39 02 93578215

M³ Solution Center CHIETI

Contrada Santa Calcagna - 66020 Rocca S. Giovanni (CH), ITALY
TEL: 39 02 93578280
FAX: 39 02 93578255

M³ Solution Center PADOVA

Via G. Galilei 21/F - 35035 Mestrino (PD), ITALY
TEL: 39 02 93578268
FAX: 39 02 93578255

Netherlands

Mitutoyo Nederland B.V.

Storkstraat 30, 3905 KX Veenendaal,
THE NETHERLANDS
TEL: 31(0)318-534911

Mitutoyo Nederland B.V. / M³ Solution Center Eindhoven

De Run 1115, 5503 LB Veldhoven,
THE NETHERLANDS
TEL: 31(0)318-534911

Mitutoyo Research Center Europe B.V.

De Rijn 18, 5684 PJ Best, THE NETHERLANDS
TEL: 31(0)499-320200
FAX: 31(0)499-320299

Belgium

Mitutoyo Belgium N.V. / M³ Solution Center Melsele

Schaarbeekstraat 20A bus 1, B-9120
Beveren-Kruibeke-Zwijndrecht, BELGIUM
TEL: 32 (0)3-2540444

Sweden

Mitutoyo Scandinavia AB

Släntvägen 6, 194 61 Upplands Väsby,
SWEDEN
TEL: 46 (0)8 594 109 50

Mitutoyo Scandinavia AB / M³ Solution Center Alingsås

Ängsvaktaregatan 3A, 441 38 Alingsås,
SWEDEN
TEL: 46 (0)8 594 109 50

Mitutoyo Scandinavia AB / M³ Solution Center Värnamo

Kalkstensvägen 7, 331 44 Värnamo, SWEDEN
TEL: 46 (0)8 594 109 50

Switzerland

Mitutoyo (Schweiz) AG

Steinackerstrasse 35, 8902 Urdorf,
SWITZERLAND
TEL: 41 (0)447361150

Mitutoyo (Suisse) SA

Rue Galilée 4, 1400 Yverdon-les Bains,
SWITZERLAND
TEL: 41 (0)244259422

Poland

Mitutoyo Polska Sp.z o.o.

Skrzypowa 1, 54-530 Wrocław, POLAND
TEL: 48 (0)71354 83 50
FAX: 48 (0)71354 83 55

Czech Republic

Mitutoyo Česko s.r.o.

Dubská 1635, 415 01 Teplice, CZECH REPUBLIC
TEL: 420 417-514-011
Email: info@mitutoyo.cz

Mitutoyo Česko s.r.o. M³ Solution Center Ivančice

Ke Karlovu 62/10, 664 91 Ivančice, CZECH REPUBLIC
TEL: 420 417-514-011
Email: info@mitutoyo.cz

Mitutoyo Česko s.r.o. M³ Solution Center Ostrava Mošnov

Mošnov 314, 742 51 Mošnov, CZECH REPUBLIC
TEL: 420 417-514-050
Email: info@mitutoyo.cz

Mitutoyo Česko s.r.o. Slovakia Branch

Šoltésovej 346/1, 017 01 Považská Bystrica,
SLOVAKIA
TEL: 421 948-595-590
Email: info@mitutoyo.sk

Hungary

Mitutoyo Hungária Kft.

Galamb József utca 9, 2000 Szentendre,
HUNGARY
TEL: 36 (30) 6410210

Romania**Mitutoyo Romania SRL**

1A Drumul Garii Odai Street, showroom,
Ground Floor, 075100 OTOPENI-ILFOV,
ROMANIA

TEL: 40 (0)311012088

FAX: +40 (0)311012089

Showroom in Brasov

Strada Ionescu Crum Nr.1, Brasov Business
Park Turnul 1, Mezanin, 500446
Brasov-Judetul Brasov, ROMANIA

TEL/FAX: 40 (0)371020017

Finland**Mitutoyo Scandinavia AB Finnish Branch**

Autokeskuksentie 16B, 33960 Pirkkala,
FINLAND

TEL: 358 (0)40 355 8498

Austria**Mitutoyo Austria GmbH**

Salzburger Straße 260/2 und 260/3, 4600
Wels, AUSTRIA

TEL: 43 (0)7242 219 998

**Mitutoyo Austria GmbH Goetzis Regional
showroom**

Lastenstrasse 48a, 6840 Götzis, AUSTRIA

Singapore**Mitutoyo Asia Pacific Pte. Ltd.****Head office / M³ Solution Center**

24 Kallang Avenue, Mitutoyo Building,
SINGAPORE 339415

TEL:(65)62942211

FAX:(65)62996666

Malaysia**Mitutoyo (Malaysia) Sdn. Bhd.****Kuala Lumpur Head Office / M³ Solution
Center**

Mah Sing Integrated Industrial Park, 4, Jalan
Utariid U5/14, Section U5, 40150 Shah Alam,
Selangor, MALAYSIA

TEL:(60)3-78459318

FAX:(60)3-78459346

Penang Branch office / M³ Solution Center

30, Persiaran Mahsuri 1/2, Sunway Tunas,
11900 Bayan Lepas, Penang, MALAYSIA

TEL:(60)4-6411998

FAX:(60)4-6412998

Johor Branch office / M³ Solution Center

70 (Ground Floor), Jalan Molek 1/28, Taman
Molek, 81100 Johor Bahru, Johor, MALAYSIA

TEL:(60)7-3521626

FAX:(60)7-3521628

Thailand**Mitutoyo (Thailand) Co., Ltd.****Bangkok Head Office / M³ Solution Center**

2327 Onnut Road Kwaeng Onnut Khet Suanlu-
ang Bangkok 10250, THAILAND

TEL:(66)2080 3500

Chonburi Branch / M³ Solution Center

7/1, Moo 3, Tambon Bowin, Amphur Sriracha,
Chonburi 20230, THAILAND

TEL:(66)2080 3563

FAX:(66)3834 5788

ACC Branch / M³ Solution Center

122/8, 122/9, Moo 6, Tambon Donhuaroh,
Amphur Muangchonburi, Chonburi 20000,
THAILAND

TEL:(66)2080 3565

Indonesia**PT. Mitutoyo Indonesia****Head Office / M³ Solution Center**

Jalan Sriwijaya No.26 Desa cibatu Kec. Cika-
rang Selatan Kab. Bekasi 17530, INDONESIA

TEL: (62)21-2962 8600

FAX: (62)21-2962 8604

Batam Branch Office

Business Center Adhya Building 3rd Floor
Kompleks Permata Niaga Blok A No. 1, Jalan
jendral Sudirman Kelurahan Sukajadi, Keca-
matan Batam Kota, Kepulauan Riau 29444,
INDONESIA

TEL: (62)-778-4888000

Vietnam**Mitutoyo Vietnam Co., Ltd****Hanoi Head Office / M³ Solution Center**

1st & 2nd floor, MHDl Building, No. 60 Hoang
Quoc Viet Road, Nghia Do Ward, Cau Giay
District, Hanoi, VIETNAM

TEL:(84)24-3768-8963

FAX:(84)24-3768-8960

**Ho Chi Minh City Branch Office / M³ Solu-
tion Center**

Unit No. B-00.07, Ground Floor, C1 Building,
No. 6, Street D9, An Loi Dong Ward, Thu Duc
City, Ho Chi Minh City, VIETNAM

TEL:(84)28-3840-3489

FAX:(84)28-3840-3498

Hai Phong City Branch Office

Room 511, 5th Floor, Thanh Dat 3 Building, No.
4 Le Thanh Tong Street, May To Ward, Ngo
Quyen District, Hai Phong City, VIETNAM

TEL:(84)22-5398-9909

Philippines**Mitutoyo Philippines, Inc.****Head Office / M³ Solution Center**

Unit 1B & 2B LTI, Administration Building 1,
Annex 1, North Main Avenue, Laguna Tech-
nopark, Binan Laguna 4024, PHILIPPINES
TEL/FAX:(63) 49 544 0272

Australia**Mitutoyo Oceania Pty Ltd**

Unit1 3 Rocklea Drive, Port Melbourne VIC
3207, AUSTRALIA
TEL:61-3-7053-1990

India**Mitutoyo South Asia Pvt. Ltd. Head Office**

C-122, Okhla Industrial Area, Phase-I,
New Delhi-110 020, INDIA
TEL: (91) 11-40578485/86

MSA Technical Center

Plot no. 65, Ground Floor, Udyog Vihar,
Phase-4 Gurgaon, Haryana - 122016, INDIA
TEL : (91) 124-2340286/287

Mumbai Region Head office

303, Sentinel Hiranandani Business Park
Powai, Mumbai-400 076, INDIA
TEL: (91) 22-25700684/685/837/839

Pune Office / M³ Solution Center

G4/G5, Pride Kumar Senate, Off. Senapati
Bapat Road, Pune-411 016, INDIA
TEL:(91) 20-25660043/44/45

Ahmedabad Office / M³ Solution Center

A-104 & A-105, First Floor, Solitaire Corporate
Park, Near Divya Bhaskar Press, S.G. Road,
Ahmedabad - 380 015, INDIA
TEL: (91) 079 - 29704902/903

**Bengaluru Region Head office / M³ Solu-
tion Center**

116/117-2, Ground Floor, Sy. No. 93 & 94, 3rd
Phase, Peenya Industrial Area, Bengaluru-560
058, INDIA
TEL: (91) 80-25630946/47/48/49

Coimbatore Office

Regus, Srivari Srimath, 3rd Floor, Door
No:1045, Avinashi Road, Coimbatore - 641
018,INDIA
TEL: (91) 9345005663

Chennai Office / M³ Solution Center

No. 624, Anna Salai Teynampet, Chennai-600
018, INDIA
TEL: (91) 44-24328823/24/25

Kolkata Office

Unit No. 1208,Om Tower, 32,J.L.Nehru Road,
Kolkata-700 071, INDIA
TEL: (91) 33-22267088/40060635/22266817

Taiwan**Mitutoyo Taiwan Co., Ltd. / M³ Solution
Center Taipei**

4F., No.71, Zhouzi St., Neihu Dist.,Taipei City
114, TAIWAN
TEL:886(2)5573-5900
FAX:886(2)8752-3267

**Taichung Branch / M³ Solution Center
Taichung**

1F., No. 299, Gaotie 1st Rd., Wuri Dist., Taic-
hung City 414, TAIWAN
TEL:886(4)2338-6822
FAX:886(4)2338-6722

**Kaohsiung Branch / M³ Solution Center
Kaohsiung**

1F., No.31-1, Haibian Rd., Lingya Dist.,
Kaohsiung City 802, TAIWAN
TEL:886(7)334-6168
FAX:886(7)334-6160

South Korea**Mitutoyo Korea Corporation****Head Office / M³ Solution Center**

33, Eungyejungang-ro 306beon-gil, Siheung-si,
Gyeonggi-do, 15120 KOREA
TEL:82(31)361-4200
FAX:82(31)361-4201

Busan Office / M³ Solution Center

(3150-3, Daejeo 2-dong) 8,Yutongdanji 1-ro
49beon-gil, Gangseo-gu, Busan, 46721
KOREA
TEL:82(51)324-0103
FAX:82(51)324-0104

Daegu Office / M³ Solution Center

(Galsan-dong, Daegu Business Center), 301-
Ho, 217, Seongseogongdan-ro, Dalseo-gu,
Daegu 42704 KOREA
TEL:82(53)593-5602
FAX:82(53)593-5603

Daegjeon Office

204-Ho, 419, Expo-ro, Yuseong-gu, Daejeon,
34051 KOREA
TEL:82(42)719-1270
FAX:82(42)719-5603

China**Mitutoyo Measuring Instruments (Shang-
hai) Co., Ltd.**

18/F, NEW BUND Shun Tak Center, No.18,
Lane 666, West Haiyang Road, Pudong New
District, Shanghai 200124, CHINA
TEL:86(21)5836-0718
FAX:86(21)5836-0717

Suzhou Office / M³ Solution Center China (Suzhou)

1/2 Floor, Building 4, No.175 Songbei Road,
Suzhou Free Trade Zone, Suzhou City, Jiangsu
215000, CHINA

TEL:86(512)6522-1790

FAX:86(512)6251-3420

Wuhan Office / M³ Solution Corner

Room 1701, Wuhan Wanda Center, No. 96,
Linjiang Road, Wuchang District, Wuhan
Hubei 430060, CHINA

TEL:86(27)8544-8631

FAX:86(27)8544-6227

Chengdu Office

Room 1-102, 1st Floor, Unit 1, Building 1, No.
24, Wannian Road (Wanniancang Cool), Chen-
ghua District, Chengdu City, Sichuan 610056,
CHINA

TEL:86(28)8671-8936

FAX:86(28)8671-9086

Hangzhou Office

Room 329, 3F, Building D, West Square of
Hangzhoudong Railway Station, No. 260 Xin-
feng Road, Shangcheng District, Hangzhou
City, Zhejiang 310002, CHINA

TEL: 86(571)8288-0319

FAX: 86(571)8288-0320

Tianjin Office / M³ Solution Center China (Tianjin)

Room D 12/F, TEDA Building, No.256 Jie-fang
Nan Road Hexi District, Tianjin 300042, CHINA

TEL:86(22)5888-1700

FAX:86(22)5888-1701

Changchun Office

Room 815, 8F, Building A1, Upper East
International No.3000 Dongsheng Street,
Erdao District, Changchun, Jilin, 130031,
CHINA

TEL:86(431)8192-6998

FAX:86(431)8192-6998

Chongqing Office

Room 1312, Building 3, Zhongyu Plaza, No.86,
Hongjin Avenue, Longxi Street, Yubei District,
Chongqing, 400000, CHINA

TEL:86(23)6595-9950

FAX:86(23)6595-9950

Qingdao Office

Room 638, 6F, No.192 Zhengyang Road,
Chengyang District, Qingdao, Shandong,
266109, CHINA

TEL:86(532)8096-1936

FAX:86(532)8096-1937

Xi'an Office

Room 1503 Jianke Building, No.99 Yanta Road,
Beilin District, Xi'an City, Shaanxi 710054,
CHINA

TEL:86(29)8538-1380

FAX:86(29)8538-1381

Dalian Office / M³ Solution Center China (Dalian)

Room A-106 Shuijing SOHO, No.16 Harbin
Road, Economic Development Zone, Dalian,
116600 CHINA

TEL:86(411)8718 1212

FAX:86(411)8754-7587

Zhengzhou Office

Room 5003, 50th Floor, South Tower of
Greenland Centre, No.36 Yulin North Road,
Zhengdong New District, Zhengzhou, Henan,
450000, CHINA

TEL:86(371)6097-6436

FAX:86(371)6097-6981

**Dongguan Office / M³ Solution Center Chi-
na (Dongguan)**

Room 201, Building 1, No. 405, Tai'an Road,
Chang'an Section, Chang'an Town, Dongguan
City, Guangdong 523850, CHINA

TEL:86(769)8541 7715

FAX:86(769)-8541 7745

Fuzhou Office

Unit 03, 7th floor of East Tower, Sansheng
International Center, No.118 Wusi Road, Gulou
Distrit, Fuzhou City, Fujian 350001, CHINA

TEL: 86 (591) 8761 8095

FAX: 86 (591) 8761 8096

Changsha Office

Room 2207, Building 1, Shiner International
Plaza, No. 88, Kaiyuan Middle Road, Chang-
sha City, Hunan 410100, CHINA

TEL: 86 (731) 8401 9276

FAX: 86 (731) 8401 9376

Changzhou Office

Room 1502, Joint Financial Tower, No.255,
Tongjiang North Road, Tianning District,
Changzhou City, Jiangsu 2130002, CHINA

TEL:86(519)8815 8319

FAX:86(519)8815 8319

Wenzhou Office

Room 512, Building 4, Xinjingdujiayuan,
Sanyang Street, Ouhai District, Wenzhou City,
Zhejiang 325014, CHINA

TEL:86(577)8641 5280

Hefei Office

Unit B3111-1, 1F, Block B3, Huliabaodi Huiyu-
an, Heping Road, Yaohai District, Hefei City,
Anhui 230001, CHINA

TEL: 86(551)6560 1006

Mitutoyo Measuring Technology (Suzhou) Co., Ltd.

1/2 Floor, Building 4, No.175 Songbei Road,
Suzhou Free Trade Zone, Suzhou City, Jiangsu
215000, CHINA

TEL:86(512)6252-2660

FAX:86(512)6252-2580

USA

Mitutoyo America Corporation

965 Corporate Blvd., Aurora, IL 60502, U.S.A.

TEL:1-(630)820-9666 Toll Free No. 1-888-648-8869

FAX:1-(630)978-3501

Headquarters (Aurora) / M³ Solution Center

965 Corporate Blvd., Aurora, IL 60502, U.S.A.

Seattle (Renton) Office / M³ Solution Center

1000 SW 34th St. Suite G, Renton,
WA 98057 U.S.A.

TEL:1-(888)-648-8869

Houston Office / M³ Solution Center

4560 Kendrick Plaza Drive Suite 120 Houston,
TX 77032, U.S.A.

TEL:1-(888)-648-8869

FAX:1-(281)227-0937

Cincinnati (Mason) Office / M³ Solution Center

6220 Hi-Tek Ct., Mason, OH 45040, U.S.A.

TEL:1-(888)-648-8869

FAX:1-(513)754-0718

Detroit (Novi) Office / M³ Solution Center

46850 Magellan Drive, Suite 100 Novi, MI
48377, U.S.A.

TEL:1-(888)-648-8869

FAX: 1-(248)-926-0928

Los Angeles (City of Industry) Office / M³ Solution Center

16925 E. Gale Ave., City of Industry, CA 91745,
U.S.A.

TEL:1-(888)-648-8869

FAX:1-(626)369-3352

Charlotte (Huntersville) Office / M³ Solution Center

11515 Vanstory Dr., Suite 140, Huntersville, NC
28078, U.S.A.

TEL:1-(888)-648-8869

FAX:1-(704)875-9273

Boston (Marlborough) Office / M³ Solution Center

753 Forest Street, Suite 110, Marlborough,
MA 01752, U.S.A.

TEL:1-(888)648-8869

FAX:1-(508)485-0782

West Chester (Ohio) / Metrology Service Center

8876 Beckett road, West Chester, OH 45069,
USA

TEL:1-(888)-648-8869

Mitutoyo America Corporation Calibration Lab

965 Corporate Blvd., Aurora, IL 60502, U.S.A.

TEL:1-(888)-648-8869

FAX:1-(630)978-6477

Mitutoyo America Corporation CT-Lab Chicago

965 Corporate Blvd., Aurora, IL 60502, U.S.A.

TEL: 1-(888)-648-8869

FAX: 1-(630)-820-3418

Mitutoyo Research & Development America, Inc.

11533 NE 118th St., Kirkland,
WA 98034-7111, U.S.A.

TEL:1-(425)821-3906

FAX:1-(425)821-3228

Mitutoyo Research & Development America,
Inc. - California Office

16925 Gale Ave. City of Industry,
CA 91745-1806 U.S.A.

TEL: 1-(425)821-3906

FAX: 1-(425)821-3228

Canada

Mitutoyo Canada Inc.

2121 Meadowvale Blvd., Mississauga,
Ont. L5N 5N1., CANADA

TEL:1-(905)821-1261

FAX:1-(905)821-4968

Montreal Office

7075 Place Robert-Joncas Suite 129, Montreal,
Quebec H4M 2Z2, CANADA

TEL:1-(514)337-5994

FAX:1-(514)337-4498

Brazil

Mitutoyo Sul Americana Ltda.

Head office / M³ Solution Center

Avenida Mimes nº 25 – Loteamento Multivias II,
Jardim Ermida I, CEP 13212-216 Jundiá - SP,
BRASIL

TEL: 55 (11) 5643-0004/0041

Filial Curitiba / M³ Solution Center

Rua Sergipe, nº 101, Sala A, Bairro Boneca do
Iguaçu, São José dos Pinhais – Paraná – BRA-
SIL CEP 83040120

TEL: 55 (41) 3534-1728

Filial Joinville / M³ Solution Center

Rua Sorocaba, No.265, Bairro Floresta, Joinville, Santa Catarina, BRASIL, CEP 89212-210
TEL: 55 (47) 3025-8062

Filial Porto Alegre / M³ Solution Center

Rua Emilio Boeckel nº 325, Bairro: Flao, São Leopoldo - RS, BRASIL CEP 93020-600
TEL: 55 (51) 3037-9383

Irapuato Office / M³ Solution Center

Boulevard a Villas de Irapuato No. 1460 L.1
Col. Ejido
Irapuato C.P. 36643
Irapuato, Gto., MÉXICO
TEL: 52 (01-462) 144-1200 and 144-1400

Argentina**Mitutoyo Sul Americana Ltda.****Argentina Branch / M³ Solution Center**

AV. MITRE 1249 Piso. PB- FLORIDA – BUENOS AIRES ARGENTINA
TEL:54 (11) 4730-1433
FAX:54 (11) 4730-1411

Mexico**Mitutoyo Mexicana, S.A. de C.V.**

Industria Eléctrica No.15, Parque Industrial, Naucalpan de Juárez, Estado de México
C.P.53370, MÉXICO
TEL: 52 (01-55) 5312-5612
FAX: 52 (01-55) 5312-3380

Monterrey Office / M³ Solution Center

Blv. Interamericana No. 103, Parque Industrial FINSA, C.P. 66636 Apodaca, N.L., MÉXICO
TEL: 52(01-81) 8398-8227/8228/8242/8244
FAX: 52(01-81) 8398-8226

Tijuana Office / M³ Solution Center

Calle José María Velazco 10501-C, Col. Cd. Industrial Nueva Tijuana, C.P. 22500 Tijuana, B.C., MÉXICO
TEL: 52 (01-664) 647-5024

Querétaro Office / M³ Solution Center

Av. Cerro Blanco No.500-1, Colonia Centro Sur, Querétaro, Querétaro, C.P. 76090, MÉXICO
TEL: 52 (01-442) 340-8018, 340-8019 and 340-8020
FAX: 52 (01-442) 340-8017

Mitutoyo Mexicana, S.A. de C.V. Querétaro Calibration Laboratory

Av. Cerro Blanco 500 30 Centro Sur, Querétaro, Querétaro, C.P. 76090, MÉXICO
TEL: 52 (01-442) 340-8018, 340-8019 and 340-8020
FAX: 52 (01-442) 340-8017

Aguascalientes Office / M³ Solution Center

Av. Aguascalientes No. 622, Local 15 Centro Comercial El Cilindro Fracc. Pulgas Pandas Norte, C.P. 20138, Aguascalientes, Ags. MÉXICO
TEL: 52 (01-449) 174-4140 and 174-4143

Revision Record

Date of publication	Revision status	Details of revision
August 1, 2017	First edition	Publication
November 1, 2018	Revised first edition	Revisions due to increase/decrease in models listed
January 1, 2021	Revised second edition	Accommodation of changes in harmonized European standards, etc.
July 1, 2021	Revised third edition	Additions and changes due to application of the UKCA (UK Conformity Assessed) marking, etc.
March 1, 2022	Revised fourth edition	Changes in notation and presentation
May 1, 2025	Revised fifth edition	Change of China RoHS compliance
January 1, 2026	Revised sixth edition	Correction of errors

Mitutoyo Corporation

20-1, Sakado 1-Chome, Takatsu-ku, Kawasaki-shi, Kanagawa 213-8533, Japan
Tel: +81 (0)44 813-8230 Fax: +81 (0)44 813-8231
Home page: <https://www.mitutoyo.co.jp/global.html>

For the EU Directive, Authorized representative and importer in the EU:
Mitutoyo Europe GmbH
Borsigstrasse 8-10, 41469 Neuss, Germany

For the UK Regulation, Authorized representative and importer in the UK:
Mitutoyo (UK) Ltd.
Joule Road, West Point Business Park, Andover, Hampshire SP10 3UX, UNITED KINGDOM