


ABSOLUTE ID-C112J シグナルデジマチックインジケータ / Signal Digimatic Indicator

No.99MAH006B
SERIES No.543

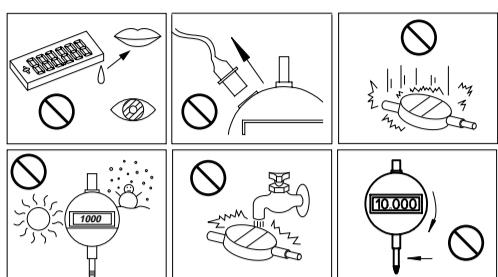

はじめに

ABSOLUTE ID-C112Jは、上／下限値を設定することでその判定結果を外部機器へ出力することができる測定器です。ご使用になる前にこの取扱説明書と外部機器の取扱説明書を併せてよくお読み下さい。また本書は、大切に保管して下さい。本製品の仕様及び本書の内容は将来予告無しに変更する事があります。万一弊社の製造販売に起因する不具合がお買上より一年以内に発生した場合、無償修理致しますので求めの販売店、営業所までご連絡下さい。

廃棄に関する注意

警告

- 本製品には液晶が使用されています。廃棄にあたっては、各地方自治体の条例または規制などに従ってください。
- 液晶の内部には刺激性物質が含まれています。万一液状の内容物が誤って目や皮膚などに付着した場合、清浄な流水で洗浄して下さい。口に入った場合は、直ちに口内を洗浄し大量の水を飲んで吐き出した後医師に相談して下さい。

ご使用上の注意事項

以下の行為、状況は本製品の故障・誤動作の原因となりますのでお気を付け下さい。

重要



- 外部機器との接続には十分注意して下さい。誤接続により本製品及び外部機器が破壊される場合があります。
- 衝撃や急激なショックを与えることなく、過度の力を加えないで下さい。
- 分解、改造しないで下さい。また本体から接続ケーブルを外さないで下さい。
- 本製品の表示部は回転しません。表示部に無理な力を加えますと故障の原因になります。
- 尖ったもの(ドライバー・ボールペンの先など)でスイッチ操作をしないで下さい。
- お手入れの際は、乾いた柔らかい布等をそのまま、もしくは希釈した中性洗剤に浸してご利用下さい。有機溶剤(シンナー、ベンジン等)を使用すると変形や故障の原因になります。

注記

本製品及び測定の対象は、十分温度に慣らしてから測定を開始し、できるかぎり温度変動の少ないところでご使用下さい。

1. 各部名称・寸法

- 単位なき寸法値はmmを示します。
- ①はAmerican Gage Design(AGD)を表す記号で、ANSI規格 AGD Group2の要求する寸法部を示す。(サフィックスにE、Tの付くタイプについて適用)
- キャップ 耳金 平裏蓋 ステム ゴムブーツ スピンドル 測定子 接続ケーブル 2色 LED LCD レバー取付けねじ レリーズ取付け穴

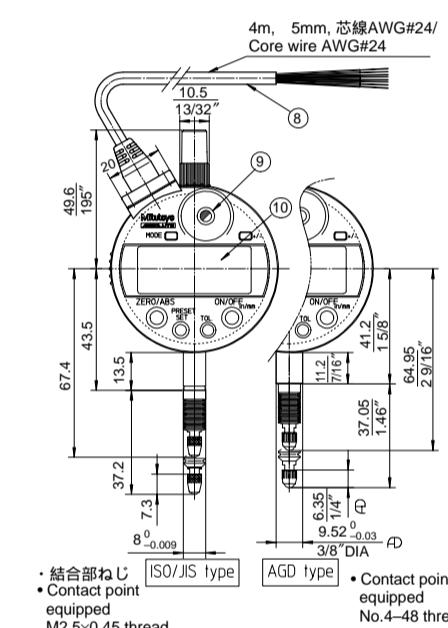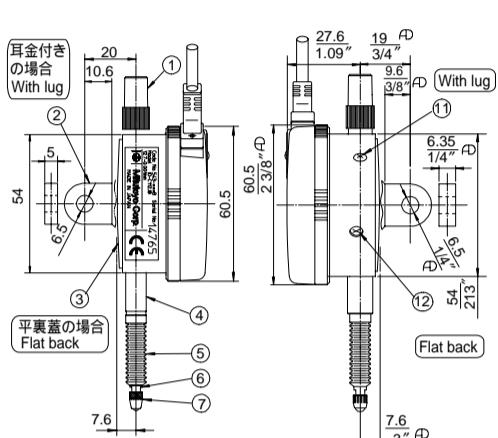

2. スイッチの名称と機能

名称	条件	機能説明
+ / -	通常モード(2秒未満)	カウント方向の切り替え
	全モード(2秒以上)	ファンクションロック解除
ON/OFF/ in/mm	全モード(2秒未満)	電源のON/OFF
	全モード(2秒以上)	mm系 inch系(輸出仕様のみ)
TOL.	全モード	公差設定への切り替え及び設定
	公差設定中	上／下限値の置数及び桁変更
PRESET /SET	通常モード	プリセットへの切り替え及び設定
	プリセット中	プリセット値の置数及び桁変更
	その他	計測モード切り換え時の確定 検出ピーク値のホールド解除
ZERO/ABS	通常モード	ABS系 INC系
	通常モード(2秒未満)	ゼロセット(INC系)
	数値設定中	数値設定を中止し、設定開始直前へ戻る
	MAX, MINホールドモード(2秒以上)	ホールド位置をゼロとする(ABS系) 現在位置でゼロセット(INC系)
MODE	通常モード(2秒未満)	計測モードの切り替え
	全モード(2秒以上)	通常モードへ戻る

3. セットアップ

3.1 スタンド、治具への取付け

本製品はステムまたは耳金を固定してお使いください。

重要

- 止めネジなどでステムを直接締め付けて固定する方法は避けてください。 $300\text{N}\cdot\text{cm}$ 以上の締め付けトルクで固定した場合、作動不良が生じる恐れがあります。
- スピンドルに対し、垂直な方向の荷重やねじれがかかるようなご使用は避けて下さい。

注記

- スピンドルが基準面と被測定面に対して垂直になるように固定してください。軸線(スピンドル)が基準面(測定面)に垂直でない場合、測定値に誤差が加算されます。例えば、基準面から軸線の傾斜角度 θ の時の測定12mmあたりの誤差は $=1^\circ = 0.002\text{mm}$, $=2^\circ = 0.007\text{mm}$, $=3^\circ = 0.016\text{mm}$ となります。
- 治具などに取付ける際は、#8G7(+0.005 ~ +0.02)程度の嵌合部を持つリリースホールドにてステムを固定する方法を推奨します。

3.2 レリーズ # 540774 / 別売 取付け

レリーズ穴のねじ⑫(M.2.6)を#0の十字ドライバで外しレリーズをねじ込みます。

重要



- レリーズを強く引張ったり、叩いたりするとねじ山が欠落することがあります。
- レリーズ以外のものを差し込んだり、過剰に力がかかると故障する恐れがあります。

3.3 レバー # 902011 / 別売 取付け

- キャップを外し、スピンドル上端のねじ(M.2.5)を取り外してストップねじ⑮を取り付けます。
- 本機側面のレバー取付けねじ⑯をゆるめ、レバー⑰をストップねじ⑮に掛けながら取り付けます。

3.4 測定子の交換

- 弊社ダイヤルゲージ用オプションの各種特殊測定子・継ぎ足しロッドがご利用頂けます。
- スピンドルが回らない様に、ゴムブーツ下のスピンドル平面部をウェスなどを介してプライヤで固定し、別のプライヤで測定子を挟んで回して、測定子の取り外し・取付けを行なってください。
- 上記作業の際スピンドルを確実に固定して下さい。確実に固定しなければ故障の恐れがあります。また、スピンドルに傷がつくと動作不良の原因となります。
- 測定子は、ゴムブーツが破れないように注意して交換してください。
- 測定子の変更に伴い、外観寸法・測定力の変化、測定方向の制限などが生じる場合があります。
- 測定精度に測定子の器差(フラット測定子の直角度、ローラー測定子の芯振れなど)が累積されます。

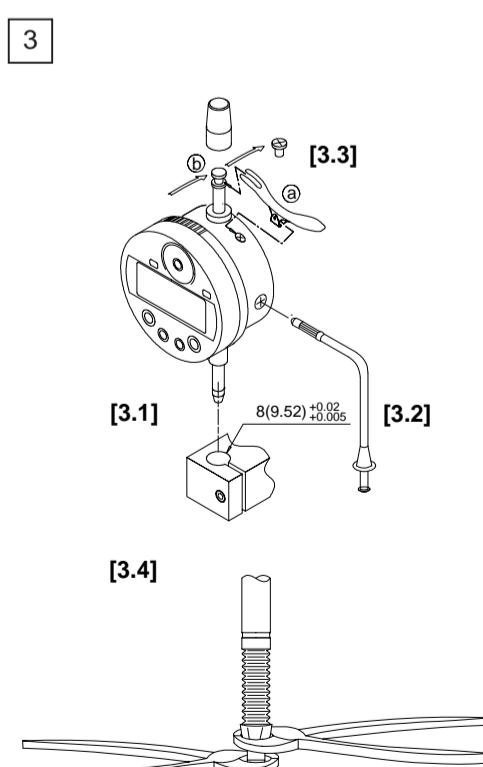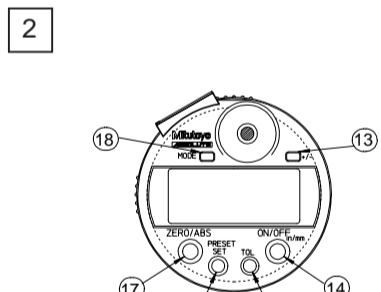

INTRODUCTION

ABSOLUTE ID-C112J is the measuring instrument that can output the judgment result to external devices by setting the upper/lower limits. To obtain the highest performance from this instrument and to use it safely, read this User's Manual and the manual for the external device prior to use. After reading, retain this manual for future reference. Specifications of this instrument and information in this manual are subjected to change without notice. In the event that the instrument should prove defective in workmanship or material, within one year from the date of original purchase for use, it will be repaired or replaced, at our option, free of charge upon its prepaid return to us. Please contact Mitutoyo sales office.

PRECAUTIONS ON DISPOSAL

- WARNING**
- For this instrument the LCD is used. When disposing, follow the local ordinances or regulations of respective local governments.
 - The LCD part contains irritating substance. Should the liquid content accidentally come into contact with the eye or skin, rinse with water immediately and consult a physician. Should it get into the mouth, immediately rinse inside the mouth, swallow plenty of water, vomit, then consult a physician.

PRECAUTIONS ON USE

Observe the following precautions to avoid instrument failure and malfunction:

IMPORTANT

- Take sufficient care for the connection with the external device. Connecting improperly may damage this instrument and the external device.
- Do not apply sudden shock or excessive force to this instrument.
- Do not disassemble and modify this instrument. Do not disconnect the connecting cable from this instrument.
- The display unit of this instrument can not be rotated. Applying excessive force to the display unit may cause instrument failure.
- Do not press the switch with a pointed object, such as a screwdriver or ball-point pen.
- To clean the instrument, use a soft cloth soaked in a diluted neutral detergent. Do not use any organic solvent (thinner or benzene). It may deform or damage the instrument.

NOTE

Use the instrument in a temperature-controlled room that has minimum temperature fluctuation. Allow a sufficient time for both the instrument and workpiece to thermally stabilize before performing measurement.

1. DIMENSIONS AND NOMENCLATURE

- Dimensions without unit are in mm.
- ① is the symbol for American Gage Design (AGD) representing the dimensioning meets the ANSI standard for AGD Group 2 indicator. (Applicable to the model with suffix E or T.)
- ② Cap
- ③ Lug
- ④ Flat back
- ⑤ Stem
- ⑥ Rubber boot
- ⑦ Spindle
- ⑧ Contact point
- ⑨ Connecting cable
- ⑩ Two-tone LED
- ⑪ LCD
- ⑫ Lever mounting screw
- ⑬ Release hole

2. SWITCHES AND FUNCTIONS

Switch	Condition	Function
⑬ +/-	Normal mode (<2sec)	Switches the counting direction
⑭ ON/OFF / in/mm	All modes (2sec or more)	Function lock Release
⑮ TOL.	All modes (<2sec)	Turns ON/OFF the Power
⑯ PRESET /SET	All modes (2sec or more)	Metric system inch system (unique to mm/inch model)
⑰ ZERO/ABS	All modes	Switches to the tolerance setting mode/Sets the tolerance value
⑱ MODE	During the tolerance setting	Displaces the upper/lower limits and selects the digit
	Normal mode	Switches to the preset mode/Sets the preset value
	Zero-set (INC system)	Displaces the preset value and selects the digit
	Others	Determines the measurement mode switched to
	Normal mode	Releases the hold of the peak value detected
	Zero-set (INC system)	Releases the hold of the peak value detected
	During the value setting	Cancels the value setting and returns to the state just before start setting
	MAX, MIN hold mode (2sec or more)	Sets the hold position to zero (ABS system)
	Normal mode (<2sec)	Zero-set at the current position (INC system)
	All modes (2sec or more)	Returns to the normal mode

3. SETUP

3.1 Securing the Instrument

Secure the instrument with a fixture by the stem or lug.

IMPORTANT

- Avoid fixing the stem directly using a lock screw. If fixed under a clamping torque of $300\text{N}\cdot\text{cm}$ or more, the spindle may not move smoothly.
- Do not exert load on the spindle in the perpendicular direction and do not twist the spindle.

NOTE

- Set up the instrument with the spindle perpendicular to the reference plane or the measured surface. If the spindle axis is not perpendicular to the reference plane (measured surface), measurement errors will result.
- If the spindle axis is inclined from the perpendicular line to the reference plane, measurement error will be as follows for the measured length of 12 mm:
 $=1^\circ = 0.002\text{mm}$, $=2^\circ = 0.007\text{mm}$, $=3^\circ = 0.016\text{mm}$

- If the instrument is to be secured with a fixture, fix it by the stem in a slotted hole of approx. #8G7 (+0.005 to +0.02) or #9.52 (+0.005 to +0.02).

3.2 Mounting the Release (#540774/optional)

Remove the screw ⑫ (M.2.6) in the release hole with a #0 Philips screwdriver and screw the release in.

IMPORTANT

- Jerking or knocking the release may cause the thread to be chipped off.
- Do not insert other than the release to the hole or apply excessive force. Caution, risk of instrument failure.


3.3 Mounting the Lifting Lever [optional, #902011(ISO)/#902794(AGD)]

- Remove the cap, unscrew the screw (M.2.5(ISO)/#4-48UNF(AGD)) at the top of the spindle, then mount the stop screw ⑮ instead.
- Loosen the lever mounting screw ⑯, and mount the lever ⑰ while hanging it on the stop screw ⑮.

3.4 Replacing the Contact Point

- Various type of contact points and extension rods are optionally available.
- Secure the flat part of the spindle below the rubber boot with pliers protecting it with rags, hold the contact point with another pliers, and turn to demount/mount it.
- Use a rag to protect and to hold securely the spindle during the above work to avoid instrument failure. The spindle does not move smoothly if damaged.
- Replace the contact point with care so as not to break the rubber boot.
- Different contact point results in different external dimensions, measuring force, and limitation of measuring direction.
- Contact point error such as perpendicularity of a flat contact point, run-out of roller point, etc. adds to the measurement error.

Mitutoyo

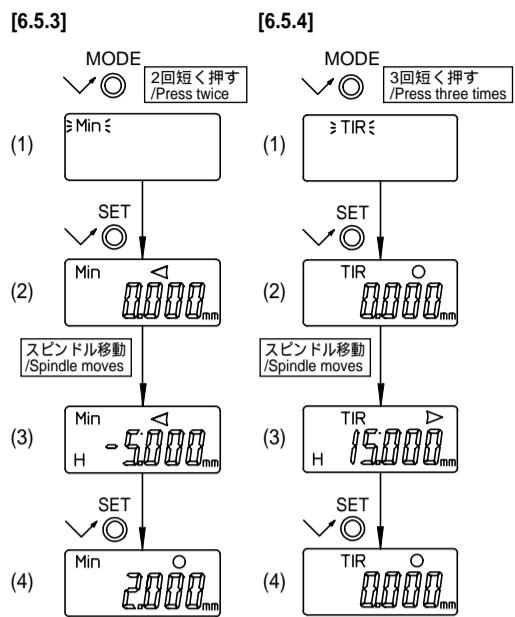


- 6.5.3 MIN (最小値)ホールドモード**
- 変動する測定値の最小値を保持し、公差値に対する最小値の判定結果を出力します。
 - ABS系・INC系での動作の違いは、MAXホールドモードと同様です。
- 通常モードで[MODE]スイッチを2回短く押すと、“Min”が点滅します。
 - [SET]スイッチを短く押すと最小値ホールドモード(“Min”点灯)に入ります。
 - スピンドルが移動すると最小値を保持します。(“H”点灯)
 - [SET]スイッチを短く押すと、ホールドが解除され、現在の位置を表示し、新たな最小値測定を開始します。また、HOLD_RESET(外部接続端子)を使用することによりホールドの解除を行なうことができます。


- 6.5.4 TIR (振れ幅)ホールドモード**
- 変動する測定値の振れ幅を保持し、公差値に対する振れ幅の判定結果を出力します。
 - このモードのみABS系・INC系ともに全く同じ動作をします。
- 通常モードで[MODE]スイッチを3回短く押すと、“TIR”が点滅します。
 - [SET]スイッチを短く押すとTIRホールドモード(“TIR”点灯)に入り、ゼロを表示します。
 - スピンドルが移動すると振れ幅を保持します。(“H”点灯)
 - [SET]スイッチを短く押すと、ゼロセットされ、新たな振れ幅測定を開始します。また、HOLD_RESET(外部接続端子)を使用することによりホールドの解除を行なうことができます。

注記

TIRホールドモードにおける公差判定は、設定された上/下限値の幅(上限値 - 下限値)とTIR測定値を比較して判定します。

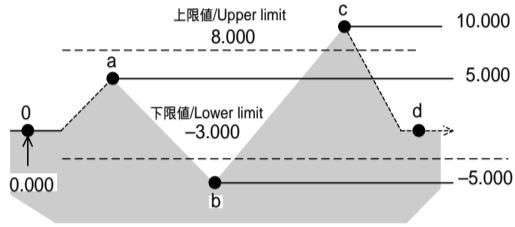


6.6

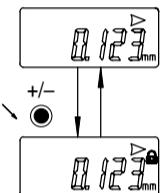

7

8

[例] 偏心量と最大回転速度の関係/
[e.g.] Off-centering value and maximum shaft rotating speed

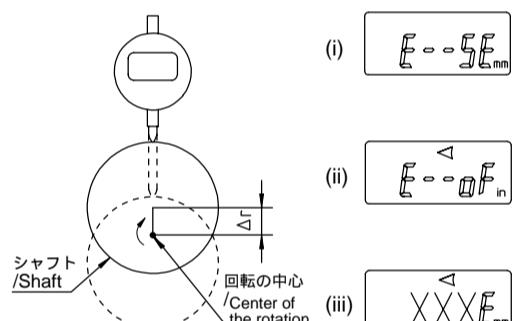

偏心量 /Off-centering value r	シャフト最大回転速度 /Maximum shaft rotating speed
0.1(mm)	約 60rpm/Approx. 60rpm
1.0(mm)	約 15rpm/Approx. 15rpm
3.0(mm)	約 8rpm/Approx. 8rpm

9. 仕様 /SPECIFICATIONS

9.1 本機仕様 /Specification of the Main Unit

符号 /Model name Code No. *	ID-C112J 543-280	ID-C112JM 543-281	ID-C112JE 543-282	ID-C112JT 543-283
最小表示量 /Resolution	0.001mm	0.001mm / 0.00005"		0.001mm / 0.0001"
測定範囲 /Measuring range	12.7mm = 0.5"			
指示精度 /Accuracy (20 * 2)	0.003mm(=.00012")以下 / 0.003mm(=.00012") or less			
量子化誤差 /Quantizing error	± 1カウント / ± 1 count			
準拠規格 /Standards	ISO R463/JIS B7503/DIN 878	ASME/ANSI B89.1.10/AGD Group 2		
システム径 /Stem diameter	8mm	9.52mm(=3/8" DIA)		
測定子 /Contact point	超硬 / Carbide(M 2.5 × 0.45)	鋼球 / Steel(#4 - 48UNF)		
保護等級 /Protection level * 3	防塵保護 IP-54 / Dust proof protection IP-54			
測定力 /Measuring force	2.0N(200gf)以下 / 2.0N(200gf) or less			
位置検出方式 /Position detecting method	静電容量式 ABS リニアエンコーダ方式 / Electrostatic capacitance ABS linear scale method			
応答速度 /Response speed * 4	無制限(但し、スピンドル移動中にも判定結果を必要とする場合、スピンドル移動速度は50 μm/sec以下とする。) / Unlimited (For the measurement that requires the measurement value during the spindle movement, spindle speed should be 50 μm/sec or less.)			
電源 /Power voltage * 5	DC12 - 24V ± 10%、リップル(p-p) 5%以下 / Ripple(p-p) 5% or less			
消費電流 /Current consumption	30mA 以下 / 30mA or less			
サンプリング回数 /Measuring frequency	50回/sec / 50times/sec			
出力形式 /Output method	NPN オープンコレクタ / NPN open-collector, (+NG, OK, -NG)			
出力応答時間 /Output response time	40ms 以内 / 40ms or less			
入力形式 /Input method	無電圧入力 / No-voltage input, (PRESET RECALL/ZERO, HOLD RESET)			
接続ケーブル /Connecting cable	4m(本体より引き出し、先端はバラ線 AWG #24 : 7本、シールド線 : 1本) / One end is fixed to the main unit. No connector is supplied for the other end (AWG#24:7 wires, Shielded line: 1 wire.)			
使用温度範囲 /Operation temperature	0 ~ 40			
保存温度範囲 /Storage temperature	-10 ~ 60			
本体重量 /Mass of the main unit	約 175g / Approx. 175g(=Approx. 0.39 lbs)			
ケーブル重量 /Mass of the connecting cable	約 170g / Approx. 170g(=Approx. 0.38 lbs)			

* 1: ウラブタ平のものは、コードナンバーに符号 'B' が付き、そうでない場合は耳金付きとなる。/ The model with suffix B on the Code No. is supplied with a flat back and the model without suffix is supplied with a back with a lug.

* 2: 量子化誤差を含まない。/ A quantizing error is excluded.

* 3: 保護等級 (IP=International Protection) 表示は IEC 60529/JIS D0207, C0920 に基づく / Protection level (IP=International Protection) shown in the table is according to IEC 60529/JIS D0207, C0920, and DIN 40050 part 1.

* 4: スピンドルの移動速度が50 μm/s を越えますと正しいピーク値を表示しない可能性があります。/ If the spindle speed exceeds 50 μm/sec, the correct peak value may not be displayed.

* 5: 飽和電圧に達した安定な直流電源を供給してください。/ Supply a stabilized DC power that has reached the saturation voltage.

6.5.3 Min hold mode

- In this mode, the instrument holds the minimum value during measurement, and outputs the tolerance judgment result on the minimum value.
 - The difference in operation between the ABS system and INC system is same as ones stated in the “6.5.2 Max hold mode”.
- Press the [MODE] switch twice shortly in the normal mode, then the “Min” blinks.
 - Press the [SET] switch shortly to enter the Min hold mode (“Min” appears.)
 - When the spindle moves, the minimum value is held (“H” appears.)
 - Press the [SET] switch shortly to release the hold. Then the current position is displayed and starts measuring a new minimum value. Hold can be released using HOLD_RESET (external connection terminal) as well.

6.5.4 TIR (Run-out) hold mode

- In this mode, the instrument holds the run-out during measurement, and output the tolerance judgment result on the run-out.
 - Only this mode has the same operation in both the ABS and INC systems.
- Press the [MODE] switch three times shortly in the normal mode. “TIR” blinks in the display.
 - Press the [SET] switch shortly to enter the TIR Hold mode (“TIR” appears) and display the zero.
 - When the spindle moves, the run-out is held. (“H” appears.)
 - Press the [SET] switch shortly to zero-set and start measuring a new run-out. Hold can be released using HOLD_RESET (external connection terminal) as well.

NOTE

The tolerance judgment in TIR hold mode is performed comparing TIR measured data with the range set by the upper/lower limits (upper limit - lower limit).

各計測モードの公差判定表示例 (上限値 8.0、下限値 - 3.0 の時)/ Difference of tolerance judgment in each mode (e.g. upper limit: 8.0, lower limit: - 3.0)

区間 /Path	0	a	b	c	d
通常モード/Normal mode	0.000	5.000	- 5.000	10.000	0.000
Max モード/Max mode	0.000		5.000		10.000
Min モード/Min mode	0.000			- 5.000	
TIR モード/TIR mode	0.000	5.000	10.000		15.000

6.6 Function Lock (Switch Lock Function)

Holding down the [+/-] switch deactivates all switches except the [ON/OFF] switch, [SET] switch, and [+/-] switch for releasing lock in all modes. To reactivate the switches, hold down the [+/-] switch again.

- Check the display and acquire the judgment result while the spindle stops. For this measurement procedure, no spindle moving speed restriction is required.
- For the measurement that requires the measurement value during the spindle movement, use this instrument so that the spindle moving speed should be 50μm/sec or less.
- In the peak hold mode, use this instrument so that the spindle moving speed around the peak point should be 50μm/sec or less. (For example, if measuring a 1mm or larger diameter shaft with the off-centering value of Δr mm, the correlation between the off-centering values and the maximum shaft rotating speed will be described as shown in the table left.)

8. ERROR MESSAGE AND CORRECTIVE MEASURES

- Tolerance setting error:** Tolerance limit is set with the upper limit being smaller than the lower limit. Set it so that the upper limit is greater than the lower limit.

NOTE

If the digit of the previous set value overflows caused by in/mm conversion when recalled by [TOL] switch, “E - SE” appears. Return to the state before setting and change the unit system by the [in/mm] switch, then set the tolerance limit again.

- Overflow:** The counted value overflows the display digit. Set the proper preset value again.

- ABS data composition error:** If malfunction caused by noise or abnormality in the sensor are detected, “E” will be displayed at the last digit, red color LED blinks, all of the output signal will be High level.

IMPORTANT

If this error occurs frequently, this instrument could be out of order. Contact the nearest Mitutoyo sales office or representative.

9.2 標準付属品 /Standard Accessory

- 取扱説明書 /User's Manual (This manual)

9.3 オプション /Optional Accessory

Order No.	品名	Part Name
#540774	レリーズケーブル	Release cable
#902011	レバー Assy	Lifting lever Assy (for ISO type)
#902794	レバー Assy (海外仕様品に使用)	Lifting lever Assy (for AGD type)
#02ACA376	ゴムブーツ	Rubber boot