

ID-C112GXB2

ABS Digimatic Indicator For Bore gage

User's Manual

Read this User's Manual thoroughly
before operating the instrument. After reading,
retain it close at hand for future reference.

Mitutoyo

CONVENTIONS USED IN THIS MANUAL

Safety Precautions

To ensure that instruments are operated correctly and safely, Mitutoyo manuals use various safety symbols (Signal Words and Safety Alert Symbols) to identify and warn against hazards and potential accidents.

The following signs indicate **general** warnings:



Indicates a potentially hazardous situation which, if not avoided, could result in serious injury or death.



Indicates a potentially hazardous situation which, if not avoided, may result in minor or moderate injury or property damage.

Types of Notes

The following types of **notes** are used in this manual to help the operator obtain reliable measurement data through correct instrument operation.

IMPORTANT

An important note provides information essential to use the product. You cannot disregard this note.

An important note is a type of precaution, which if neglected could result in degraded performance or accuracy, or instrument malfunction/failure.

NOTE

A note provides information to be especially noted or supplemented to use the product. A note also supplies information to be noted for specific operations.

TIP

A *tip* is a type of note that helps the user apply the techniques and procedures described in the text to his or her specific needs.

It also provides reference information associated with the topic being discussed.

The specifications and information in this manual are subject to change without notice.

Copyright © 2022-2023 Mitutoyo Corporation. All rights reserved.

Battery-related Warnings



WARNING

- Always keep the battery out of the reach of infants and toddler to prevent it from being swallowed. If it is swallowed, consult a physician immediately.
 - The battery should never be short-circuit, disassembled or deformed, heated or exposed to flames.
 - If alkaline liquid contained in the battery does come in contact with your eyes, flush them immediately with plenty of clean water and consult a physician. If the liquid adheres to the skin or clothes, immediately flush it with plenty of clean water.
-



CAUTION

- Never charge the battery since it is a primary battery. Never reverse the positive and negative terminals when mounting. Improper handling of the battery could lead to leakage or explosion, causing bodily injury or malfunction.
-

NOTE

- Always use the recommended battery.
 - If the instrument will not be used for more than three months, remove the battery and store it separately.
 - When discarding or storing the battery, cover the positive (+) and negative (–) terminals with insulating tape to prevent contact with other metals. When disposing of it, follow the ordinances or regulations of the local government.
-

Disposal Warnings



WARNING

- A liquid crystal display and a lithium metal battery are used in this product. When disposing of the instrument, follow the ordinances or regulations of the local government.
 - The liquid crystal display contains an irritating substance. Should the liquid content contact an eye or skin, flush with clean, flowing water. If the substance enters the mouth, immediately rinse the mouth, drink plenty of water, induce vomiting, and then consult a physician.
-

Cautions on use

Observe the following precautions to avoid instrument failure or malfunction.

IMPORTANT

- Do not strike the instrument or allow it to be struck.
- Do not drop it or apply excessive force to it.
- Do not disassemble or modify the instrument.
- Do not press the keys with a pointed object (such as screwdriver or ballpoint pen).
- Do not use or store the instrument under direct sunlight, or in an excessively hot or cold environment.
- Be alert for malfunction due to material deterioration if it is used in an environment with low or high atmospheric pressure.
- Do not store the instrument in a high-humidity environment. Do not use the instrument where it could be splashed with coolant.
- Do not use high-voltage equipment, such as an electric marking pen, near the instrument. Electronic parts may be damaged by such equipment. Be alert for malfunction if it is used in the vicinity of electric noise.
- Secure the instrument with a fixture such as a dial gage stand in a vibration-free environment.
- Do not subject the spindle to a vertical load or torsion.
- Wipe stains from the instrument panel by using a soft cloth or a cotton swab that is dry or moistened with diluted neutral detergent. Do not use an organic solvent such as thinner and benzene, which may cause the instrument panel to deform or malfunction.
- The contaminated spindle may cause malfunction. Wipe them off with a cloth damped with alcohol.

NOTE

- Be alert for measurement errors caused by thermal expansion of the component parts and the fixtures, resulting from a significant temperature fluctuation. Use the instrument in a temperature-controlled room that has minimum temperature fluctuation. Allow sufficient time for the instrument to thermally stabilize if it is moved to an environment with a different temperature.

Warranty

In the event that this product should prove defective in workmanship or material, within one year from the date of original purchase for use, it will be repaired or replaced, at Mitutoyo's option, free of charge upon its prepaid return to Mitutoyo

If the product fails or is damaged for any of the following reasons, it will be subject to a repair charge, even if it is still under warranty.

- (a) Failure or damage owing to fair wear and tear.
- (b) Failure or damage owing to inappropriate handling, maintenance or repair, or to unauthorized modification.
- (c) Failure or damage owing to transport, dropping, or relocation of the instrument after purchase.
- (d) Failure or damage owing to fire, salt, gas, abnormal voltage, lightning surge, or natural disaster.
- (e) Failure or damage owing to use in combination with hardware or software other than those designated or permitted by Mitutoyo.
- (f) Failure or damage owing to use in ultra-hazardous activities.

This warranty is effective only where the instrument is properly installed and operated in conformance with the instructions in this manual within the original country of the installation.

EXCEPT AS SPECIFIED IN THIS WARRANTY, ALL EXPRESS OR IMPLIED CONDITIONS, REPRESENTATIONS, AND WARRANTIES OF ANY NATURE WHATSOEVER INCLUDING, WITHOUT LIMITATION, ANY IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, NONINFRINGEMENT OR WARRANTY ARISING FROM A COURSE OF DEALING, USAGE, OR TRADE PRACTICE, ARE HEREBY EXCLUDED TO THE MAXIMUM EXTENT ALLOWED BY APPLICABLE LAW.

You assume all responsibility for all results arising out of its selection of this product to achieve its intended results.

Export Control Compliance

This Product falls into the Catch-All-Controlled Goods and/or Catch-All-Controlled Technologies (including Programs) under Category 16 of Appended Table 1 of Export Trade Control Order or under Category 16 of Appended Table of Foreign Exchange Control Order, based on Foreign Exchange and Foreign Trade Law of Japan.

If you intend re-exporting the product from a country other than Japan, re-selling the product in a country other than Japan, or re-providing the technology (including program), you shall observe the regulations of your country.

Contents

CONVENTIONS USED IN THIS MANUAL.....	i
Battery-related Warnings.....	ii
Disposal Warnings	ii
Cautions on use.....	iii
Warranty	iv
Export Control Compliance.....	iv
1 OVERVIEW	1-1
1.1 Overview.....	1-1
1.2 Features(what you can do).....	1-2
1.3 Part Name and Dimensions.....	1-3
1.4 Details of the Display unit	1-4
1.5 Specifications	1-5
1.6 Standard accessories	1-6
1.7 Optional accessories	1-6
2 SETUP.....	2-1
2.1 Installation (replacement) of Battery and Initial Setting.....	2-1
2.2 Adjusting Display Angle	2-2
2.3 Mounting on the bore gage	2-2
3 FUNCTIONS AND OPERATIONS	3-1
3.1 Power ON/OFF	3-2
3.2 Measurement mode.....	3-2
3.2.1 Preset setting	3-2
3.2.2 Numerical value Editing.....	3-4
3.2.3 Changing to Minimum value detection mode “Min”	3-6
3.2.4 Holding display value (when a data processor is not connected)	3-6
3.2.5 Holding display value (when a data processor is not connected)	3-6
3.2.6 Data save/Data load.....	3-7
3.2.7 Switching units (in/mm)	3-10

3.3	Setup mode	3-11
3.3.1	TOL:Tolerance judgment.....	3-14
3.3.2	RES:Resolution	3-16
3.3.3	SCALE:Analog bar graduation	3-18
3.3.4	LOCK:Keylock	3-20
3.3.5	OTHER:Other functions	3-22
3.3.5.1	PC(1):PC communication	3-25
3.3.5.2	RULER(2):Analog bar display	3-28
3.3.5.3	FAST(3):FAST mode	3-30
3.3.5.4	RESET(4):All reset	3-32
3.2	Calibration mode	3-34
4	DATA OUTPUT.....	4-1
4.1	Cable connection.....	4-1
4.2	Output connector.....	4-2
4.3	Output Data Format.....	4-2
4.4	Timing Chart.....	4-3
5	ERROR MESSAGE AND ACTION	5-1

Service Network

1

OVERVIEW

This chapter describes overview of this instrument including names and functions of each part, external dimensions, and details of the display unit.

1.1 Overview

This instrument is the dedicated inside diameter measuring instrument mounted to the bore gage (511, 526 series). To obtain the highest performance from this instrument and to use it safely, read this User's Manual and User's Manual of the bore gage prior to use.

Measurement and Setup mode are available with this instrument.

- Measurement mode
 - Normal mode : Dynamically displays measurement data
 - Minimum value detection mode: Detects minimum value of the measurement data
- Setup mode: Enables each setting

The measuring system of this instrument is the only ABS system (Absolute value measurement which measures distance (displacement) from a preset position).

NOTE


- In this instrument, there are no run-out value detection mode and maximum value detection mode.
 - There is not INC system.
 - This instrument is specially designed for bore gage. Therefore, the count direction when spindle is pressed is limited to minus, and the plus direction is not available.
-

1.2 Features (what you can do)

The following can be achieved with this instrument:


- Measurement-related items
 - Tolerance judgment of the measurement result P.3-11
 - Measurement of minimum value P.3-6
 - Outputting the measurement data to the data processor P.3-6
 - Changing the display value unit P.3-10
- Display-related settings
 - Changing the resolution P.3-16
 - Changing the graduation of the analog bar P.3-18
 - Hiding the analog bar P.3-28
 - Holding the displayed measurement data P.3-6
 - Saving the displayed measurement data P.3-7
 - Loading the saved data P.3-7
- Other setting-related items
 - Key lock P.3-20
 - Setting up each function from PC P.3-25
 - Setting up the FAST mode P.3-30
 - Resetting to the factory default P.3-32

1.3 Part Names and Dimensions

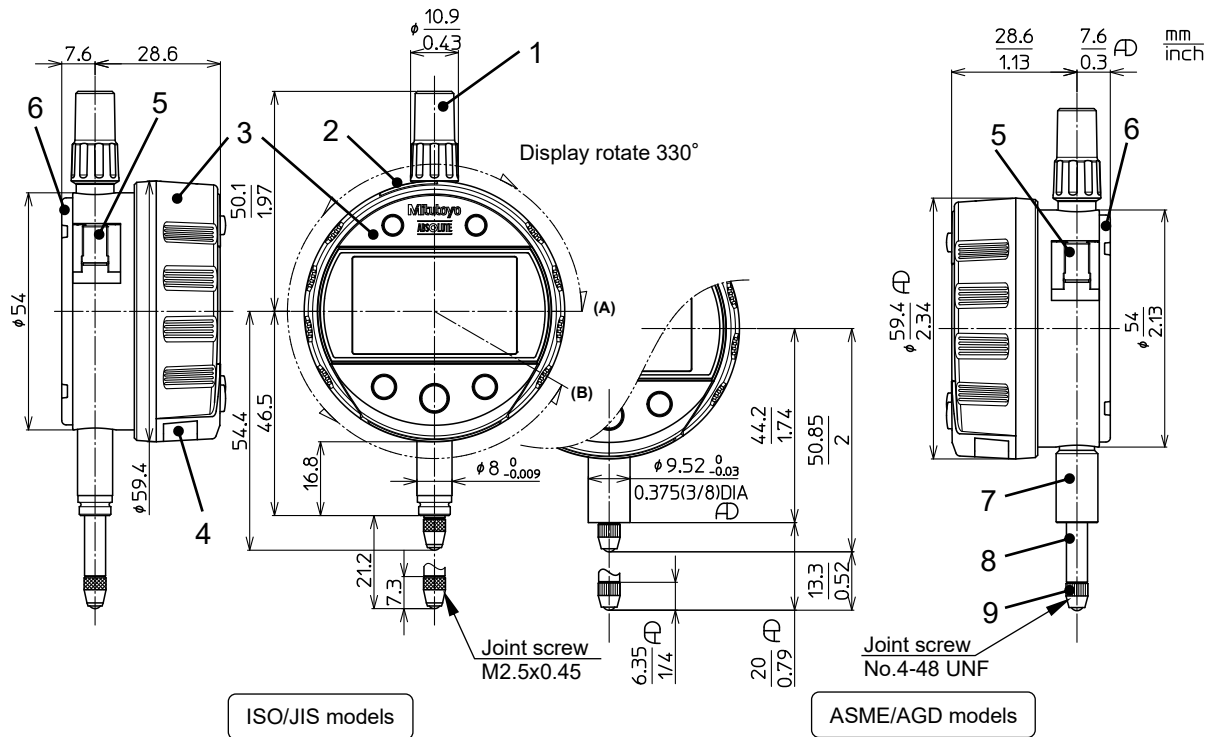

1	Cap
2	Output connector (with rubber cap)
3	Display unit
4	Battery holder
5	Lever mounting position (left and right)
6	Flat back
7	Stem
8	Spindle
9	Contact point
	ISO/JIS models : Part No.901312
	ASME/AGD models : Part No.21BZB005

1.4 Details of the Display unit

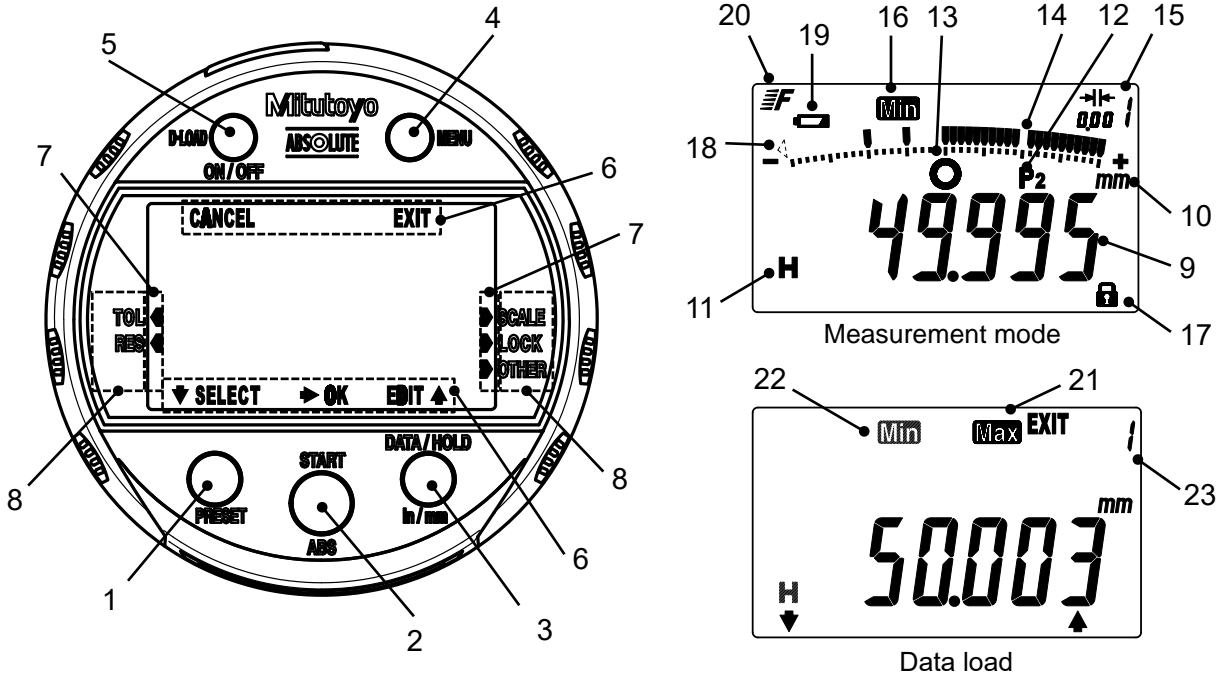

1	Lower left key	13	Tolerance judgment
2	Center key	14	Analog bar
3	Lower right key	15	Analog bar graduation
4	Upper right key	16	Minimum value detection measurement
5	Upper left key	17	Lock
6	Key assist	18	Lower over-range
7	Cursor	19	Low battery alarm
8	Parameter	20	FAST
9	Display value	21	Maximum value
10	Unit	22	Minimum value
11	Data hold	23	Data No.
12	Preset No.		

1.5 Specifications

Model name *1		ID-C112GXB2	ID-C112GMXB2	ID-C112GEXB2
Code No. *1		543-310B-10	543-311B-10	543-312B-10
Resolution *2		0.001 /0.01 mm	0.00005/0.0001/0.0005 in // 0.001/0.01 mm	
Measuring range		12.7 mm	0.5 in / 12.7 mm	
ISO/JIS	Error of Indication (PME)	Partial measuring range P_{MPE} *3	0.003 mm	0.003 mm
		Total measuring range E_{MPE} *3	0.003 mm	0.003 mm
	Hysteresis H_{MPE} *3	0.003 mm	0.003 mm	
	Repeatability R_{MPE} *3	0.002 mm	0.002 mm	
ASME	Overall *3*4	-	± 0.0001 in	
	Hysteresis *3	-	0.0001 in	
	Repeatability *3	-	0.0001 in	
Stem diameter		$\phi 8$ mm	0.375 in DIA	
Contact point		Carbide (M2.5x0.45)	Carbide (No.4-48UNF)	
Measuring force MPL		≤ 1.5 N		
Measuring direction		Useful in all directions		
Protection level *5		IP42 (in factory shipment state)		
Power supply		Lithium battery CR2032 $\times 1$ pc.		
Battery life *6		Normal use :Approx. 1 year		
Scale		Electrostatic capacitance absolute encoder		
Response speed		Infinite		
Measurement frequency *7		Normal mode: 10 times/s Minimum value detection mode: 50 times/s		
CE marking/ UKCA marking		EMC Directive/Electromagnetic Compatibility Regulations: EN IEC 61326-1 Immunity test requirement: Clause 6.2 Table 2 Emission limit: Class B RoHS Directive/The Restriction of the Use of Certain Hazardous Substances in Electrical and Electronic Equipment Regulations: EN IEC 63000		
Operating temperature		0 °C~40 °C		
Storage temperature		-10 °C~60 °C		
Net weight		170 g		

*1 : All instruments in this series are of the flat-back type.

*2 : Changeable by way of setting. Refer to "3.3.2 RES : Resolution".

*3 : 20°C, normal measurement.

*4 : Overall magnification and linearity.

The values are calculated with the resolution set to 0.001mm.

*5 : The protection level (IP: International Protection) is indicated according to IEC 60529 and JIS C 0920 standards.

*6 : Battery life depends on use of the indicator. Use the above value as a guide.

*7 : If the spindle speed exceeds following, the correct peak value may not be displayed.

Normal mode: 10 μ m/s

Minimum value detection mode: 50 μ m/s

1.6 Standard accessories

- — Lithium battery CR2032 (for monitor)
- No. 99MAH062B User's Manual
- No. 99MAH041B Quick Reference Manual
- No. 99MAH042M Product regulation guide
- — Certificate of inspection
- No. WA100 Warranty

1.7 Optional accessories

- No. 905338 Connecting cable (1m)
- No. 905409 Connecting cable (2m)
- No. 21EZA313 Parameter Setup Kit

2

SETUP



This chapter describes installation of a battery, adjusting display angle and mounting on the bore gage

2.1 Installation (replacement) of Battery and Initial Setting

A lithium battery (CR2032) is used with this instrument.

This instrument is not delivered with the battery set into position, so set the battery before use.

1. Remove the battery holder by using a flat-blade screwdriver or the like. (When replacing the battery, remove the spent battery.)
2. Set the battery into the battery holder as described in the figure below.
3. Set the battery holder into the original position. ([-----] is displayed.)
4. To enter into the preset setting, press the center key.
5. Set up the preset values referring to "3.2.1 Preset setting".
6. Set up measurement mode and function which you want. (See section 3. Functions and Operating Procedure.)

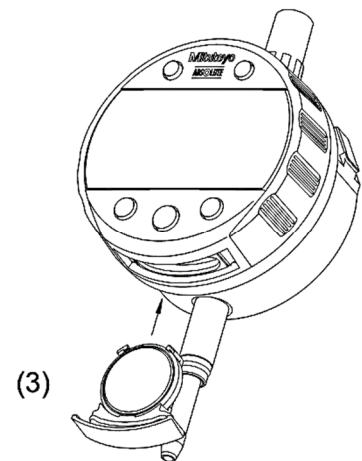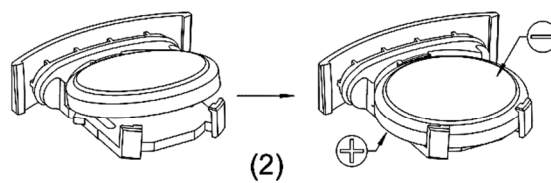

IMPORTANT

- Do not use a sharp-pointed tool to remove the battery holder and not pry out the battery holder, to prevent damage to the battery holder.
 - Note not to damage your nail when the battery holder is removed by hand.
 - If the battery and battery holder is not set properly, a damage and malfunction may result.
 - If the Measurement mode is not entered after executing the above procedure, set the battery again.
 - If the instrument will not be used for more than three months, remove the battery and store it separately to prevent damage by battery leakage.
-

NOTES

- The supplied battery is used only to check the functions and performance of the instrument, so it may not meet the battery life specification.
-

2.2 Adjusting Display Angle

The display can be rotated 90° (to position A) clockwise or 240° (to position B) counterclockwise from the initial position. (For the rotating range, see 1. Part Names and Dimensions.)

IMPORTANT

- Stoppers are set at both positions A and B. Stop rotating the display at the stoppers, or the instrument may malfunction.
 - Do not push in the display or pull it out. Doing so may cause the instrument to malfunction.
-

2.3 Mounting on the bore gage

This instrument is used by mounting on a bore gage (optional) correctly. For details, refer to the User's Manual of the bore gage.

3

FUNCTIONS AND OPERATIONS

This chapter describes functions and their operations of this instrument.

Each key function will change as follows depending on the operation mode.

- Measurement mode

* "Press and hold" means pressing and holding the key for 2 seconds or more.

Keys	Press	Press and hold
Lower left	—	PRESET (3.2.1)
Center	START (3.2.5)	—
Lower right	DATA (3.2.7) HOLD (3.2.6)	in/mm (3.2.10)
Upper left	D-LOAD(3.2.9)	ON/OFF (3.1)
Upper right	MENU (3.3)	—

- Setup mode/Numerical values setting

Keys	Press	Press and hold
Lower left	SELECT / ▼	—
Center	OK / ►	—
Lower right	EDIT / ▲	—
Upper left	CANCEL	—
Upper right	EXIT	—

3.1 Power ON/OFF

Power ON: Press the upper left key.

Power OFF: Press and hold the upper left key

NOTE

- If the power is turned off right after the battery is installed before completing preset setting, "-----" will be displayed when the power is turned on again.
 - When the power is turned off while the instrument is holding the display value, and then the power is turned on again, the held display value will be released.
 - When the power is turned off, all the measurement values saved with the data save function will be deleted.
-

Auto-off function (energy saving function): The power automatically will be turned off after approximately 20 minutes of idle time.

NOTE

- When enabling FAST mode, auto-off function will be disabled. (Refer to "3.3.6.3 FAST(3): FAST mode".)
-

3.2 Measurement mode

The following describes each setting and operation of the measurement mode of this instrument. Refer to "1.1 Overview" for details of the measurement mode.

3.2.1 Preset setting

Set up the preset when performing master setting.

Three settings; P1, P2, P3 are available as preset values.

1. Starting the preset setting

Press and hold the lower left key in the measurement mode. "P□" (□ indicates Preset No.) starts blinking and the previously set value will be displayed. If the value does not need to be changed, skip to step 4.

2. Selecting preset No.

Press the lower left key and select the preset No. to be set. Pressing the lower left key, the display changes in the following order: P1→P2→P3.

3. Editing the preset value.

Press the lower right key to move the numerical value editing. Refer to "3.2.3 Numerical value editing" for details of the setting.

4. Completing the preset setting

Lift up the spindle and position the contact point in the desired preset position. Next, press the center key.

In the peak detection mode, the spindle position of minimum value will be set as the preset position.


IMPORTANT

- Repeatability in the range of 0.2 mm (.0079") from the bottom of the stroke is not guaranteed for this indicator. When setting the origin, be sure to lift the spindle at least 0.2 mm (.0079") from the bottom of the stroke.
- The preset value will be calculated automatically according to the resolution. Check the preset value when the resolution is changed since the conversion error may occur.

NOTE

- Press the upper left key to cancel the setting,
- The preset setting cannot be completed while the spindle is moving. So complete it after the spindle stops.
- The power supply cannot be turned off with the upper left key in the preset setting.
- When auto-off is activated during preset setting, the setting will be canceled.
- The setup preset values and position will be held after the power is turned off. However, when the battery is replaced, the preset position will be cleared. Set up the position again.
- The preset setting cannot be completed if Overflow error of preset value (Err95) is occurring for the selected preset number. Reset the preset value.
- When preset setting is changed, all the measurement values saved with the data save function will be deleted.
- A rubber damper has been attached to the spindle in this indicator as a shock absorber. The elasticity of the damper may cause the indicated value to not stabilize at the bottom of the stroke, but this will not cause any operational problems. Also, the spindle may feel heavy at the bottom of the stroke when this indicator is first used, but this can be resolved by pushing the spindle up once.

Preset setting (Master setting)

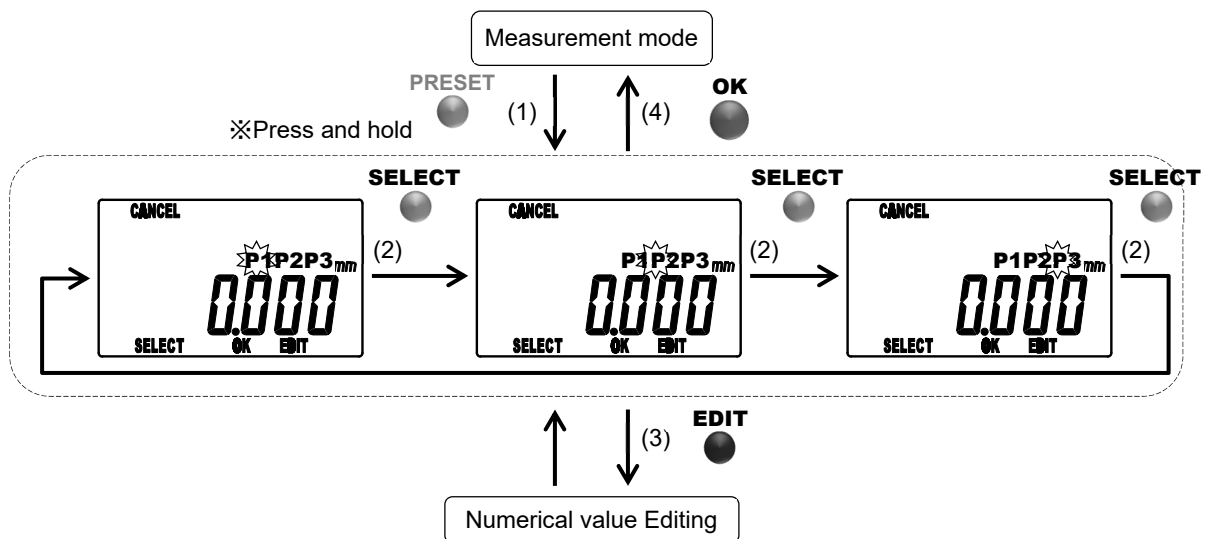

3.2.2 Numerical value Editing

Numerical value for "Preset", "Tolerance judgment" can be edit by same key operation.

Items that requires numerical value editing

Functions	Editing items
Preset	P1, P2, P3
Tolerance judgment	Upper limit, Lower limit

- Moving signs (+/-) and digits
Press the center key to move the sign or digit.
- Changing signs (+/-) and numerical values
Press the lower left key or lower right key to change the sign (+/-) or numerical value.

For signs (+/-)

Press the lower left or lower right key to switch the signs "+" \leftrightarrow "-".

For numerical values

Pressing the lower left key, the display changes in the following order:

0 \rightarrow 9 \rightarrow 8 \rightarrow ... \rightarrow 1 \rightarrow 0.


Pressing the lower right key, the display changes in the following order:

0 \rightarrow 1 \rightarrow 2 \rightarrow ... \rightarrow 9 \rightarrow 0.

- Completing the numerical value editing
Press the upper right key to complete the numerical value editing.
After editing the numerical values, the previous setup widow will be restored.

-
- NOTE**
- If the last digit of resolution is "5", that of the numerical value changes in the order of "0 \rightarrow 5 \rightarrow 0".
 - Press the upper left key to cancel the setting.
 - The value is temporarily saved until completing each setting before moving the numerical value editing. If canceled, it will be deleted.
-

Numerical value Editing

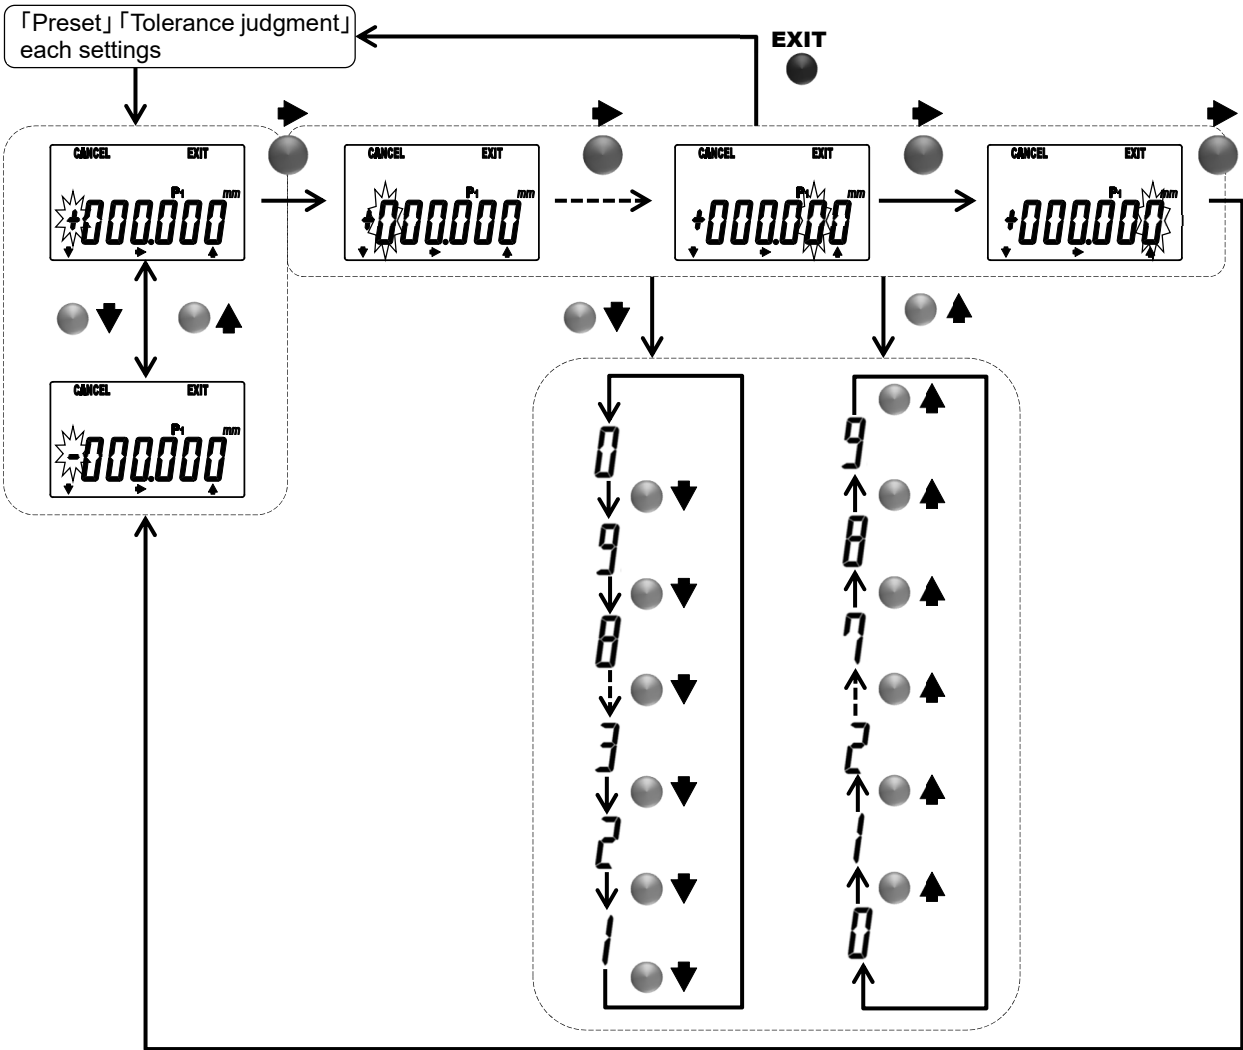


3.2.3 Changing to minimum value detection mode

Press the center key to change the minimum value detection mode. It can to hold the minimum values of the measured values fluctuate.

When the measurement value is below the minimum value is retained a new minimum value, and then held until the center key is pressed. Press the center key to restart minimum value measurement.

When Power OFF, Setup mode transition, preset setting, and data load is performed, the minimum value detection mode is canceled, and change to normal mode.

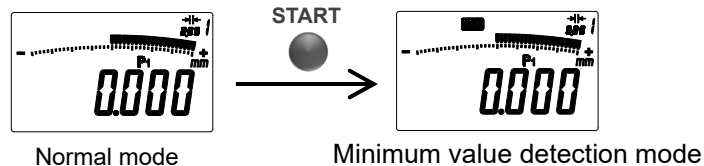

NOTE

- Please start measuring while the contact point is contacting the measuring target.
 - Note that the displacement caused by vibration, impact, etc. is detected.
 - Holding and saving the display value is possible in the minimum value detection mode. (Refer to "3.2.4 Holding display value", "3.2.6 Data save/Data load")
 - The minimum point can be edited into a desired value. So this instrument can measure based on this point. Refer to "3.2.1 Preset setting" to set the preset.
 - When a minimum value pointer of the analog bar is out of displayable range, the pointer automatically moves to the center by selecting the "Auto".
-

3.2.4 Holding display value (when a data processor is not connected)

Press the lower right key in the measurement mode. "H" is displayed and the display value will be held. Press the lower right key again to release the hold.

NOTE

- If a data processor is connecting to this instrument during "H" is displayed, the held value will be output to it and then be released.
 - The spindle position is being detected while "H" is displayed.
-

3.2.5 Display value output (when a data processor is connected)

The display value can be output to the data processor.

Press the lower right key in the measurement mode to output the display value to the data processor.

Refer to "4 Data Output" for cable connections, pin assignment, output format, and timing chart.

NOTE

- To use the data output function properly, refer to the operation manual of the data processor to be connected.
 - When inputting a data output request (REQ) from a data processor, the spindle must be stopped. Otherwise, this instrument may output wrong data or may not output.
 - If this instrument receives data output request (REQ) signals repeatedly at short intervals, it may not output a data.
-

3.2.6 Data save/Data load

Up to 9 data can be stored in the internal memory of this instrument.

The saved measurement values can be displayed by loading operation. The following data can be also checked by loading the data.

- For the maximum value among the saved measurement values, "Max" will be displayed.
- For the minimum value among the saved measurement values, "Min" will be displayed.
- The result of tolerance judgment for the saved values will be displayed while the tolerance judgment is enabled. (Refer to "3.3.1 TOL: Tolerance judgment".)

- **Data save**

Press the lower right key in the measurement mode.

When a data processor is not connected, data will be saved at the time when the displayed value is held. Data save will not be performed when the hold status is released.

When a data processor is connected, data will be saved at the time when the displayed value is output.

- **Data load**

1. Press the upper left key in the measurement mode, to enter into the data load mode. "H" will blink, and the last saved value will be displayed.

2. Press the lower left or the lower right key, to change display value. The data number displayed in the upper right of the display unit indicates the order of saving. The larger the number is, the more recent the measurement value is.

- **Stopping the data load**

Press the upper right key to restore the normal mode after deleting all the saved measurement values.


NOTE

- When data save is executed while 9 data are already saved, the data number "1", which is the oldest data, will be deleted. When a data is deleted, the data numbers descend and the measured value to be saved this time will be numbered "9".
 - When data load is stop, the saved measurement values will be deleted. Therefore, make a note of data if necessary.
 - Set the followings before performing data save or data load, because all the saved measurement values will be deleted, if any of the following operation is performed besides data load stopping:
 - Selecting the preset values
 - Selecting the tolerance judgment setting
-


- Changing the resolution
 - Shifting into PC communication status
 - Power off (auto-off)
 - Switching units
- Even when shifting from the minimum value detection mode to the data load, the normal mode will be restored when data load is stop.
 - When the maximum and the minimum values are the same, both "Max" and "Min" will be displayed.
 - If there are multiple maximum or minimum values, "Max" or "Min" will be displayed respectively with each value.
 - If data load is executed when no data is saved, "0" as data number and "-----" as measurement value will be displayed.

TIP


- The following describes some examples of the data number
 - When the number of saved measurement data are less than 9

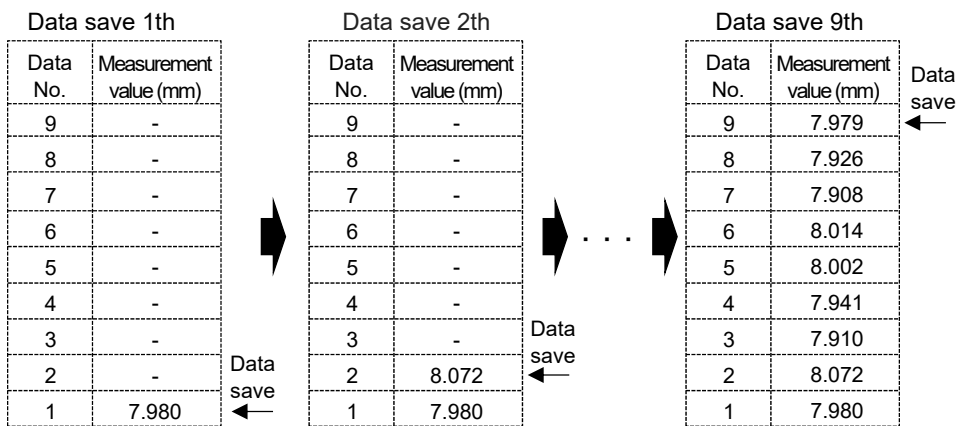

- When the number of saved measurement data are 9 (maximum number) or more

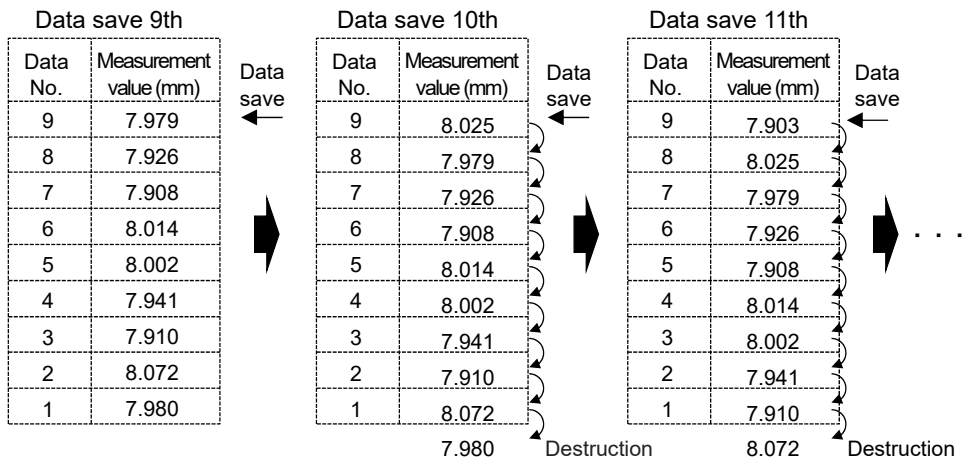


Data save

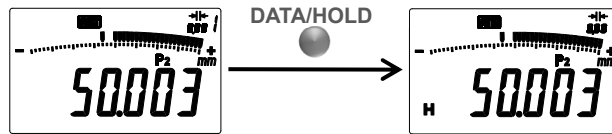

(Note) Hold the display value is performed at the same time when the data processor is not connected.

Data load

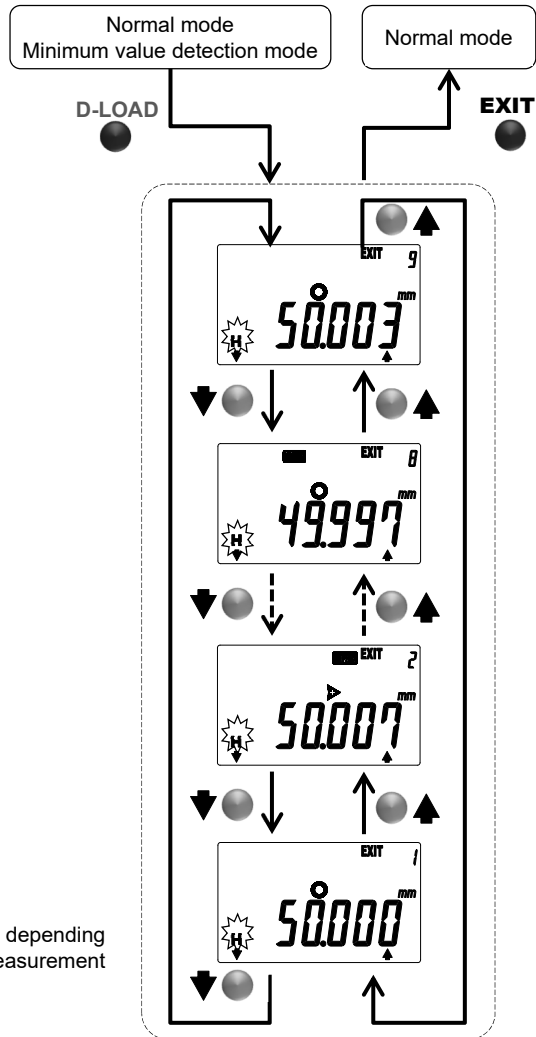

(Note) The number of data will vary depending on the number of the saved measurement values.

3.2.7 Switching units (in/mm)

Press and hold the lower right key to switch the display unit between inch and metric.

NOTE


- When the unit is switched, the following will be converted accordingly: display value, preset values, tolerance value, resolution, and analog bar graduation. If it causes the overflow error of display value (Err 30), set the proper resolution. Also, it causes overflow error of each setting values or conversion error, it is recommended to check the values of each setting after switching unit.
 - The display unit can be switched only in the normal mode. So if switching is required in the peak detection mode, press the lower left key a few times to change the mode to the normal, and then switch.
-

3.3 Setup Mode






The following parameters can be checked or set in the setup mode.

- Starting up the setup mode
Press the upper right key in the measurement mode to move into the setup mode.
- Selecting parameters
 1. The blinking cursor indicates the currently selected parameter.
 2. Press the lower left or lower right key to display the current set parameter.
 - Pressing the lower left key, the cursor moves in the following order: TOL→RES→ ... →OTHER→TOL.
 - Pressing the lower right key, the cursor moves in the following order: TOL→OTHER→ ... →RES→TOL.
 3. Press the center key to move the parameter setting
- Completing the setup mode
Press the upper right key to complete setup mode and return to the measurement mode,

-
- NOTE**
- During the setup mode, key assists which correspond to each key will be displayed. (Refer to "1.4 Details of Display Unit".)
 - The setup parameters will be registered even after the battery is replaced or power is turned off. However, if the battery is replaced while the key-lock function is enabled, the key-lock function will be set off.
 - The power supply cannot be turned off with the upper left key in the setup mode.
-

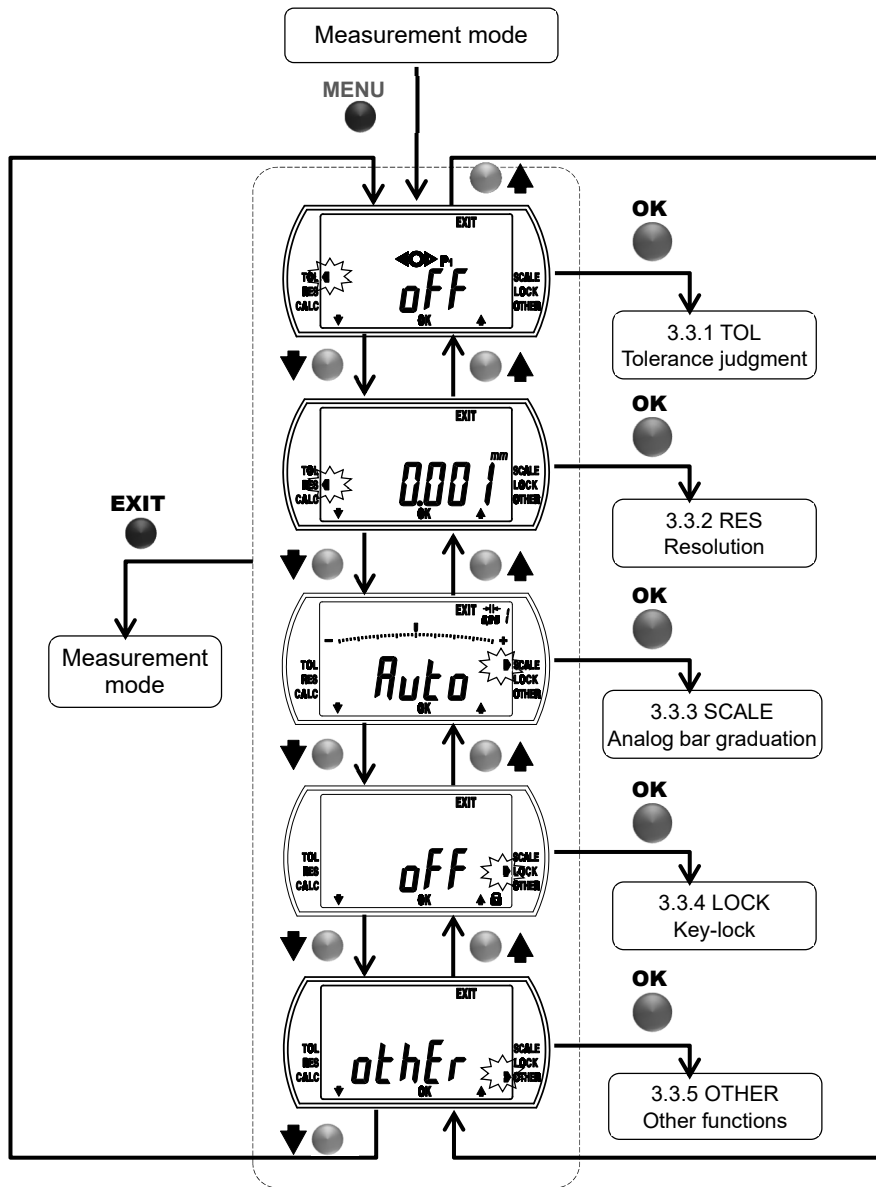

Parameters

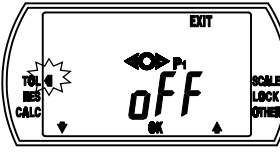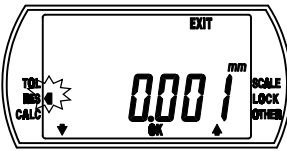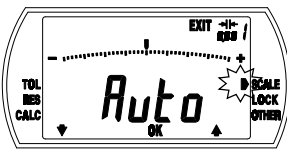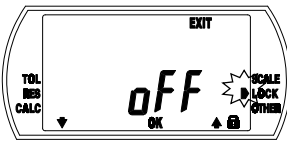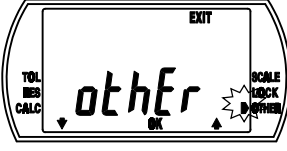Parameter	Example of display	Settings
<p>TOL (Tolerance judgment)</p>	 <p>"ON" or "OFF"</p>	<p>Selecting ON/OFF of tolerance judgment and tolerance value setting</p>
<p>RES (Resolution)</p>	 <p>Current resolution</p>	<p>Selecting resolution of the display</p>
<p>SCALE (Analog bar graduation)</p>	 <p>Current analog bar graduation</p>	<p>Selecting analog bar graduation</p>
<p>LOCK (Key-lock)</p>	 <p>"ON" or "OFF"</p>	<p>Selecting ON/OFF of key-lock function</p>
<p>OTHER (Other functions)</p>	 <p>"other"</p>	<p>Setting other functions (Refer to "3.3.5 OTHER: Other functions".)</p>

3.3.1 TOL: Tolerance judgment

The tolerance judgment function compares measurement data (display value) with tolerance values (upper/lower limit) for OK/NG judgment. The tolerance values can be set in preset No. (P1, P2, P3) respectively.

- Enabling tolerance judgment. Changing tolerance values
 1. Press the upper right key in the measurement mode to move the setup mode.
 2. Press the lower left or lower right key to move the blinking cursor to "TOL".
 3. Press the center key to move the ON/OFF selection of the tolerance judgment function.
 4. Press the lower left key to select "ON".
 5. Press the center key to move the tolerance value setting (upper/lower limit). The upper limit sign is blinking, and currently set value will be displayed.
 6. When press the lower left key, the display switches to the lower limit. (Pressing the lower left key, the upper limit and the lower limit switch.) The lower limit sign (or the upper limit sign) is blinking, and the currently set lower limit (or the upper limit) will be displayed.
 7. To edit the tolerance value, select the target value and press the lower right key. The numerical value editing will be enabled. (Refer to "3.2.2 Numerical value editing".)
 8. Press the center key after checking or editing the tolerance values. The tolerance judgment is set "ON", and the mode returns to the parameter setting. (Refer to "3.3 Setup Mode".)
- Disabling tolerance judgment
 1. Press the upper right key in the measurement mode to move the setup mode.
 2. Press the lower left or lower right key to move the blinking cursor to "TOL".
 3. Press the center key to move the ON/OFF selection of the tolerance judgment function.
 4. Press the lower left key to select "OFF".
 5. Press the center key to set the tolerance judgment "OFF" and return to the parameter setting. (Refer to "3.3 Setup Mode".)


IMPORTANT

- The tolerance values will be set in the currently active preset No. (P1, P2, P3). Check the desired measuring system is selected before setting the tolerance judgment function.
- The tolerance values will be calculated automatically according to the unit or the resolution. Check the tolerance values after the resolution is changed since the conversion error may occur.


NOTE

- Press the upper left key to cancel the operation.
- If the upper limit is set lower than the lower limit, the tolerance upper/lower limit setting error (Err 90) will occur. Reset the values to be the upper limit is greater than the lower limit.
- The tolerance judgment setting cannot be completed if Overflow error of upper / lower limit value (Err95) is occurring. Reset the upper or lower limit value.
- When the tolerance judgment setting is changed, all the measurement values saved with the data save function will be deleted.

Enabling tolerance judgment. Changing tolerance values

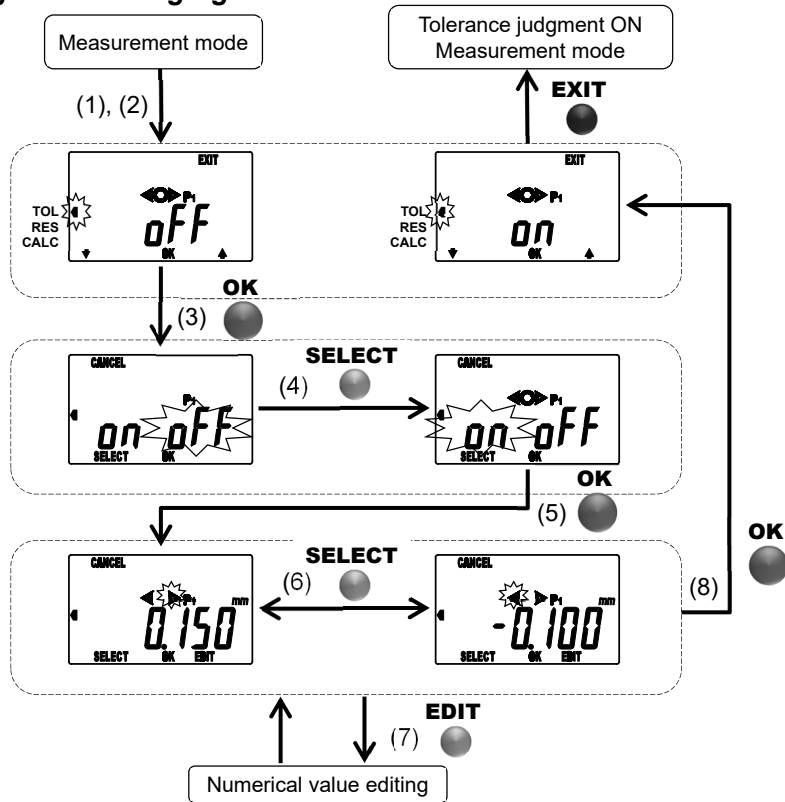

Disabling tolerance judgment

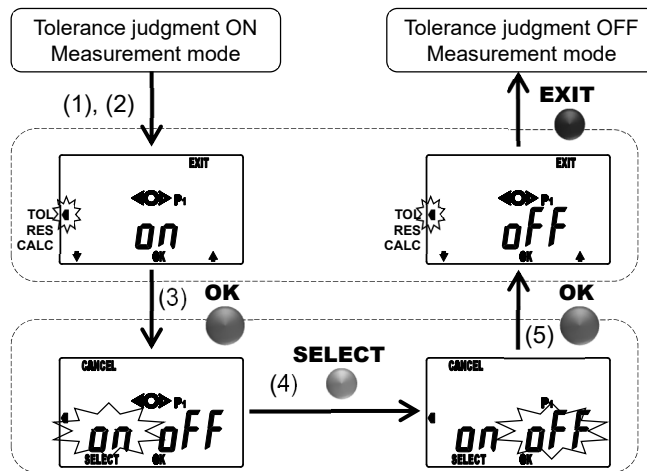

3.3.2 RES: Resolution

The resolution of the display can be changed.



- Selecting the resolution

3. Press the upper right key in the measurement mode to move the setup mode.
4. Press the lower left or lower right key to move the blinking cursor to "RES".
5. Press the center key to set the resolution.
6. Press the lower left or lower right key to switch the resolution.
7. Press the center key to set the resolution and the mode returns to the parameter setting. (Refer to "3.3 Setup Mode".)

IMPORTANT · The preset values (P1, P2, P3) and the tolerance values (upper and lower limits) will be calculated automatically according to the resolution. Check the values after changing the resolution, since the conversion error or overflow error (Err95) may occur.

NOTE · Press the upper left key to cancel the operation.
· When the unit is switched, the resolution will be automatically changed accordingly. Check the resolution after switching the unit.

Selecting the resolution

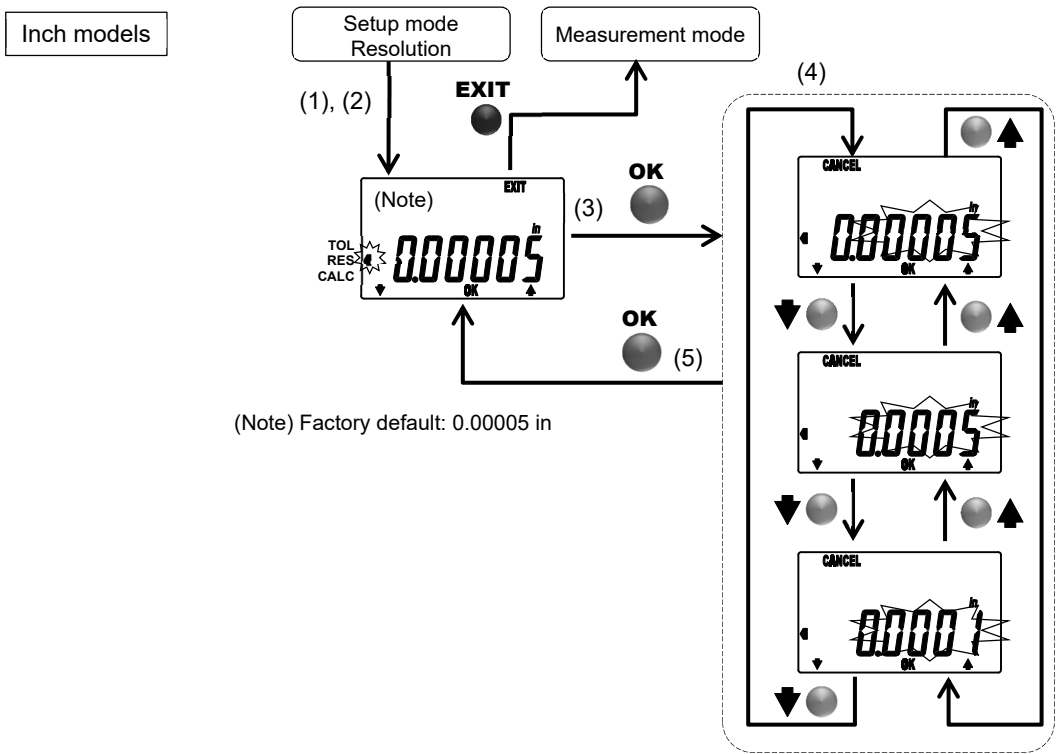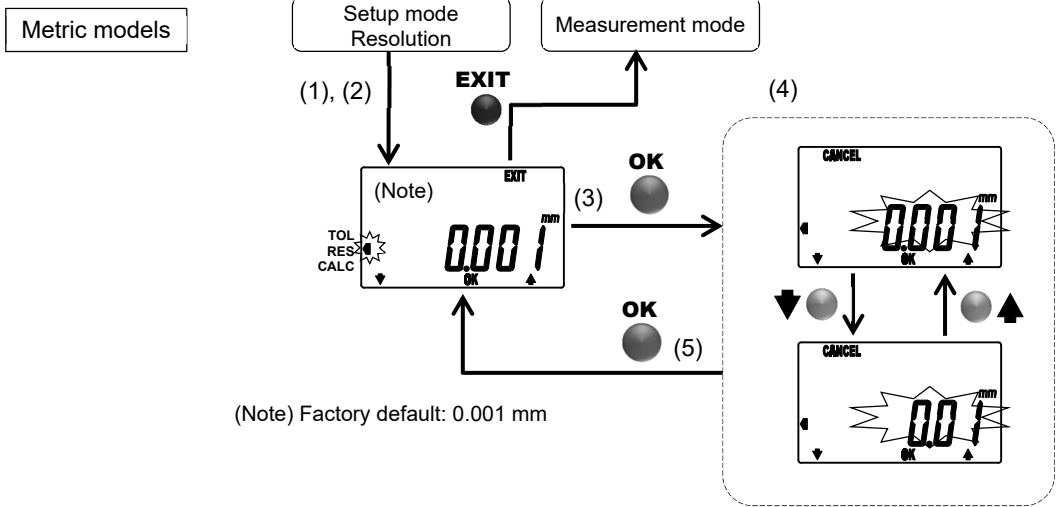

3.3.3 SCALE: Analog bar graduation

The analog bar graduation (Display range: ± 20) can be changed.

- Selecting a graduation of analog bar
 1. Press the upper right key in the measurement mode to move the setup mode.
 2. Press the lower left or lower right key to move the blinking cursor to "SCALE".
 3. Press the center key to set the analog bar graduation.
 4. Press the lower left or lower right key to switch the analog bar graduation.
 5. Press the center key to set the analog bar graduation and return to the parameter setting. (Refer to "3.3 Setup Mode".)

-
- NOTE**
- Press the upper left key to cancel the operation.
 - The factory default of the analog bar graduation is "Auto". Change it as required.
 - If the analog bar graduation is set to "0.0005mm" or "0.0002mm", the resolution will be "0.001mm". Because the resolution of the spindle displacement "x" is "0.001mm".
 - The analog bar will be displayed based on the display value. If the analog bar graduation is selected lower than the resolution of display value, the analog bar will vary discontinuously.
 - When the unit is switched, the graduation of the analog bar will be automatically changed accordingly. After switching the unit, check the graduation of the analog bar.

-
- TIP**
- The graduation of the analog bar will change automatically in the following conditions:
 1. Tolerance judgment ON: Graduation will change tolerance values to be within the display range.
 2. Changing resolution: Graduation will change same as resolution.
-

3.3.4 LOCK: Key-lock

Key operation can be partially disabled in order to avoid incorrect key operation.

- Enabling key-lock (disabling key operation)
 1. Press the upper right key in the measurement mode to move the setup mode.
 2. Press the lower left or lower right key to move the blinking cursor to "LOCK".
 3. Press the center key to move the ON/OFF selection of the key-lock function.
 4. Press the lower left key to select "ON".
 5. Press the center key to set the key-lock function "ON" and return to the parameter setting. (Refer to "3.3 Setup Mode".)
- Disabling key-lock (enabling key operation)
 1. Press the upper right key in the measurement mode to move the setup mode.
 2. Press the lower left or lower right key to move the blinking cursor to "LOCK".
 3. Press the center key to move the ON/OFF selection of the key-lock function.
 4. Press the lower left key to select "OFF".
 5. Press the center key to set the key-lock function "OFF" and return to the parameter setting. (Refer to "3.3 Setup Mode".)


- NOTE**
- Press the upper left key to cancel the operation.
 - The key-lock function will not be disabled by turning off the power. However, it will be set off when the battery is replaced.
 - When the key-lock is set on, other than key-lock cannot be selected in the setup mode.
 - The key-lock items can be customized via PC communication. (Refer to "3.3.5.1 PC(1): PC communication".)

Functions to be disabled while key-lock is on


- Measurement mode

Keys	Operation	Key names		Disabled functions		Remarks
		Metric model	Inch models	Metric model	Inch models	
Lower left key	Press	—		—		
	Press and Hold	PRESET		○		3.2.1
Center key	Press	START		—		3.2.3
	Press and Hold	—		—		
Lower right key	Press	DATA/HOLD		—		3.2.4
	Press and Hold	—	in/mm	—	○	3.2.7
Upper left key	Press	D-LOAD		—		3.2.6
	Press and Hold	ON/OFF		—		3.1
Upper right key	Press	MENU		—		3.3
	Press and Hold	—		—		

Enabling key-lock (disabling key operation)

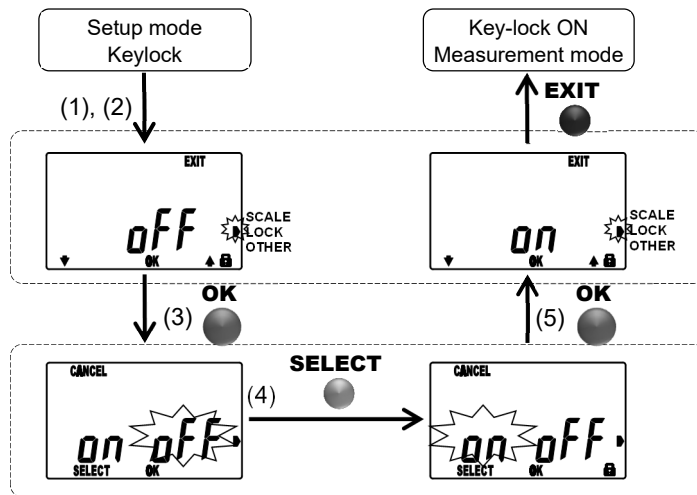

Disabling key-lock (enabling key operation)

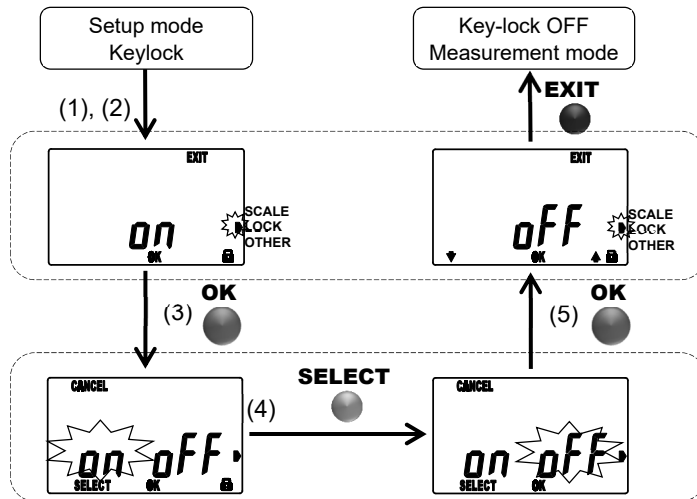


3.3.5 OTHER: Other functions

Check or set up the PC communication or the unit display.




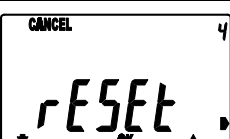
- Selecting items available in OTHER functions

1. Press the upper right key in the measurement mode to move the setup mode.
2. Press the lower left or lower right key to move the blinking cursor to "OTHER".
3. Press the center key to move the ON/OFF selection of OTHER functions.
4. Press the lower left or lower right key to change the item in the other functions.
 - Pressing the lower left key, the display changes in the following order:
PC communication → Analog bar display →...→ All reset → PC communication
 - Pressing the lower right key, the display changes in the following order:
PC communication → All reset→...→ Analog bar display → PC communication
5. Press the center key to return to the parameter setting.

NOTE · Press the upper left key to cancel the operation.

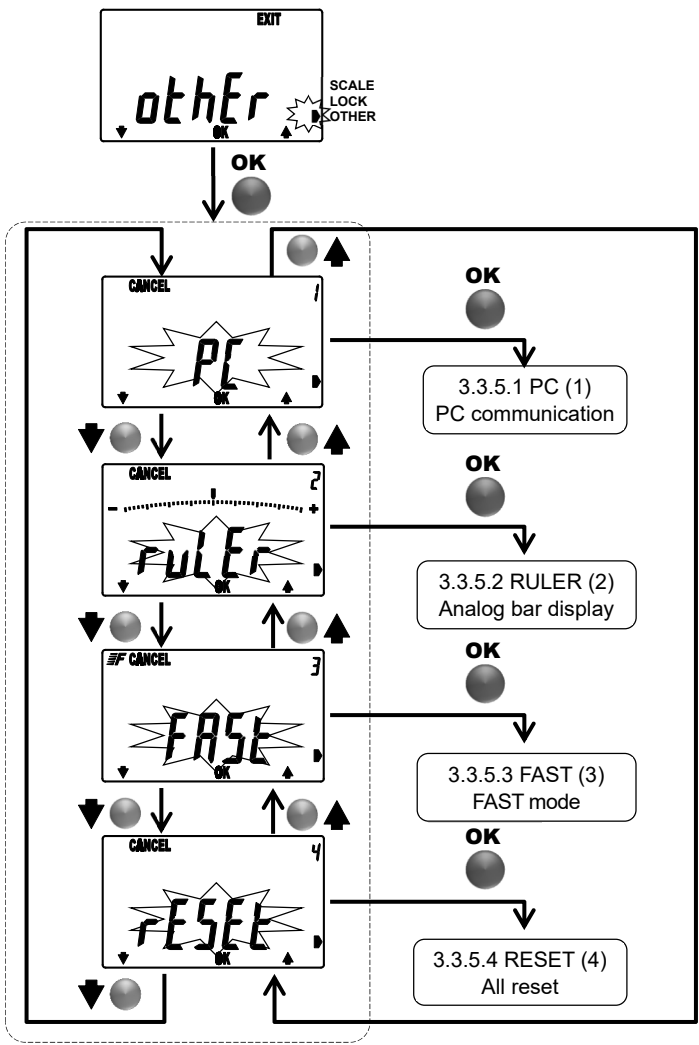

Items available in OTHERs

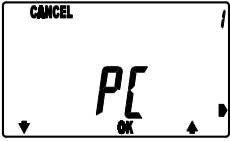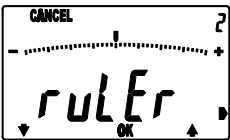Other functions (Item No.)	Example of LCD display	Settings
<p>PC(1) PC communication</p>	 <p>1, PC</p>	<p>Selecting ON/OFF of PC communication for each setting</p>
<p>RULER(2) Analog bar display</p>	 <p>2, RULER</p>	<p>Selecting ON/OFF of analog bar display</p>
<p>FAST(3) FAST mode</p>	 <p>3, FAST</p>	<p>Selecting ON/OFF of FAST mode</p>
<p>RESET(4) All reset</p>	 <p>4, RESET</p>	<p>Executing all reset</p>

3.3.5.1 PC(1): PC communication


This instrument can set up or change various items with special software, if it connects to Personal computer with a Parameter setup kit (optional accessory).

- Enabling PC communication

1. Connect a Parameter setup kit.
2. Press the upper right key in the measurement mode to move the setup mode, and select OTHER functions. (Refer to "3.3.5 OTHER: Other functions".)
3. Press the lower left or lower right key until "PC" is blinking.
4. Press the center key to move the PC communication setting.
5. Press the lower left key to select "ON".
6. Press the center key to start communication with the PC.
When the communication is started, "PC con" will be displayed.

-
- NOTE**
- Press the upper left key to cancel the communication with the PC.
 - Remove the cap of the output connector, and securely connect the cable.
 - Do not disconnect the Parameter setup kit while communicating with the PC.
 - When communication with PC is finished, the measurement mode will be restored.
 - For details of communication with the PC, refer to the operation manual supplied with the Parameter setup kit.
 - When the mode is shifted into PC communication, all the measurement values saved with the data save function will be deleted.
-

Enabling PC communication

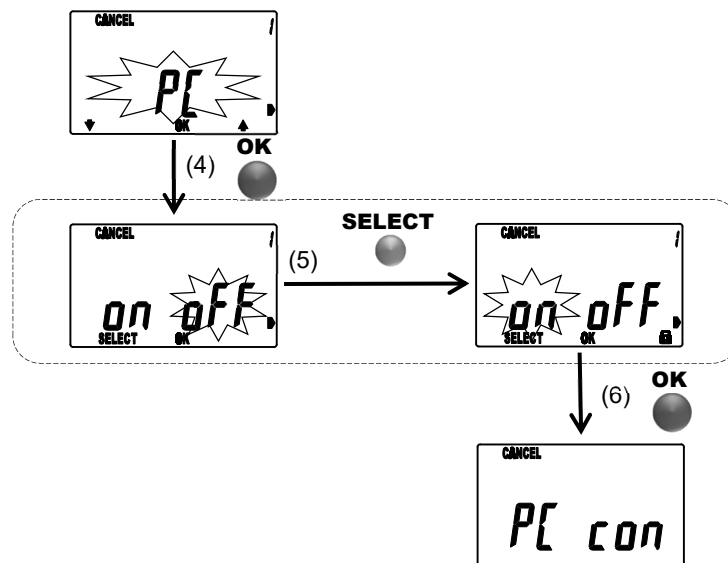



Configurable items by external input

Configurable items		Settings
Preset		Preset No.: P1 / P2 / P3 Preset value: P1 / P2 / P3
Unit		mm / in (only inch models)
Tolerance judgment		ON / OFF
		Upper and lower limit of each preset No.(P1, P2, P3)
Resolution	Metric	0.001 / 0.01
	Inch	0.00005 / 0.0001 / 0.0005
Analog bar graduation	Metric	AUTO / 0.001 / 0.002 / 0.005 / 0.01 / 0.02 / 0.05 / 0.1 / 0.2 / 0.5 / 1 / 5
	Inch	AUTO / 0.00005 / 0.0001 / 0.0002 / 0.0005 / 0.001 / 0.002 / 0.005 / 0.01 / 0.02 / 0.05 / 0.2
Key-lock		ON / OFF
		Key-lock setting (multiple selection possible) <ul style="list-style-type: none"> • PRESET(Preset setting) • DATA/HOLD (Holding the display value/Display value output) • in/mm (Switching the unit (inch↔mm))
Analog bar display		ON / OFF
FAST mode		ON / OFF
Parameter-lock		ON / OFF
		Parameter-lock setting (multiple selection possible) <ul style="list-style-type: none"> • Preset value setting: P1/ P2/ P3 • Tolerance setting: P1: upper limit/lower limit P2: upper limit/lower limit P3: upper limit/ lower limit • MENU key

TIP

- The parameter-lock function is to disable each setting and all reset operation, and it is available only while communicating with PC.
 - When the parameter lock is enabled, the locked parameter cannot be edited with the instrument.
 - While the parameter lock is enabled, the "EDIT" sign with the lower right key will not be displayed.
 - When the MENU Key is set to "Lock", the parameters other than PC communication cannot be confirmed and set by operating the key of this instrument. Release the Lock of MENU Key by conducting the PC communication if you want to confirm or set each parameter.
-

Display example during parameter-lock (Preset setting)

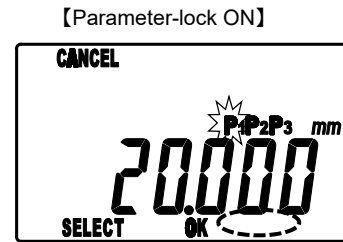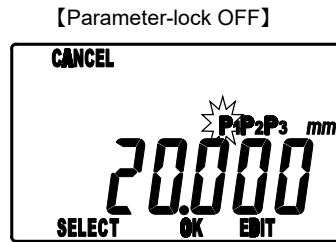

※The "EDIT" sign will not be displayed


3.3.5.2 RULER(2): Analog bar display

Analog bar can be set up displayed or hidden.


- Hiding the analog bar
 1. Press the upper right key in the measurement mode to move the setup mode, and select OTHER functions. (Refer to "3.3.5 OTHER: Other functions".)
 2. Press the lower left or lower right key until "RULER" is blinking.
 3. Press the center key to move the ON/OFF selection of the analog bar display.
 4. Press the lower left key to select "OFF".
 5. Press the center key to hide the analog bar and return to the parameter setting. (Refer to "3.3 Setup Mode".)
- Displaying the analog bar
 1. Press the upper right key in the measurement mode to move the setup mode, and select OTHER functions. (Refer to "3.3.5 OTHER: Other functions".)
 2. Press the lower left or lower right key until "RULER" is blinking.
 3. Press the center key to move the ON/OFF selection of the analog bar display.
 4. Press the lower left key to select "ON".
 5. Press the center key to hide the analog bar and return to the parameter setting. (Refer to "3.3 Setup Mode".)

NOTE • The analog bar will not be displayed if the graduation is changed while it is hidden. (Refer to "3.3.3 SCALE: Selecting analog bar graduation".)

Hiding the analog bar

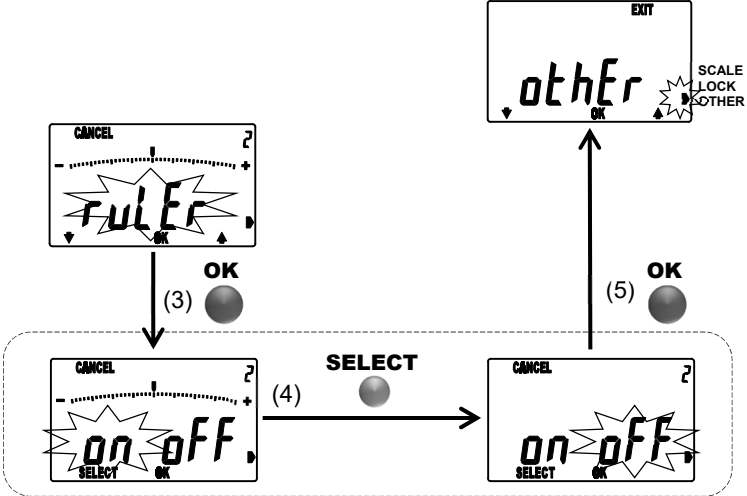

Displaying the analog bar

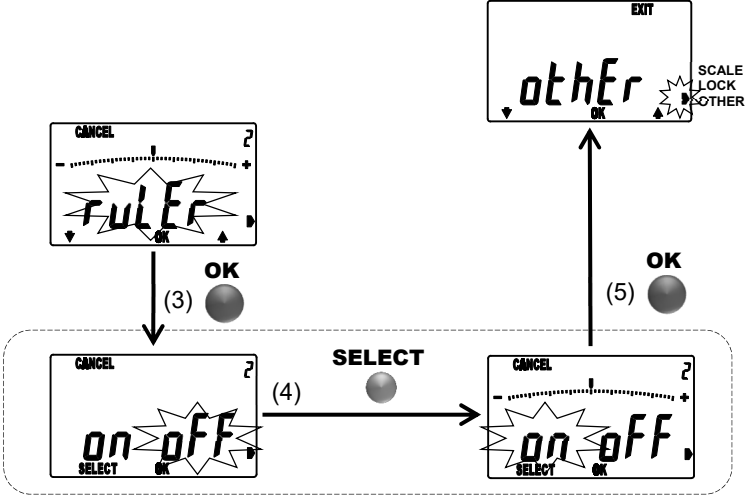

3.3.5.3 FAST(3): FAST mode

When enabling the FAST mode, the minimum value detection mode, it enables to detect minimum value more correctly.

Auto-off function is disabled in FAST mode.

- Enabling the FAST mode

1. Press the upper right key in the measurement mode to move the setup mode, and select OTHER functions. (Refer to "3.3.5 OTHER: Other functions".)
2. Press the lower left or lower right key until "FAST" is blinking.
3. Press the center key to move the ON/OFF selection of the FAST mode.
4. Press the lower left key to select "ON".
5. Press the center key to enable this function and return to the parameter setting. (Refer to "3.3 Setup Mode".)


- Disabling the FAST mode

1. Press the upper right key in the measurement mode to move the setup mode, and select OTHER functions. (Refer to "3.3.5 OTHER: Other functions".)
2. Press the lower left or lower right key until "FAST" is blinking.
3. Press the center key to move the ON/OFF selection of the FAST mode.
4. Press the lower left key to select "ON".
5. Press the center key to disable this function and return to the parameter setting. (Refer to "3.3 Setup Mode".)


IMPORTANT ▪ The accuracy will not be affected by this function.

NOTE ▪ Operating in this function will shorten the battery life.
It is recommended to operate with disabling this function if not necessary.

Enabling the FAST mode

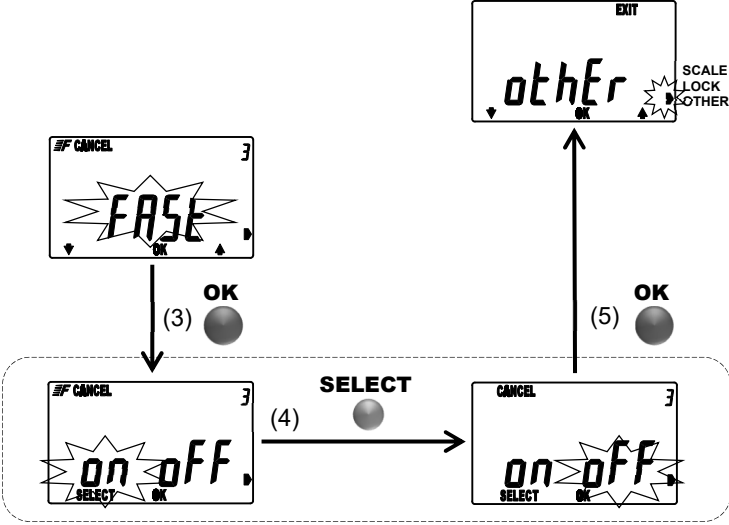

Disabling the FAST mode

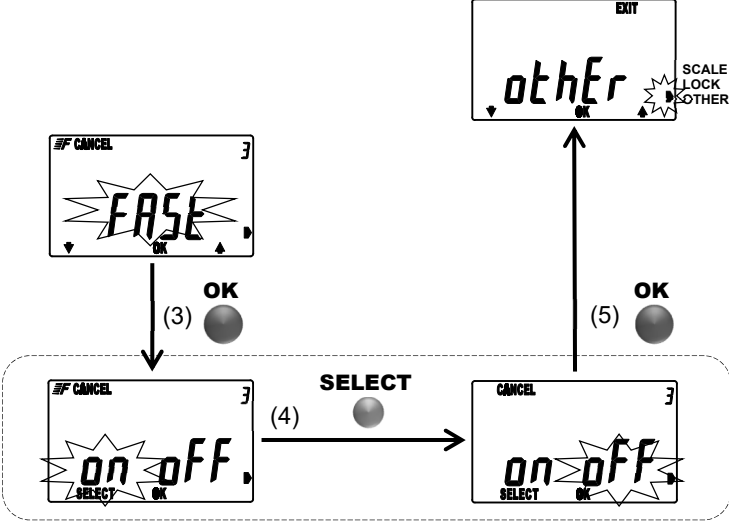

3.3.5.4 RESET(4): All reset

It restores the factory default.

- Executing all reset


1. Press the upper right key in the measurement mode to move the setup mode, and select OTHER functions. (Refer to "3.3.5 OTHER: Other functions".)
2. Press the lower left or lower right key until "RESET" is blinking.
3. Press the center key to move the all reset setting.
4. Press the lower left key to select "YES".
5. Press the center key, then "YES" will be displayed again.
6. Press the center key to execute all reset.
The display turns off shortly, and restores the display of the time when the battery is installed.

IMPORTANT ▪ The setting before executing all reset cannot be restored.

Factory default

Setting items	Settings
Preset	Preset No. (P1/P2/P3): P1 Preset values (P1/P2/P3): Zero for all
Unit	mm (for inch models: in)
Center position of the analog bar	Centered at zero
Tolerance judgment	OFF Tolerance judgment (upper limit/lower limit): Zero for all
Resolution	0.001mm (0.00005in)
Analog bar graduation	Auto
Key-lock	OFF All key function: Enabled
Analog bar display	ON
FAST mode	OFF
Data save	Discard all saved measurements
Parameter-lock	OFF

Excuting all reset

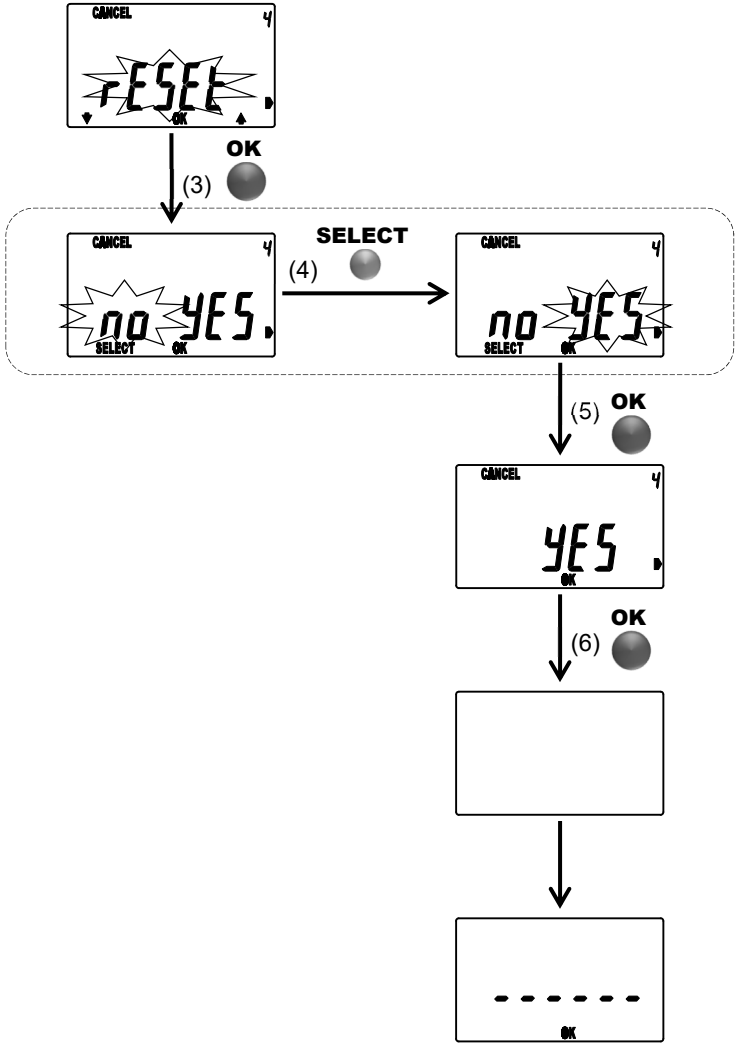

3.4 Calibration mode

In this mode the instrument can measure with an appropriate setting of accuracy inspection and calibration while retaining the current settings in memory. The INC system is employed with this mode, in which comparative measurement will be performed by measuring the distance and the displacement from the zero-set position. And also in this mode when the instrument receives an output request (REQ) from the data processor, it outputs a display value. (Refer to 3.2.5 Display value output)

The settings of calibration mode
(The settings change automatically when starting the calibration mode)

Setting items	Settings
Measurement mode	Normal mode
Measuring system	INC
Unit	mm / in(for inch models)
Resolution	0.001mm / 0.00005in(for inch models)
Other	Tolerance judgment :OFF Key-lock :OFF Analog bar display :OFF

Key function for the calibration mode

Keys	Press	Press and hold
Lower left	-	-
Center	Set to zero	-
Lower right	-	Switching the unit
Upper left	-	
Upper right	-	


● Starting the calibration mode

1. Remove the battery holder by using a flat-blade screwdriver or the like.
2. While pressing the lower left key and center key, set to the battery holder. This instrument will be started up in the calibration mode.

● Stopping the calibration mode

1. Remove the battery holder, so it means stopping the calibration mode. The measurement mode (the normal mode) will be restarted when the battery holder is set into the original position again (Refer to 2. SETUP).

IMPORTANT • The preset setting is required in the measurement mode after using this mode (Refer to 3.2.1 Preset setting). However other settings and parameters are held with the former setting which moves to this mode.

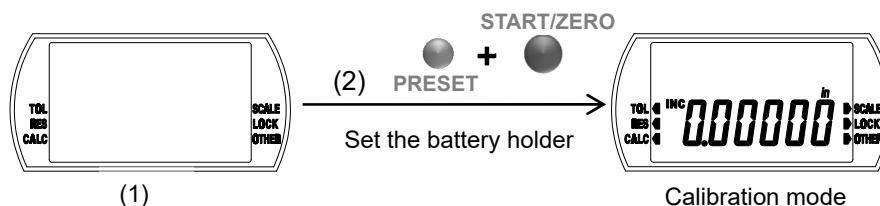

4

DATA OUTPUT

This chapter describes how to output data.


The measurement data can be outputted to the data processor such as Digimatic Mini-processor DP-1VR with an optional connecting cable (Parts No. 905338 (1m) or No. 905409 (2m)). And the data can be summed up or recorded

NOTE

- Use only the output cable of Mitutoyo specific accessories. The use of an improper cable or deteriorated cable may disable data output.
 - Prior to data output carefully read the user's manual of the data processor to use it correctly.
-

4.1 Cable Connection


Remove the output connector cap, and then connect the instrument to the data processor by using a connecting cable. Insert the cable securely to the end, in the direction as shown.

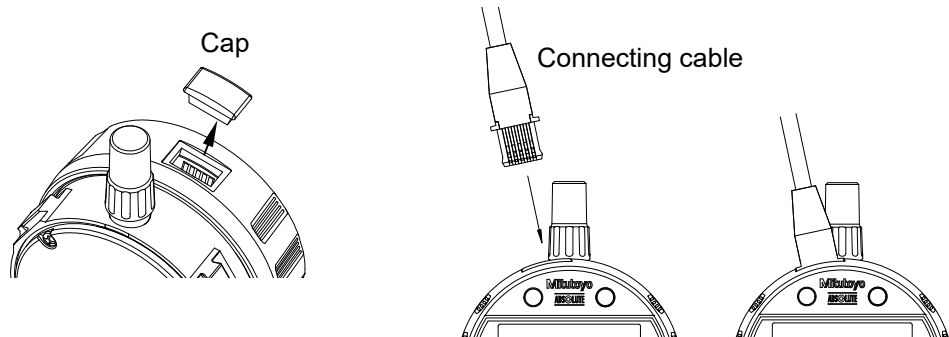


NOTE

- Store the removed cap, taking care to prevent loss.
 - Install the direction of output pin correctly.
 - Be sure to attach a cap to the connecting cable when not in use.
-

4.2 Output Connector

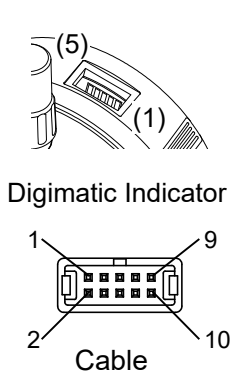


Indicator	Pin No.		Signal	I/O
	Indicator	Cable		
1	1	1	GND	-
2 *1	2	2	DATA	O
3 *1	3	3	$\overline{\text{CK}}$	O
4 *1	4	4	$\overline{\text{RD}}$	O
5 *2	5	5	$\overline{\text{REQ}}$	I
-	6-10	-	N.C.	-

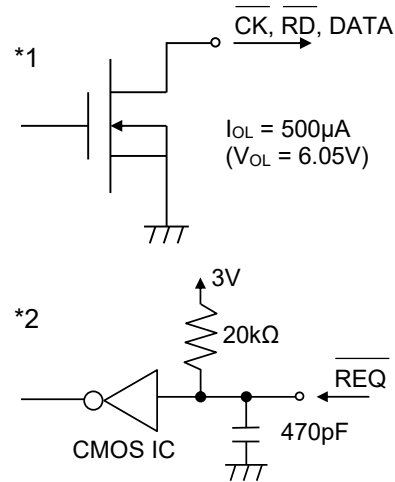

IMPORTANT

- Since the power voltage differs between this instrument and the data processor, absolutely design an output system either open-collector or open-drain. Do not use CMOS output.


4.3 Output Data Format

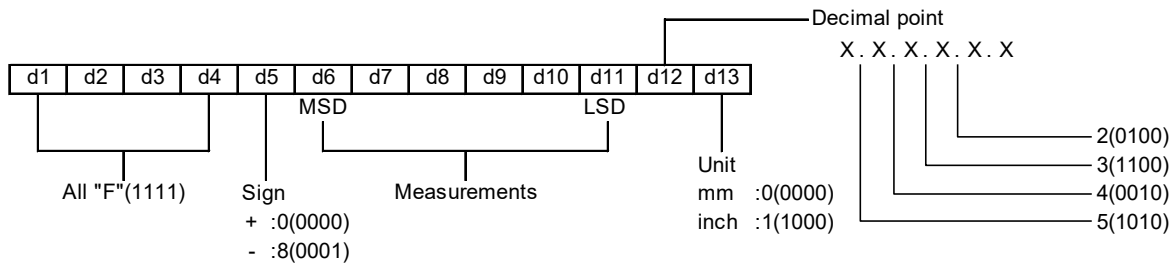

※This instrument outputs 13 digits from d1 to d13 by making 4 bits into 1 digit.

※Each digit is outputted in the order from least significant bit (LSB) to most significant bit (MSB).

4.4 Timing Chart

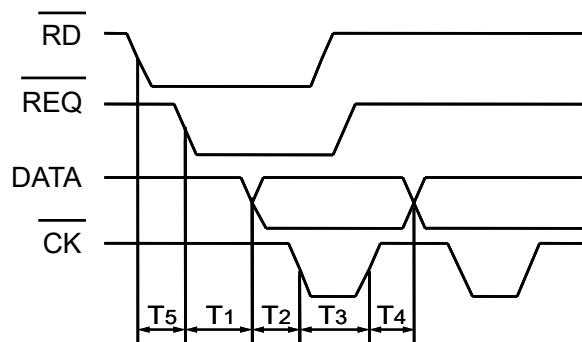

$0.7 \text{ ms} \leq T1 \leq 1.2 \text{ ms}$
 $100 \text{ } \mu\text{s} \leq T2 \leq 200 \text{ } \mu\text{s}$
 $200 \text{ } \mu\text{s} \leq T3 \leq 300 \text{ } \mu\text{s}$
 $100 \text{ } \mu\text{s} \leq T4 \leq 200 \text{ } \mu\text{s}$
T5 : Determined by the performance
of the data processor

IMPORTANT

- If the output request (REQ) signal is received during the spindle displacement or if the inverter receives output request (REQ) signals repeatedly at short intervals, the instrument may not output data.
-

NOTE

- Retain the REQ signal at Low level until the CK signal is outputted. Also, return the REQ signal to High level before the last CK signal (at the 52nd bit) is outputted.
-




MEMO





5


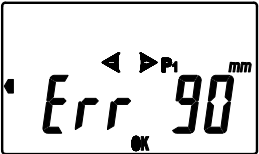
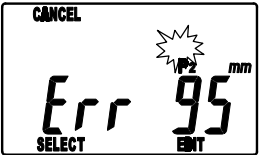
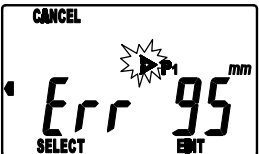
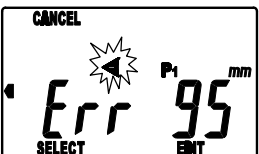
ERROR MESSAGE AND ACTION

This chapter describes the error messages and their corrective actions.

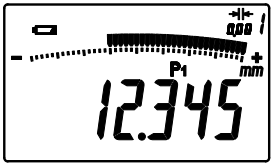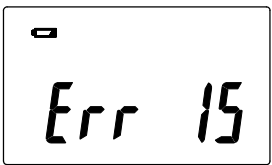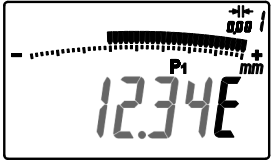If any error occurs in this Digimatic indicator, a corresponding error message is displayed. If the instrument does not recover the normal conditions after corrective actions, contact your dealer or Mitutoyo sales office.

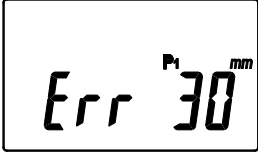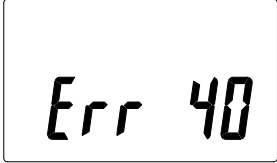Display	definition	Actions
	Low battery alarm <ul style="list-style-type: none"> Battery voltage is getting low 	<ul style="list-style-type: none"> Replace the battery with the new one.
	Low battery error <ul style="list-style-type: none"> Measurement cannot be performed due to consumption of the battery. 	<ul style="list-style-type: none"> Replace the battery with the new one.
	Sensor signal synthesizing error <ul style="list-style-type: none"> Synthesizing of sensor signal is failed. 	<ul style="list-style-type: none"> A sensor signal synthesizing error occurred while the spindle was moving at high speed. Keep on using the indicator since this error does not affect measured values. * If this error occurs while the spindle is stopped, it could be due to sensor failure. In this case, contact the nearest Mitutoyo sales office.

Display	definition	Actions
	<p>Overflow error of display value</p> <ul style="list-style-type: none"> The display value has exceeded the maximum number of digits that can be displayed. 	<ul style="list-style-type: none"> Return the display value to the permissible number of digits to automatically reset the error. Press the center key, or press and hold Move the Setup mode to change the resolution. (Refer to "3.3.2 RES: Resolution".)
	<p>Internal connection error</p>	<ul style="list-style-type: none"> This could be due to instrument failure. In this case, contact your dealer or Mitutoyo sales office.
	<p>Setting value rewrite error</p> <ul style="list-style-type: none"> A setting value has been rewritten from any cause after the previous use. 	<ul style="list-style-type: none"> Press the center key will return to the initial state after setting the battery. Perform re-setting after confirming the setting value, referring to "2.1 Installation (replacement) of Battery and Initial Setting".
	<p>Setting value storage error</p> <ul style="list-style-type: none"> A setting value could not be stored. A setting value could not be loaded. 	<ul style="list-style-type: none"> Remove the battery once and perform re-setting, referring to "2.1 Installation (replacement) of Battery and Initial Setting". If this error occurs even after re-setting the battery, replace it. If this error occurs even after replacing the battery, it could be due to instrument failure. In this case, contact your dealer or Mitutoyo sales office.

Display	definition	Actions
	Internal program error <ul style="list-style-type: none"> Measurement cannot be performed due to occurrence of an anomaly in the internal program. 	<ul style="list-style-type: none"> This could be due to instrument failure. In this case, contact your dealer or Mitutoyo sales office.
	Tolerance upper/lower limit setting error <ul style="list-style-type: none"> The tolerance limit value is set with the upper limit value being smaller than the lower limit value. 	<ul style="list-style-type: none"> Press the center key to reset to be the upper limit value is greater than the lower limit value. (Refer to "3.3.1 TOL: Tolerance judgment".)
	Overflow error of preset value <ul style="list-style-type: none"> The preset value has exceeded the maximum number of digits that can be displayed. 	<ul style="list-style-type: none"> Press the lower right key to reset the preset value. Lower the resolution. (Refer to "3.3.2 RES: Resolution".)
	Overflow error of upper limit value <ul style="list-style-type: none"> The upper limit value has exceeded the maximum number of digits that can be displayed. 	<ul style="list-style-type: none"> Press the lower right key to reset the upper limit value. (Refer to "3.3.1 TOL: Tolerance judgment".) Lower the resolution. (Refer to "3.3.2 RES: Resolution".)
	Overflow error of lower limit value <ul style="list-style-type: none"> The lower limit value has exceeded the maximum number of digits that can be displayed. 	<ul style="list-style-type: none"> Press the lower right key to reset the lower limit value. (Refer to "3.3.1 TOL: Tolerance judgment".) Lower the resolution. (Refer to "3.3.2 RES: Resolution".)

MEMO

Europe

Mitutoyo Europe GmbH

Borsigstrasse 8-10, 41469 Neuss, GERMANY
TEL: 49(0)2137 102-0 FAX: 49(0)2137 102-351

Mitutoyo CTL Germany GmbH

Von-Gunzert-Strasse 17, 78727 Oberndorf, GERMANY
TEL: 49(0)7423 8776-0 FAX: 49(0)7423 8776-99

KOMEG Industrielle Messtechnik GmbH

Zum Wasserwerk 3, 66333 Völklingen, GERMANY
TEL: 49(0)6898 91110 FAX: 49(0)6898 9111100

Germany

Mitutoyo Deutschland GmbH

Borsigstrasse 8-10, 41469 Neuss, GERMANY
TEL: 49(0)2137 102-0 FAX: 49(0)2137 86 85

M³ Solution Center Hamburg

Tempowerkring 9 im HIT-Technologiepark 21079 Hamburg, GERMANY

TEL: 49(0)40 791894-0 FAX: 49(0)40 791894-50

M³ Solution Center Berlin

Ernst-Lau-Straße 6, 12489 Berlin, GERMANY
TEL: 49(0)30 2611 267 FAX: 49 30 67988729

M³ Solution Center Eisenach

Neue Wiese 4, 99817 Eisenach, GERMANY
TEL: 49(0)3691 88909-0 FAX: 49(0)3691 88909-9

M³ Solution Center Ingolstadt

Marie-Curie-Strasse 1A, 85055 Ingolstadt, GERMANY
TEL: 49(0)841 954920 FAX: 49(0)841 9549250

M³ Solution Center Leonberg

Am Längenbühl 3, 71229 Leonberg, GERMANY
TEL: 49(0)7152 6080-0 FAX: 49(0)7152 608060

Mitutoyo Deutschland GmbH - Small Tool Sales Division

Heidenheimer Strasse 14, 71229 Leonberg, GERMANY
TEL: 49(0)7152 9237-0 FAX: 49(0)7152 9237-29

U.K.

Mitutoyo (UK) Ltd. HQ

Joule Road, West Point Business Park, Andover, Hampshire SP10 3UX, UNITED KINGDOM

TEL: 44(0)1264 353123 FAX: 44(0)1264 354883

Coventry M³ Solution Centre

Unit6, Banner Park, Wickmans Drive, Coventry, West Midlands CV4 9XA, UNITED KINGDOM
TEL: 44(0)2476 426300

Halifax M³ Solution Centre

Lowfields Business Park, Navigation Close, Elland, West Yorkshire HX5 9HB, UNITED KINGDOM
TEL: 44(0)1422 375566

East Kilbride M³ Solution Centre

The Bairds Building, Rankine Avenue, Scottish Enterprise Technology Park, East Kilbride G75 0QF, UNITED KINGDOM
TEL: 44(0)1355 581170

France

Mitutoyo France

Paris Nord 2-123 rue de la Belle Etoile, BP 59267 ROISSY EN FRANCE 95957 ROISSY CDG CEDEX, FRANCE
TEL: 33(0)149 38 35 00

M³ Solution Center LYON

Parc Mail 523, cours du 3ème millénaire, 69791 Saint-Priest, FRANCE
TEL: 33(0)149 38 35 70

M³ Solution Center STRASBOURG

Parc de la porte Sud, Rue du pont du péage, 67118 Geispolsheim, FRANCE
TEL: 33(0)149 38 35 80

M³ Solution Center CLUSES

290 Avenue des Lacs, 74950 Scionzier, FRANCE
TEL: 33(0)1 49 38 35 90

M³ Solution Center TOULOUSE

Aeroparc Saint Martin Cellule B08
ZAC de Saint Martin du Touch 12 rue de Caulet
31300 Toulouse, FRANCE
TEL: 33(0)1 49 38 42 90

M³ Solution Center RENNES

2, rue Claude Chappe, PA le Vallon - ZAC Mivoie, 35230 Noyal-Châtillon-sur-Seiche, FRANCE
TEL: 33(0)1 49 38 42 10

Italy

Mitutoyo Italiana S.r.l.

Corso Europa, 7 - 20045 Lainate (MI), ITALY
TEL: 39 02 935781 FAX: 39 02 93578255

M³ Solution Center BOLOGNA

Via dei Carpini1/A - 40011 Anzola Emilia (BO), ITALY
TEL: 39 02 93578215 FAX: 39 02 93578255

M³ Solution Center CHIETI

Contrada Santa Calcagna - 66020 Rocca S. Giovanni (CH), ITALY
TEL: 39 02 93578280 FAX: 39 02 93578255

M³ Solution Center PADOVA

Via G. Galilei 21/F - 35035 Mestrino (PD), ITALY
TEL: 39 02 93578268 FAX: 39 02 93578255

Netherlands

Mitutoyo Nederland B.V.

Storkstraat 30, 3905 KX Veenendaal, THE NETHERLANDS
TEL: 31(0)318-534911

Mitutoyo Nederland B.V. / M³ Solution Center Enschede

Institutenweg 50, 7521 PK Enschede, THE NETHERLANDS
TEL: 31(0)318-534911

Mitutoyo Nederland B.V. / M³ Solution Center Eindhoven

De Run 1115, 5503 LB Veldhoven, THE NETHERLANDS
TEL: 31(0)318-534911

Mitutoyo Research Center Europe B.V.

De Rijn 18, 5684 PJ Best, THE NETHERLANDS
TEL:31(0)499-320200 FAX:31(0)499-320299

Belgium

Mitutoyo Belgium N.V. / M³ Solution Center Melsele

Schaarbeekstraat 20, B-9120 Melsele, BELGIUM
TEL: 32(0)3-2540444

Sweden

Mitutoyo Scandinavia AB

Släntvägen 6, 194 61 Upplands Väsby, SWEDEN
TEL: 46(0)8 594 109 50

Mitutoyo Scandinavia AB / M³ Solution Center Alingsås

Ångsvaktaregatan 3A, 441 38 Alingsås, SWEDEN
TEL: 46(0)8 594 109 50

Mitutoyo Scandinavia AB / M³ Solution Center Värnamo

Kalkstensvägen 7, 331 44 Värnamo, SWEDEN
TEL: 46(0)8 594 109 50

Switzerland

Mitutoyo (Schweiz) AG

Steinackerstrasse 35, 8902 Urdorf, SWITZERLAND
TEL: 41(0)447361150

Mitutoyo (Suisse) SA

Rue Galilée 4, 1400 Yverdon-les Bains, SWITZERLAND
TEL: 41(0)244259422

SERVICE NETWORK

*As of June 2023

Poland

Mitutoyo Polska Sp.z o.o.

Ul.Graniczna 8A, 54-610 Wrocław, POLAND
TEL: 48(0)71354 83 50 FAX: 48(0)71354 83 55

Czech Republic

Mitutoyo Česko s.r.o.

Dubská 1626, 415 01 Teplice, CZECH REPUBLIC
TEL: 420 417-514-011 Email: info@mitutoyo.cz

Mitutoyo Česko s.r.o. M[®] Solution Center Ivančice

Ke Karlovu 62/10, 664 91 Ivančice, CZECH REPUBLIC
TEL: 420 417-514-011 Email: info@mitutoyo.cz

Mitutoyo Česko s.r.o. M[®] Solution Center Ostrava Mošnov

Mošnov 314, 742 51 Mošnov, CZECH REPUBLIC
TEL: 420 417-514-050 Email: info@mitutoyo.cz

Mitutoyo Česko s.r.o. Slovakia Branch

Hviezdoslavova 124, 017 01 Povážská Bystrica, SLOVAKIA
TEL: 421 948-595-590 Email: info@mitutoyo.sk

Hungary

Mitutoyo Hungária Kft.

Galamb József utca 9, 2000 Szentendre, HUNGARY
TEL: 36 (30) 6410210

Romania

Mitutoyo Romania SRL

1A Drumul Garii Odai Street, showroom, Ground Floor,
075100 OTOPENI-ILFOV, ROMANIA
TEL: 40(0)311012088 FAX: 40(0)311012089

Showroom in Brasov

Strada Ionescu Crum Nr.1, Brasov Business Park Turnul 1,
Mezanin, 500446 Brasov-Judetul Brasov, ROMANIA
TEL/FAX: 40(0)371020017

Finland

Mitutoyo Scandinavia AB Finnish Branch

Viherkiitäjä 2A, 33960, Pirkkala, FINLAND
TEL: 358(0)40 355 8498

Austria

Mitutoyo Austria GmbH

Salzburger Straße 260 / 3A-4600 Wels, AUSTRIA
TEL: 43(0) 7242 219 998

Mitutoyo Austria GmbH Goetzis Regional showroom

Lastenstrasse 48a, 6840 Götzis, AUSTRIA

Singapore

Mitutoyo Asia Pacific Pte. Ltd.

Head office / M[®] Solution Center

24 Kallang Avenue, Mitutoyo Building, SINGAPORE 339415
TEL: (65)62942211 FAX: (65)62996666

Malaysia

Mitutoyo (Malaysia) Sdn. Bhd.

Kuala Lumpur Head Office / M[®] Solution Center

Mah Sing Integrated Industrial Park, 4, Jalan Utarid U5/14,
Section U5, 40150 Shah Alam, Selangor, MALAYSIA
TEL: (60)3-78459318 FAX: (60)3-78459346

Penang Branch office / M[®] Solution Center

30, Persiaran Mahsuri 1/2, Sunway Tunas, 11900 Bayan
Lepas, Penang, MALAYSIA
TEL: (60)4-6411998 FAX: (60)4-6412998

Johor Branch office / M[®] Solution Center

70 (Ground Floor), Jalan Molek 1/28, Taman Molek, 81100
Johor Bahru, Johor, MALAYSIA
TEL: (60)7-3521626 FAX: (60)7-3521628

Thailand

Mitutoyo (Thailand) Co., Ltd.

Bangkok Head Office / M[®] Solution Center

76/3-5, Chaengwattana Road, Kwaeng Anusaawaree, Khet
Bangkaen, Bangkok 10220, THAILAND
TEL: (66)2080 3500 FAX:(66)2521 6136

Chonburi Branch / M[®] Solution Center

7/1, Moo 3, Tambon Bowin, Amphur Sriracha, Chonburi
20230, THAILAND

TEL: (66)2080 3563 FAX:(66)3834 5788

ACC Branch / M[®] Solution Center

122/8, 122/9, Moo 6, Tambon Donhuaroh,
Amphur Muangchonburi, Chonburi 20000, THAILAND
TEL: (66)2080 3565

Indonesia

PT. Mitutoyo Indonesia

Head Office / M[®] Solution Center

Jalan Sriwijaya No.26 Desa cibatu Kec. Cikarang Selatan
Kab. Bekasi 17530, INDONESIA

TEL: (62)21-2962 8600 FAX: (62)21-2962 8604

Batam Branch Office

Business Center Adhya Building 3rd Floor Kompleks
Permata Niaga Blok A No. 1, Jalan jendral Sudirman
Kelurahan Sukajadi, Kecamatan Batam Kota, Kepulauan
Riau 29444, INDONESIA
TEL: (62)-778-4888000

Vietnam

Mitutoyo Vietnam Co., Ltd

Hanoi Head Office / M[®] Solution Center

1st & 2nd floor, MHDl Building, No. 60 Hoang Quoc Viet
Road, Nghia Do Ward, Cau Giay District, Hanoi, VIETNAM
TEL: (84)24-3768-8963 FAX: (84)24-3768-8960

Ho Chi Minh City Branch Office / M[®] Solution Center

Unit No. B-00.07, Ground Floor, C1 Building, No. 6, Street
D9, An Loi Dong Ward, Thu Duc City, Ho Chi Minh City,
VIETNAM

TEL: (84)28-3840-3489 FAX: (84)28-3840-3498

Hai Phong City Branch Office

Room 511, 5th Floor, Thanh Dat 3 Building, No. 4 Le Thanh
Tong Street, May To Ward, Ngo Quyen District, Hai Phong
City, VIETNAM

TEL:(84)22-5398-9909

Philippines

Mitutoyo Philippines, Inc.

Head Office / M[®] Solution Center

Unit 1B & 2B LTI, Administration Building 1, Annex 1,
North Main Avenue, Laguna Technopark, Binan Laguna
4024, PHILIPPINES

TEL/FAX:(63) 49 544 0272

India

Mitutoyo South Asia Pvt. Ltd. Head Office

C-122, Okhla Industrial Area, Phase-1, New Delhi-110 020,
INDIA

TEL: (91) 11-40578485/86

MSA Technical Center

Plot no. 65, Ground Floor, Udyog Vihar, Phase-4 Gurgaon,
Haryana - 122016, INDIA

TEL: (91) 124-2340286/287

Mumbai Region Head office

303, Sentinel Hiranandani Business Park Powai,
Mumbai-400 076, INDIA

TEL: (91) 22-25700684/685/837/839

SERVICE NETWORK

*As of June 2023

Pune Office / M^o Solution Center

G4/G5, Pride Kumar Senate, Off. Senapati Bapat Road,
Pune-411 016, INDIA
TEL: (91) 20-25660043/44/45

Ahmedabad Office / M^o Solution Center

A-104 & A-105, First Floor, Solitaire Corporate Park, Near
Divya Bhaskar Press, S.G. Road, Ahmedabad - 380 015,
INDIA
TEL: (91)079 - 29704902/903

Bengaluru Region Head office / M^o Solution Center

116/117-2, Ground Floor, Sy. No. 93 & 94, 3rd Phase, Peenya
Industrial Area, Bengaluru-560 058, INDIA
TEL: (91) 80-25630946/47/48/49

Coimbatore Office

Regus, Srivari Srimath, 3rd Floor, Door No: 1045, Avinashi
Road, Coimbatore - 641 018,INDIA
TEL: (91)9345005663

Chennai Office / M^o Solution Center

No. 624, Anna Salai Teynampet, Chennai-600 018, INDIA
TEL: (91) 44-24328823/24/25

Kolkata Office

Unit No. 1208,Om Tower, 32,J.L.Nehru Road, Kolkata-700
071, INDIA
TEL: (91) 33-22267088/40060635/22266817

Taiwan

Mitutoyo Taiwan Co., Ltd. / M^o Solution Center Taipei

4F., No.71, Zhouzi St., Neihu Dist.,Taipei City 114, TAIWAN
TEL: 886(2)5573-5900 FAX: 886(2)8752-3267

Taichung Branch / M^o Solution Center Taichung

1F., No. 299, Gaotie 1st Rd., Wuri Dist., Taichung City 414,
TAIWAN
TEL:886(4)2338-6822 FAX:886(4)2338-6722

Kaohsiung Branch / M^o Solution Center Kaohsiung

1F., No.31-1, Haibian Rd., Lingya Dist., Kaohsiung City 802,
TAIWAN
TEL: 886(7)334-6168 FAX: 886(7)334-6160

South Korea

Mitutoyo Korea Corporation

Head Office / M^o Solution Center

(Sanbon-Dong, Geumjeong High View Build.), 6F, 153-8,
Ls-Ro, Gunpo-Si, Gyeonggi-Do, 15808 KOREA
TEL: 82(31)361-4200 FAX: 82(31)361-4201

Busan Office / M^o Solution Center

(3150-3, Daejeo 2-dong) 8,Yutongdanji 1-ro 49beon-gil,
Gangseo-gu, Busan, 46721 KOREA
TEL: 82(51)718-2140 FAX: 82(51)324-0104

Daegu Office / M^o Solution Center

(Galsan-dong, Daegu Business Center), 301-Ho, 217,
Seongseogongdan-ro, Dalseo-gu, Daegu 42704 KOREA
TEL: 82(53)593-5602 FAX: 82(53)593-5603

China

Mitutoyo Measuring Instruments (Shanghai) Co., Ltd.

8th Floor, Tower 1 Lujiazui Jinkong Square No.1788/1800
Century Ave., Pudong New District, Shanghai 200122,
CHINA
TEL: 86(21)5836-0718 FAX: 86(21)5836-0717

Suzhou Office / M^o Solution Center China (Suzhou)

1/2 Floor, Building 4, No.175 Songbei Road, Suzhou Free
Trade Zone, Suzhou City, Jiangsu 215000, CHINA
TEL: 86(512)6522-1790 FAX: 86(512)6251-3420

Wuhan Office / M^o Solution Corner

Room 1701, Wuhan Wanda Center, No. 96, Linjiang Road,
Wuchang District, Wuhan Hubei 430060, CHINA
TEL: 86(27)8544-8631 FAX: 86(27)8544-6227

Chengdu Office

Room 1-102, 1st Floor, Unit 1, Building 1, No. 24, Wannian
Road (Wanniancang Cool), Chenghua District, Chengdu City,
Sichuan 610056, CHINA
TEL: 86(28)8671-8936 FAX: 86(28)8671-9086

Hangzhou Office

Room 804, Eastern International Business Center Building 1,
No.600 Jinsha Road of Hangzhou Economic and
Technological Development Zone, 310018, CHINA
TEL: 86(571)8288-0319 FAX: 86(571)8288-0320

Tianjin Office / M^o Solution Center China (Tianjin)

Room D 12/F, TEDA Building, No.256 Jie-fang Nan Road
Hexi District, Tianjin 300042, CHINA
TEL: 86(22)5888-1700 FAX: 86(22)5888-1701

Changchun Office

Room 815, 8F, Building A1, Upper East International
No.3000 Dongsheng Street, Erdao District, Changchun, Jilin,
130031, CHINA
TEL: 86(431)8192-6998 FAX: 86(431)8192-6998

Chongqing Office

Room 1312, Building 3, Zhongyu Plaza, No.86, Hongjin
Avenue, Longxi Street, Yubei District, Chongqing, 400000,
CHINA
TEL: 86(23)6595-9950 FAX: 86(23)6595-9950

Qingdao Office

Room 638, 6F, No.192 Zhengyang Road, Chengyang District,
Qingdao, Shandong, 266109, CHINA
TEL: 86(532)8096-1936 FAX: 86(532)8096-1937

Xi'an Office

Room 805, Xi'an International Trade Center, No. 196
Xiaozhai East Road, Xi'an, 710061, CHINA
TEL: 86(29)8538-1380 FAX: 86(29)8538-1381

Dalian Office / M^o Solution Center China (Dalian)

Room A-106 Shuijing SOHO, No.16 Harbin Road, Economic
Development Zone, Dalian, 116600 CHINA
TEL: 86(411)8718 1212 FAX: 86(411)8754-7587

Zhengzhou Office

Room1801,18/F,Unit1,Building No.23, Shangwu Inner Ring
Road, Zhengdong New District,Zhengzhou City, Henan
450018, CHINA
TEL: 86(371)6097-6436 FAX: 86(371)6097-6981

Dongguan Office / M^o Solution Center China (Dongguan)

Room 801, No 65, Chang'an Section Guanchang Road,
Chang'an Town, Dongguan City, Guangdong 523841, CHINA
TEL: 86(769)8541 7715 FAX: 86(769)-8541 7745

Fuzhou Office

Unit 03, 7th floor of East Tower, Sansheng International
Center, No.118 Wusi Road, Gulou Distrit, Fuzhou City,
Fujian 350001, CHINA
TEL: 86 (591) 8761 8095 FAX: 86 (591) 8761 8096

Changsha Office

Room 2207, Building 1, Shiner International Plaza, No. 88,
Kaiyuan Middle Road, Changsha City, Hunan 410100,
CHINA
TEL: 86 (731) 8401 9276 FAX: 86 (731) 8401 9376

Changzhou Office

Room 1502, Joint Financial Tower, No.255, Tongjiang North
Road, Tianning District, Changzhou City, Jiangsu 2130002,
CHINA
TEL:86(519)8815 8319 FAX:86(519)8815 8319

Wenzhou Office

Room 512, Building 4, Xinjingdujiayuan, Sanyang Street,
Ouhai District, Wenzhou City, Zhejiang 325014, CHINA
TEL: 86(577)8641 5280

SERVICE NETWORK

*As of June 2023

Shunde Office

Room 1603, Buliding 26, Vanke Golden Riverside Plaza Phase II, No.13 Mid DeSheng Road, ShunDe District, Foshan City, Guangdong 528300, CHINA
TEL/FAX: 86(757)2228 8621

Mitutoyo Measuring Technology (Suzhou) Co., Ltd.

1/2 Floor, Building 4, No.175 Songbei Road, Suzhou Free Trade Zone, Suzhou City, Jiangsu 215000, CHINA
TEL: 86(512)6252-2660 FAX: 86(512)6252-2580

U.S.A.

Mitutoyo America Corporation

965 Corporate Blvd., Aurora, IL 60502, U.S.A.
TEL: 1-(630)820-9666 Toll Free No. 1-888-648-8869
FAX: 1-(630)978-3501

Headquarters (Aurora) / M^o Solution Center

965 Corporate Blvd., Aurora, IL 60502, U.S.A.

Seattle (Renton) Office / M^o Solution Center

1000 SW 34th St. Suite G, Renton, WA 98057 U.S.A.
TEL: 1-(888)-648-8869

Houston Office / M^o Solution Center

4560 Kendrick Plaza Drive Suite 120 Houston, TX 77032, U.S.A.

TEL: 1-(888)-648-8869 FAX: 1-(281)227-0937

Cincinnati (Mason) Office / M^o Solution Center

6220 Hi-Tek Ct., Mason, OH 45040, U.S.A.
TEL: 1-(888)-648-8869 FAX: 1-(513)754-0718

Detroit (Novi) Office / M^o Solution Center

46850 Magellan Drive, Suite 100, Novi, MI 48377, U.S.A.
TEL: 1-(888)-648-8869 FAX: 1-(248)-926-0928

Los Angeles (City of Industry) Office / M^o Solution Center

16925 E. Gale Ave., City of Industry, CA 91745, U.S.A.
TEL: 1-(888)-648-8869 FAX: 1-(626)369-3352

Charlotte (Huntersville) Office / M^o Solution Center

11515 Vanstory Dr., Suite 140, Huntersville, NC 28078, U.S.A.
TEL: 1-(888)-648-8869 FAX: 1-(704)875-9273

Boston (Marlborough) Office / M^o Solution Center

753 Forest Street, Suite 110, Marlborough, MA 01752, U.S.A.
TEL: 1-(888)648-8869 FAX: 1-(508)485-0782

Mitutoyo America Corporation Calibration Lab

965 Corporate Blvd., Aurora, IL 60502, U.S.A.
TEL: 1-(888)-648-8869 FAX: 1-(630)978-6477

Mitutoyo America Corporation CT-Lab Chicago

965 Corporate Blvd., Aurora, IL 60502, U.S.A.
TEL: 1-(888)-648-8869 FAX: 1-(630)-820-3418

Mitutoyo Research & Development America, Inc.

11533 NE 118th St., Kirkland, WA 98034-7111, U.S.A.
TEL: 1-(425)821-3906 FAX: 1-(425)821-3228

Mitutoyo Research & Development America, Inc. - California Office

16925 Gale Ave. City of Industry, CA 91745-1806 U.S.A.
TEL: 1-(425)821-3906 FAX: 1-(425)821-3228

Canada

Mitutoyo Canada Inc.

2121 Meadowvale Blvd., Mississauga, Ont. L5N 5N1., CANADA
TEL: 1-(905)821-1261 FAX: 1-(905)821-4968

Montreal Office

7075 Place Robert-Joncas Suite 129, Montreal, Quebec H4M 2Z2, CANADA
TEL: 1-(514)337-5994 FAX: 1-(514)337-4498

Brazil

Mitutoyo Sul Americana Ltda.

Head office / M^o Solution Center

Avenida Mimes n° 25 – Loteamento Multivias II, Jardim Ermida I, CEP 13212-216 Jundiá - SP, BRASIL
TEL: 55 (11) 5643-0004/0041

Filial Curitiba / M^o Solution Center

Rua Sergipe, n° 101, Sala A, Bairro Boneca do Iguauçu, São José dos Pinhais – Paraná – BRASIL CEP 83040120
TEL: 55 (41) 3534-1728

Argentina

Mitutoyo Sul Americana Ltda.

Argentina Branch / M^o Solution Center

Av. B. Mitre 891/899 – C.P. (B1603CQD) Vicente López –Pcia. Buenos Aires – ARGENTINA

TEL: 54 (11) 4730-1433 FAX: 54 (11) 4730-1411

Sucursal Cordoba / M^o Solution Center

Av. Ricchieri 2872 L.4 – B° Jardín – CP X5014OPJ Cordoba, ARGENTINA

TEL: 54 (351) 464-4125

Mexico

Mitutoyo Mexicana, S.A. de C.V.

Industria Eléctrica No.15, Parque Industrial, Naucalpan de Juárez, Estado de México C.P.53370, MÉXICO
TEL: 52 (01-55) 5312-5612 FAX: 52 (01-55) 5312-3380

Monterrey Office / M^o Solution Center

Blv. Interamericana No. 103, Parque Industrial FINSA, C.P. 66636 Apodaca, N.L., MÉXICO

TEL: 52(01-81) 8398-8227/8228/8242/8244

FAX: 52(01-81) 8398-8226

Tijuana Office / M^o Solution Center

Calle José María Velazco 10501-C, Col. Cd. Industrial Nueva Tijuana, C.P. 22500 Tijuana, B.C., MÉXICO

TEL: 52(01-664) 647-5024

Querétaro Office / M^o Solution Center

Av. Cerro Blanco No.500-1, Colonia Centro Sur, Querétaro, Querétaro, C.P. 76090, MÉXICO

TEL: 52(01-442)340-8018, 340-8019 and 340-8020

FAX: 52(01-442)340-8017

Mitutoyo Mexicana, S.A. de C.V. Querétaro Calibration

Laboratory

Av. Cerro Blanco 500 30 Centro Sur, Querétaro, Querétaro, C.P. 76090, MÉXICO

TEL: 52(01-442)340-8018, 340-8019 and 340-8020

FAX: 52(01-442)340-8017

Aguascalientes Office / M^o Solution Center

Av. Aguascalientes No. 622, Local 15 Centro Comercial El Cilindro Fracc. Pulgas Pandas Norte, C.P. 20138, Aguascalientes, Ags. MÉXICO

TEL: 52(01-449)174-4140 and 174-4143

Irapuato Office / M^o Solution Center

Boulevard a Villas de Irapuato No. 1460 L.1 Col. Ejido Irapuato C.P. 36643

Irapuato, Gto., MÉXICO

TEL: 52(01-462)144-1200 and 144-1400

Mitutoyo Corporation

20-1, Sakado 1-Chome, Takatsu-ku, Kawasaki-shi, Kanagawa 213-8533, Japan

Tel: +81 (0)44 813-8230 Fax: +81 (0)44 813-8231

Home page: <http://www.mitutoyo.co.jp/global.html>